Operating Instructions

PA-CONTROL MP

From version 5.27

Edition: September 2015

Article No.: 1067161

IEF-Werner GmbH
Wendelhofstraße 6
78120 Furtwangen - Germany
Phone: +49 (0)7723-925-0
Fax: +49 (0)7723-925-100
www.IEF-Werner.de
info@IEF-Werner.de

Modification history:

Document code	Date	Modification
MAN_EN_1006925_PAC_CPU4_R1a.doc	May 2014	Release of this english document. The German operating instructions MAN_DE_1039612_PAC-MP_D5i.doc served as a template.
MAN_EN_1006925_PAC_CPU4_R1b.doc	May 2015	Changing information about help for WINPAC *(see chapter 4.5.2.1, page 91)*
MAN_EN_1006925_PAC_CPU4_R1c.doc	September 2015	Updating the connecting voltages in chapter *1.4.1*, page *15*

The use of trademarks and trade names does not affect their legal status. These texts and examples were written with the utmost care. Nonetheless, errors cannot be ruled out. Special applications cases were not considered for the examples given. The use of the examples printed requires close checks on, for instance, the traverse distance or an acceleration value.

IEF-WERNER GmbH is neither legally responsible nor liable in any way for missing or erroneous information and its consequences.

IEF-Werner reserves the right to change or improve software or hardware or parts thereof, including the printed matter supplied or parts thereof, without prior notification.
All rights to copy (to photomechanical reproduction), even excerpts, are expressly reserved by IEF- WERNER GmbH.

We are always grateful for suggestions for improvements and notices of errors.

© September 2015, IEF-WERNER GmbH

Contents

1 Technical Short Information 11

1.1 Design of the Device 11

1.2 Declaration of Conformity 12

1.3 Safety Instructions 13

1.3.1 Connection Instructions 13

1.3.2 Ambient Conditions 14

1.3.3 Operating Instructions 14

1.4 Technical Data 15

1.4.1 Technical Data of the PA-CONTROL MP 15

1.4.2 Inputs and Outputs of the PA-CONTROL MP 16

1.4.2.1 Table of integrated inputs 16

1.4.2.2 Table of integrated outputs 16

1.4.2.3 Table of Inputs via CANbus 17

1.4.2.4 Table of Outputs via CANbus 18

1.4.2.5 Inputs and Outputs of the PA-CONTROL-MP (CANopen-Slave) 19

1.4.2.6 Inputs and Outputs of the LV-servoTEC 19

1.4.2.7 Inputs and Outputs of the IntelliMOT 20

1.4.2.8 Inputs and Outputs of the DunMOT 20

1.4.2.9 Inputs and Outpus of the flexmoTEC 21

1.4.2.10 Inputs and Outputs of the servoTEC S2 22

1.4.3 Rotary switches of the PA-CONTROL MP 23

1.4.4 Fitting dimensions 25

1.4.4.1 Outside measurements 25

1.4.4.2 Installation in a control cabinet 26

1.4.4.3 Installation depth 27

2 Operator Interface 28

2.1 The Keyboard 28

2.2 General Operation 30

2.2.1 Switch-on of PA-CONTROL 30

2.2.2 The Menu Principle 32

2.2.3 The Input Field 33

2.2.4 Entry of a Program Name 34

2.2.5 Selection of a Name from the Program List 35

2.2.6 Display System Errors 36

2.3 Menu Structure of PA-CONTROL 37

2.4 Automatic 38

2.5 Manual 38

2.5.1 Approaches to Reference Point 38

2.5.2 Move Axes manually via Front Plate 40
2.6 Programming 42
2.6.1 Display Program Directory 43
2.6.2 Create New Program 43
2.6.3 Altering an existing Program 44
2.6.4 Copy Program 44
2.6.5 Rename Program 44
2.6.6 Delete Program 45
2.6.7 Program Memory Occupancy 45
2.7 Diagnosis 46
2.7.1 Limit Switch / Stand-by 46
2.7.2 Inputs, Outputs, Flags 47
2.7.3 Real number register (R), Integer register (N) 49
2.7.4 CANopen 50
2.7.5 D-A Converter (CANopen) 51
2.8 Run Definitions 52
2.8.1 Start Program 52
2.8.2 Program at Stop 52
2.8.3 Program Start after Stop 53
2.8.4 Program at Malfunction 53
2.8.5 Heading 54
2.8.6 Initial-State-Program 54
2.8.7 Activation of Run Definition 54
2.8.8 Deletion of Assignments 54
2.9 Parameters 55
2.9.1 AS-i Parameters 56
2.9.1.1 Apply actual Configuration 56
2.9.1.2 Display Status 56
2.9.1.3 Activate automatic Programming 56
2.9.1.4 Change Mode 57
2.9.1.5 Display Configuration 57
2.9.1.6 Program Slave 57
2.9.1.7 Transfer Configuration to AS-i Master 58
2.9.2 Edit servoTEC Parameters 59
2.9.2.1 Display all 59
2.10 Basic Settings 60
2.10.1 Load System Parameter Default Values 60
2.10.2 Load Axis Parameter Default Values 60
2.10.3 Delete Program Memory 60
2.10.4 Reinitialize PA-CONTROL 61
2.10.5 Reinitialization for Devices without a Display and Keyboard 62
2.11 System Diagnosis 63

2.11.1 Display Hardware Configuration 63
2.11.2 Clock 64
2.11.3 Keyboard Test 64
2.11.4 System Diagnosis - Start Key Test 64
2.11.5 Key Switch Test 65
2.11.6 Test of the COM Port 65
2.12 Communication via Modem 66
2.12.1 Overview of the Modem Menu 66
2.12.2 Activate Connection 67
2.12.3 Display Connection Status 68
2.12.4 Terminate Connection 68
2.12.5 Edit Modem Settings 69
2.12.6 Select Modem Type 70
2.12.7 Examples of Communication Setup Sequences 71

3 Commands of the PA-CONTROL-Family 72

4 Startup 73
4.1 Important Information 73
4.2 Installation of a PA-CONTROL MP 73
4.2.1 Installation in a control cabinet 74
4.3 Electrical Installation of the PA-CONTROL MP 76
4.3.1 Wiring of the PA-CONTROL MP 77
4.3.2 Additional components 78
4.4 Connector Assignments 80
4.4.1 Inputs and outputs X3 80
4.4.2 Diagnosis port X2 82
4.4.3 Rotation Monitoring X1 83
4.4.4 Motor connector X10 83
4.4.5 Brake connector X9 84
4.4.6 Mains connector X11 84
4.4.7 CAN Bus X4 85
4.4.8 Profibus Option X5 85
4.5 Startup of the Function- and condition check of PA-CONTROL MP 86
4.5.1 Functional check of the device via keyboard 86
4.5.1.1 Parameter Settings 86
4.5.1.2 Creating a PNC program 86
4.5.1.3 Specification of the start program 88
4.5.1.4 Program execution 89
4.5.2 Functional check of the device with WINPAC 90
4.5.2.1 Creating a project folder 91
4.5.2.2 Parameters of the PA-CONTROL MP 92

4.5.2.3 Function and condition check 93
4.5.2.4 Error diagnosis 96
4.5.2.5 First Aid 97

5 Parameters 98
5.1 General Information on Parameters 98
5.1.1 Configuration Window 99
5.2 System Parameter 100
5.2.1 System Parameter Tab 100
5.2.1.1 Language 100
5.2.1.2 Autostart 100
5.2.1.3 Acces Level 101
5.2.2 System I/O Tab 102
5.2.2.1 External Start, Input-No. 102
5.2.2.2 External Stop, Input-No. 103
5.2.2.3 Manual Release, Input-No. 103
5.2.2.4 Standby, Output-No. 103
5.2.2.5 Malfunction, Output-No. 103
5.2.2.6 Activate Teleservice, Input-No. 103
5.2.2.7 Teleservice Connected, Output-No. 103
5.2.3 Run Definitions 104
5.2.3.1 Start Program 104
5.2.3.2 Program at Stop 105
5.2.3.3 Program Start after Stop 105
5.2.3.4 Program at Malfunction 106
5.2.3.5 Program in Basic Position (Program in Initial Position) 106
5.2.3.6 Heading 106
5.2.4 CANopen Control Console 107
5.3 Diagnosis 108
5.3.1 System and Diagnosis Port 108
5.3.2 Teleservice Tab 109
5.4 CANopen Bus Tab 110
5.5 RS232 Port Tab 111
5.5.1 COM1 Port 111
5.5.2 COM2 Port 111
5.6 Profibus Tab 112
5.7 Axis Parameters 113
5.7.1 Axis Parameter Tab 113
5.7.1.1 Release Mode 113
5.7.1.2 Turn on Advance Mode 114
5.7.1.3 Max. Position Deviation 114
5.7.1.4 Group Number, if Axis is moved 115

5.7.1.5 Synchronisation on Encoder 115
5.7.1.6 Get Position from Encoder 115
5.7.1.7 Aktivate Brake in State IDLE / SAFE 115
5.7.1.8 Unit 116
5.7.1.9 Gear Factor 116
5.7.1.10 Traversing Range (min.) 116
5.7.1.11 Traversing Range (max.) 116
5.7.2 Limit Switches / Approach to Reference Point 117
5.7.2.1 Axis Limit Switch exchanged 117
5.7.2.2 Limit Switch Type 117
5.7.2.3 Reference run 117
5.7.2.4 Distance of the Reference Switch Zero Point 117
5.7.2.5 Reference Offset 117
5.7.3 Limit Switches / Approach to Reference Point for Axis Type servoTEC Tab 118
5.7.3.1 Distance of the Reference Switch Zero Point 118
5.7.3.2 Reference Offset 118
5.7.3.3 Direction of Motion and Reference Traverse 118
5.7.4 Axis-I/O 119
5.7.4.1 STOP-Axis Input-No 119
5.7.4.2 START-Axis Input-No 119
5.7.4.3 OFF-Axis Input-No 120
5.7.4.4 ON-Axis Input-No 120
5.7.4.5 ON-Axis Delay time 120
5.7.4.6 OFF-Axis Delay time 120
5.7.4.7 HALT Output-No 120
5.7.4.8 IDLE / SAFE Output-No 121
5.7.4.9 AXIS-PUT-SAFE 121
5.8 Travers Parameters 122
5.8.1 Travers Parameters Menu 122
5.8.1.1 Traversing Speed 122
5.8.1.2 Reference Speed 122
5.8.1.3 Manual Speed 122
5.8.1.4 Creep Speed 122
5.8.1.5 Start/stop Rotational Speed 123
5.8.1.6 Acceleration 123
5.8.1.7 Ramp Type (Acceleration) 123
5.8.1.8 OFF-Ramp 123
5.8.2 Motor 124
5.8.2.1 Invert Direction of Rotation 124
5.8.2.2 Motor Increments per Rotation 124
5.8.3 Gantry 125
5.8.3.1 Gantry mode 125

5.8.3.2 Gantry Limit Switch, Input-No. 125
5.8.3.3 Gantry Limit Switch, Output-No. 125
5.8.4 Limit values of the axis parameters 126
5.9 Drive Parameters Stepper Motor Axis 128
5.9.1 Motor Parameters of a Stepper 128
5.9.1.1 Motor Phase Current 128
5.9.1.2 Motor Phase Current at Rest (Standstill) 128
5.9.1.3 Invert Direction of Rotation 128
5.9.1.4 Motor Steps per Revolution 128
5.9.1.5 Motor Full Steps per Revolution 128
5.9.1.6 Rotation Monitoring active 128
5.9.1.7 Invert Rotary Encoder 129
5.9.1.8 Resolution of the Rotary Encoder 129
5.10 Drive Parameters servoTEC S2 Axis 130
5.10.1 Drive Parameters of servoTEC 131
5.10.1.1 Drive Parameters for Positioning 131
5.10.1.2 Drive Parameters for Position Controller 132
5.10.1.3 Drive Parameters for Speed Controller 133
5.10.1.4 Drive Parameters for Current Controller 134
5.10.1.5 Drive Parameters for Motor 135
5.10.1.6 Drive Parameters for Feedback 136
5.10.1.7 Drive Parameters for Basic Settings 137
5.10.2 Drive Parameters flexmoTEC 138
5.10.2.1 Feedback 138
5.10.3 Drive Parameters intelliMOT 139
5.10.4 Drive Parameters dunMOT 140
5.11 Parameter Calculation 141
5.11.1 Gear Factor 141
5.11.2 Traversing Speed 142

6 Options 143
6.1 Options of the PA-CONTROL MP 143
6.2 Plug-in connections of the PA-CONTROL MP 143
6.3 Rotary switches of the PA-CONTROL MP 144
6.4 CANopen Interface 145
6.4.1 CANopen Devices with a permanent Assignment 145
6.4.2 CANopen Devices without a permanent Assignment 145
6.4.3 Overview of the CAN IDs 146
6.5 RS 232 Port Driver 147
6.6 IEF Module RS 232 Port 148
6.7 IEF Module Profibus DP 149
6.8 IEF Module A-D Converter 150

6.9 IEF Control Console 151
6.9.1 General 151
6.9.2 IEF Control Console - Version for Panel Mounting 154
6.9.3 IEF Control Console - Standard Version 155
6.10 IEF-Touch-Screen Console via CANopen Bus 156
6.10.1 CAN Addresses and Monitoring 156
6.10.2 TSwin Configuring Software 157
6.10.2.1 Directory Structure for Storage of the IEF Templates 157
6.10.2.2 New Project with IEF Template 157
6.10.2.3 CAN Bus Settings with the TSwin Configuring Software 158
6.10.3 List of Variables in the Control Console 159
6.10.3.1 Object List through Access of the Data of PA-CONTROL 161
6.10.4 Serial Signalling System with Polling Range 167
6.10.4.1 Coordination Byte 168
6.10.4.2 Write Coordination Byte 168
6.10.5 Read Coordination Byte 169
6.10.5.1 Serial Signalling Channel 170
6.10.5.2 LEDs of Function Keys 170
6.10.6 Parallel Signaling System 172
6.10.6.1 Date and Time 174
6.10.7 Simulation of the PA-CONTROL Front Plate 175
6.10.7.1 Key code for cursor keys 177

7 Technical Annex 178
7.1 Messages of PA-CONTROL 178
7.1.1 Status and operational Status Messages 179
7.1.2 Error and Fault Signals 180
7.1.2.1 CPU error messages: 180
7.1.2.2 System error Hardware Part 1: 181
7.1.2.3 System error RAM contents group: 183
7.1.2.4 Field bus error messages: 183
7.1.2.5 AS-i system error and CMD error messages: 184
7.1.2.6 CANopen bus, Communication errors / Warnings Part 1: 185
7.1.2.7 CANopen bus error axis (servoTEC) Part 1: 187
7.1.2.8 Error messages in automatic mode Part 1: 192
7.1.2.9 Communication errors: 195
7.1.2.10 Errors of the absolute dimension system: 196
7.1.2.11 CANopen LV-servoTEC error: 196
7.1.2.12 Fehlermeldungen zu den Gantry-Achsen 197
7.1.2.13 PLS7- Run error message 198
7.2 Basic board 199
7.2.1 Power supply unit 200

7.2.2 Logic power supply unit 200
7.2.3 Fuses 200
7.3 Connector assignments 201
7.3.1 Encoder connection X1 202
7.3.2 Diagnosis port (X2) 203
7.3.3 Inputs and outputs (X3) 204
7.3.3.1 Digital outputs 204
7.3.3.2 Digital inputs 204
7.3.4 CANopen interface X4 205
7.3.5 IEF module (X5, X6, X8) 206
7.3.6 Brake connector X9 206
7.3.7 Motor connector (X10) 207
7.3.8 Mains connector X11 208
7.4 Overview of accessories and spare parts 209
7.4.1 List of accessories and spare parts 210
7.5 Service 212
7.5.1 Exchange of the battery on the CPU board 212
7.6 Outside measurements 213
7.7 PA-CONTROL key code (+ ASCII character set to ISO/IEC 8859-15) 214

1 Technical Short Information

1.1 Design of the Device

The PA-CONTROL MP is a one-axis stepping motor control system. The device is designed for wall mounting in switch cabinets. The device has a separate power supply for the system (24VDC) and the motor (230VAC).

Performance features:

- Comprehensive, high-performance command set
- Combines the advantages of NC-controls with those of an SPC
- 1 stepping motor output stage, 2 phases, maximum 12A phase current 90V
- Brake control
- Rotary encoder connection facility
- 12 opto-decoupled inputs, of which 2 are limit switch inputs
- 8 opto-decoupled outputs
- Processing of I/O is possible during positioning
- 1 serial diagnosis port RS232
- 31 parallel programs with subroutine technology
- Can be extended via CANopen bus by up to
  - 15 axes
  - 1024 inputs and outputs
  - 8 A-D converters,
  - 8 D-A converters

Options

- IEF control console
- SÜTRON CANopen control console
- WINPAC software package
- The following IEF modules:

IEF module	Slot 1	Slot 2
RS232	x	x
IEF A-D converter	x	x
PROFIBUS		x
SSI	x	x

The PA-CONTROL MP can either be programmed by means of the WINPAC software package or via the IEF control console. The IEF control console is composed of a complete alphanumeric keyboard and a 2-line illuminated LC display (2*40 characters). A key-operated switch on the IEF control console prevents unauthorised access.

The WINPAC software package enables comfortable online diagnosis, manual operation, and offline programming.

The following description refers to a PA-CONTROL MP operated by the WINPAC software package. Please refer to *section* IEF Control Console*, page 151 onwards* of these operating instructions for a description of operation using the IEF control console.

1.2 Declaration of Conformity

IEF-Werner GmbH
Wendelhofstraße 6
D-78120 Furtwangen
Telephone: +49 (0)7723 /925-0
Telefax: +49 (0)7723/925-100

We hereby declare that the products referred to in the following

Designation of the products	Product nos.
PA-CONTROL-Single	1000244
PA-CONTROL-Compact	1000245
PA-CONTROL-Steuergerät	1000243
PA-CONTROL-MP	1000759
PA-CONTROL-servoTEC	1000598
PA-CONTROL smart	1000927

are intended for installation in a machine. The initial plant start-up is prohibited until it has been ascertained that the machine in which these products are to be installed complies with the provisions of EC Directive 91/368/EEC

The following standards were applied :

89/336/EEC	Electromagnetic Compatibility
EN 50081-1	Generic Emission Standard
EN 50082-2 pr EN 50082-1 pr EN 50082-2	Generic Immunity Standard

Test procedures:

IEC 801-2 / Level 3	Immunity against Electrostatic Discharges (ESD)
IEC 801-3 / Level 3	Immunity against Electrostatic Fields
IEC 801-4 / Level 3	Immunity against Fast Transients (Burst)
IEC 801-5 / Level 3	Immunity against Surge Voltages (Surge)
EN 55011 / Class B	Limits and Methods of Measurement of Radio Disturbance Characteristics

Furtwangen, 01.08.2006 (Manfred Bär, managing director)

This declaration does not include a guarantee of properties. The safety and protection information in the operating manual must always be followed.
IEF-Werner GmbH has the following technical documentation available for inspection:

	User	EU authorities
• Operating manual	X	X
• Operator software	X	X
• Plans / software source code		X
• Description of the measures to guarantee conformity		X
• Test records		X
• Other technical documentation		X

1.3 Safety Instructions

Observe the instructions and warnings contained in the operating instructions. These are identified as follows:

WARNING

If these instructions and warnings are disregarded, hazards may arise from dangerous electrical voltages.

CAUTION

This sign indicates warnings and information about general hazards

NOTE Offers additional information.

1.3.1 Connection Instructions

WARNING

Wait until the capacitors have fully discharged (discharge period)

After disconnecting the control system, the condensers are charged with a high voltage for a short period of time. Do not handle the device until 5 minutes after switching it off.

Installation and start-up should only be carried out by qualified personnel.

Observe the general installation regulations for assembling and operating electrical operating systems (EN 60204).

Protective equipment for humans and machine should comply with local conditions and regulations.

Do not connect or disconnect power or control cables while the control system is still connected to the mains.

Plugs may only be connected and/or removed when voltage-free.

Control and power lines must be laid separately (ca 10 cm apart).

Protective system IP 20.

WARNING

The controller must be de-energized when carrying out assembly, disassembly and repair work or replacing individual components or switching over the operating voltage

1.3.2 Ambient Conditions

The limit values for the ambient temperature (min. 0°C to max. 40°C) must be adhered to.

No mist or water may be allowed to enter the controller.

Dust must be prevented from entering the controller.

The controller must be protected from aggressive gases and liquids.

Ensure that air can circulate freely (air inlet and outlet ports must be kept free).

1.3.3 Operating Instructions

CAUTION

It is imperative that the parameter values are checked for compliance with the actual conditions.

When using the program examples contained in the operating instructions, always check whether the program can be implemented on the machine in question.

1.4 Technical Data

1.4.1 Technical Data of the PA-CONTROL MP

Dimension	Value
Ambient temperature	(0 to 40) °C
Connecting voltages	(180 to 263) VAC, 50 / 60 Hz 24VDC, +/-10% for the system
Power consumption:	max. 500VA
Power loss:	max. 50VA
2 limit switch inputs:	Opto-decoupled 24VDC Typ. current 5mA Low level (0 - 3) VDC High level (10 - 30) VDC
10 inputs	Opto-decoupled 24VDC Typ. current 5mA Low level (0 - 3) VDC High level (10 - 30) VDC
8 outputs	Opto-decoupled switching positive 24 VDC / 0.5A (ohmic load)
1 serial diagnoses port	RS 232, (only for PC with WINPAC)
Data security	Lithium battery (> 5 years)
Protection type:	IP20
Fitting dimensions W x H x D:	(100 x 356 x 241) mm
Weight:	5.5 kg

1.4.2 Inputs and Outputs of the PA-CONTROL MP

Users of a PA-CONTROL theoretically have 2048 inputs and outputs available. As a result of their specified task and their physical features, the IEF controllers CPU4, CPU5 and MP allow the use of expansion cards as well as ASi buses or expansion via CANopen expansion modules. The theoretical maximum therefore differs in practice owing to the possible configurations. The available inputs and outputs can be used in a variety of ways.

1.4.2.1 Table of integrated inputs

Input number	Use	Special application
1 – 10	Inputs for diverse applications	
11 - 12		Limit switches
13 - 16	Exclusive internal applications	

1.4.2.2 Table of integrated outputs

Output number	Use	Special application
1 - 8	Outputs for diverse applications	

A maximum of 16 axes can be connected to a PA-CONTROL via CANopen bus.

Any axis connected via CANopen bus extends the number of available inputs and outputs as per the table below. Only the inputs and outputs of existing axes are available. The numbering starts with the next available axis.

1.4.2.3 Table of Inputs via CANbus

Input-Number	Use	Special application
721 – 736	Axis 1	look I/O-Table type of Axis
737 – 752	Axis 2	look I/O-Table type of Axis
753 – 768	Axis 3	look I/O-Table type of Axis
769 – 784	Axis 4	look I/O-Table type of Axis
785 – 800	Axis 5	look I/O-Table type of Axis
801 – 816	Axis 6	look I/O-Table type of Axis
817 – 832	Axis 7	look I/O-Table type of Axis
833 – 848	Axis 8	look I/O-Table type of Axis
849 – 864	Axis 9	look I/O-Table type of Axis
865 – 880	Axis 10	look I/O-Table type of Axis
881 – 896	Axis 11	look I/O-Table type of Axis
897 – 912	Axis 12	look I/O-Table type of Axis
913 – 928	Axis 13	look I/O-Table type of Axis
929 – 944	Axis 14	look I/O-Table type of Axis
945 – 960	Axis 15	look I/O-Table type of Axis
961 – 976	Axis 16	look I/O-Table type of Axis
977 – 992	NOP	
993 – 1008	NOP	
1009 - 1024	NOP	
1025 - 1729	Inputs via CANopen-I/O-Modul	
1730 – 2048	NOP	

1.4.2.4 Table of Outputs via CANbus

Output-Number	Use	Special application
721 – 736	Axis 1	look I/O-Table type of Axis
737 – 752	Axis 2	look I/O-Table type of Axis
753 – 768	Axis 3	look I/O-Table type of Axis
769 – 784	Axis 4	look I/O-Table type of Axis
785 – 800	Axis 5	look I/O-Table type of Axis
801 – 816	Axis 6	look I/O-Table type of Axis
817 – 832	Axis 7	look I/O-Table type of Axis
833 – 848	Axis 8	look I/O-Table type of Axis
849 – 864	Axis 9	look I/O-Table type of Axis
865 – 880	Axis 10	look I/O-Table type of Axis
881 – 896	Axis 11	look I/O-Table type of Axis
897 – 912	Axis 12	look I/O-Table type of Axis
913 – 928	Axis 13	look I/O-Table type of Axis
929 – 944	Axis 14	look I/O-Table type of Axis
945 – 960	Axis 15	look I/O-Table type of Axis
961 – 976	Axis 16	look I/O-Table type of Axis
977 – 992	NOP	
993 – 1008	NOP	
1009 - 1024	NOP	
1025 - 1729	Inputs via CANopen-I/O-Modul	
1730 – 2048	NOP	

1.4.2.5 Inputs and Outputs of the PA-CONTROL-MP (CANopen-Slave)

Axis 1	Axis 2	Axis 3	Axis 4	Axis 5 -16	Input	Output
I/O 721	I/O 737	I/O 753	I/O 769		I1	O1
I/O 722	I/O 738	I/O 754	I/O 770		I2	O2
I/O 723	I/O 739	I/O 755	I/O 771		I3	O3
I/O 724	I/O 740	I/O 756	I/O 772		I4	O4
I/O 725	I/O 741	I/O 757	I/O 773		I5	O5
I/O 726	I/O 742	I/O 758	I/O 774		I6	O6
I/O 727	I/O 743	I/O 759	I/O 775		I7	O7
I/O 728	I/O 744	I/O 760	I/O 776		I8	O8
I/O 729	I/O 745	I/O 761	I/O 777		I9	-
I/O 730	I/O 746	I/O 762	I/O 778		I10	-
I/O 731	I/O 747	I/O 763	I/O 779		I11, negative limit switch	-
I/O 732	I/O 748	I/O 764	I/O 780		I12, positive limit switch	-
I/O 733	I/O 749	I/O 765	I/O 781		-	-
I/O 734	I/O 750	I/O 766	I/O 782		-	-
I/O 735	I/O 751	I/O 767	I/O 783		-	-
I/O 736	I/O 752	I/O 768	I/O 784		-	-

1.4.2.6 Inputs and Outputs of the LV-servoTEC

Axis 1	Axis 2	Axis 3	Axis 4	Axis 5 -16	Input	Output
I/O 721	I/O 737	I/O 753	I/O 769		Digital IN 1	-
I/O 722	I/O 738	I/O 754	I/O 770		Digital IN 2, (reference switch)	-
I/O 723	I/O 739	I/O 755	I/O 771		Digital IN 3, PSTOP	-
I/O 724	I/O 740	I/O 756	I/O 772		Digital IN 4, NSTOP	-
I/O 725	I/O 741	I/O 757	I/O 773		ENABLE	-
I/O 726	I/O 742	I/O 758	I/O 774		-	-
I/O 727	I/O 743	I/O 759	I/O 775		-	-
I/O 728	I/O 744	I/O 760	I/O 776		-	-
I/O 729	I/O 745	I/O 761	I/O 777		-	-
I/O 730	I/O 746	I/O 762	I/O 778		-	-
I/O 731	I/O 747	I/O 763	I/O 779		-	-
I/O 732	I/O 748	I/O 764	I/O 780		-	-
I/O 733	I/O 749	I/O 765	I/O 781		-	-
I/O 734	I/O 750	I/O 766	I/O 782		-	-
I/O 735	I/O 751	I/O 767	I/O 783		-	-
I/O 736	I/O 752	I/O 768	I/O 784		-	-

1.4.2.7 Inputs and Outputs of the IntelliMOT

Axis 1	Axis 2	Axis 3	Axis 4	Axis 5 -16	Input	Output
I/O 721	I/O 737	I/O 753	I/O 769		-	-
I/O 722	I/O 738	I/O 754	I/O 770		-	-
I/O 723	I/O 739	I/O 755	I/O 771		-	-
I/O 724	I/O 740	I/O 756	I/O 772		-	-
I/O 725	I/O 741	I/O 757	I/O 773		-	-
I/O 726	I/O 742	I/O 758	I/O 774		-	-
I/O 727	I/O 743	I/O 759	I/O 775		-	-
I/O 728	I/O 744	I/O 760	I/O 776		-	-
I/O 729	I/O 745	I/O 761	I/O 777		-	-
I/O 730	I/O 746	I/O 762	I/O 778		-	-
I/O 731	I/O 747	I/O 763	I/O 779		-	-
I/O 732	I/O 748	I/O 764	I/O 780		-	-
I/O 733	I/O 749	I/O 765	I/O 781		-	-
I/O 734	I/O 750	I/O 766	I/O 782		-	-
I/O 735	I/O 751	I/O 767	I/O 783		-	-
I/O 736	I/O 752	I/O 768	I/O 784		-	-

1.4.2.8 Inputs and Outputs of the DunMOT

Axis 1	Axis 2	Axis 3	Axis 4	Axis 5 -16	Input	Output
I/O 721	I/O 737	I/O 753	I/O 769		IN 0	-
I/O 722	I/O 738	I/O 754	I/O 770		IN 1	-
I/O 723	I/O 739	I/O 755	I/O 771		IN 2	-
I/O 724	I/O 740	I/O 756	I/O 772		IN 3	-
I/O 725	I/O 741	I/O 757	I/O 773		IN 4	-
I/O 726	I/O 742	I/O 758	I/O 774		-	-
I/O 727	I/O 743	I/O 759	I/O 775		-	-
I/O 728	I/O 744	I/O 760	I/O 776		-	-
I/O 729	I/O 745	I/O 761	I/O 777		-	-
I/O 730	I/O 746	I/O 762	I/O 778		-	-
I/O 731	I/O 747	I/O 763	I/O 779		-	-
I/O 732	I/O 748	I/O 764	I/O 780		-	-
I/O 733	I/O 749	I/O 765	I/O 781		-	-
I/O 734	I/O 750	I/O 766	I/O 782		-	-
I/O 735	I/O 751	I/O 767	I/O 783		-	-
I/O 736	I/O 752	I/O 768	I/O 784		-	-

1.4.2.9 Inputs and Outpus of the flexmoTEC

Axis 1	Axis 2	Axis 3	Axis 4	Axis 5 -16	Input	Output
I/O 721	I/O 737	I/O 753	I/O 769		X4.3	-
I/O 722	I/O 738	I/O 754	I/O 770		X4.4	-
I/O 723	I/O 739	I/O 755	I/O 771		X4.5	-
I/O 724	I/O 740	I/O 756	I/O 772		X4.6	-
I/O 725	I/O 741	I/O 757	I/O 773		X4.7, (reference switch)	-
I/O 726	I/O 742	I/O 758	I/O 774		X4.8, (limit switch- / out)	-
I/O 727	I/O 743	I/O 759	I/O 775		X4.9, (limit switch+ / in)	-
I/O 728	I/O 744	I/O 760	I/O 776		X4.10	-
I/O 729	I/O 745	I/O 761	I/O 777		-	-
I/O 730	I/O 746	I/O 762	I/O 778		-	-
I/O 731	I/O 747	I/O 763	I/O 779		-	-
I/O 732	I/O 748	I/O 764	I/O 780		-	-
I/O 733	I/O 749	I/O 765	I/O 781		-	-
I/O 734	I/O 750	I/O 766	I/O 782		-	-
I/O 735	I/O 751	I/O 767	I/O 783		-	-
I/O 736	I/O 752	I/O 768	I/O 784		-	-

1.4.2.10 Inputs and Outputs of the servoTEC S2

Axis 1	Axis 2	Axis 3	Axis 4	Axis 5 -16	Input	Output
I/O 721	I/O 737	I/O 753	I/O 769		DIN 0 [X1:19]	OUT 0 [X1:24]
I/O 722	I/O 738	I/O 754	I/O 770		DIN 1 [X1:7]	OUT 1 [X1:12]
I/O 723	I/O 739	I/O 755	I/O 771		DIN 2 [X1:20]	OUT 2 [X1:25]
I/O 724	I/O 740	I/O 756	I/O 772		DIN 3 [X1:8]	OUT 3 [X1:13]
I/O 725	I/O 741	I/O 757	I/O 773		DIN 8 [X1:23]	-
I/O 726	I/O 742	I/O 758	I/O 774		DIN 9 [X1:11]	-
I/O 727	I/O 743	I/O 759	I/O 775		-	-
I/O 728	I/O 744	I/O 760	I/O 776		-	-
I/O 729	I/O 745	I/O 761	I/O 777		DIN 6 [X1:22], limit switch negative	-
I/O 730	I/O 746	I/O 762	I/O 778		DIN 7 [X1:10], limit switch positive	-
I/O 731	I/O 747	I/O 763	I/O 779		-	-
I/O 732	I/O 748	I/O 764	I/O 780		Interlock, no Controller enable (DIN 5) or no Power stage enable (DIN 4)	-
I/O 733	I/O 749	I/O 765	I/O 781		-	-
I/O 734	I/O 750	I/O 766	I/O 782		-	-
I/O 735	I/O 751	I/O 767	I/O 783		-	-
I/O 736	I/O 752	I/O 768	I/O 784		-	-

1.4.3 Rotary switches of the PA-CONTROL MP

The addresses or the transmission properties can be set for the following optional expansions of PA-CONTROL:

- Port RS 232
- Profibus DP
- CANopen Slave

This function is implemented by means of the rotary switches on the front plate.

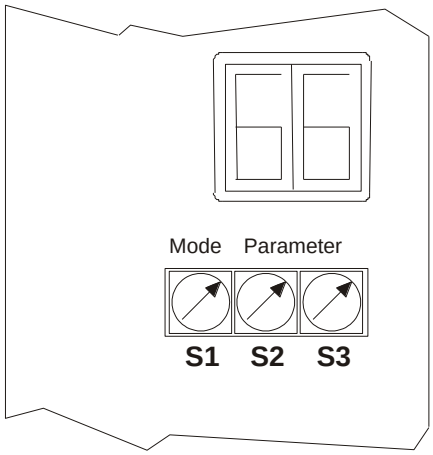

Figure 1: Rotary switches of the PA-CONTROL MP

The information set by means of S2 and S3 is assigned to a specific IEF module by means of rotary switch S1.

S1		S2	S3
Mode		**Parameter**	
0	PA-CONTROL operates as a standard device in the AUTOMATIC or ONLINE mode	---	---
1	PA-CONTROL operates as a standard device in the AUTOMATIC or ONLINE mode	The settings of S2 and S3 are transferred as an address for Profibus DP. **S2=10^1** **S3=10^0**	
2	PA-CONTROL enters the CANopen slave mode	The settings of S2 and S3 are transferred as a CANOpen ID = axis number. **S2=10^1** **S3=10^0**	
3	The PA-CONTROL operates as a standard device in the AUTOMATIC or ONLINE mode COM 1 port is switched over to "ONLINE CMD".	The settings of S2 and S3 are used for initialization of COM 1 port. See table "*Meaning of the parameter switches " on page 24* for baud rate, format, etc.	

Please refer to the document "Manual for IEF ports" for additional information on switch stages 1 and 3.

Meaning of the parameter switches S2 and S3

Switch S2		Switch S3	
Position	Meaning	Position	Meaning
1	8 data bits, 1 stop bit, no parity, CTS inactive	1	110 baud
2	7 data bits, 1 stop bit, no parity, CTS inactive	2	300 baud
3	7 data bits, 1 stop bit, even parity, CTS inactive	3	1200 baud
4	7 Datenbits, 1 stopp bit, odd parity, CTS inactive	4	2400 baud
5	8 data bits, 1 stop bit, no parity, CTS inactive	5	4800 baud
6	7 data bits, 1 stop bit, no parity, CTS inactive	6	9600 baud
7	7 data bits, 1 stop bit, even parity, CTS inactive	7	19200 baud
8	7 data bits, 1 stop bit, odd parity, CTS inactive	8	38400 baud

1.4.4 Fitting dimensions

1.4.4.1 Outside measurements

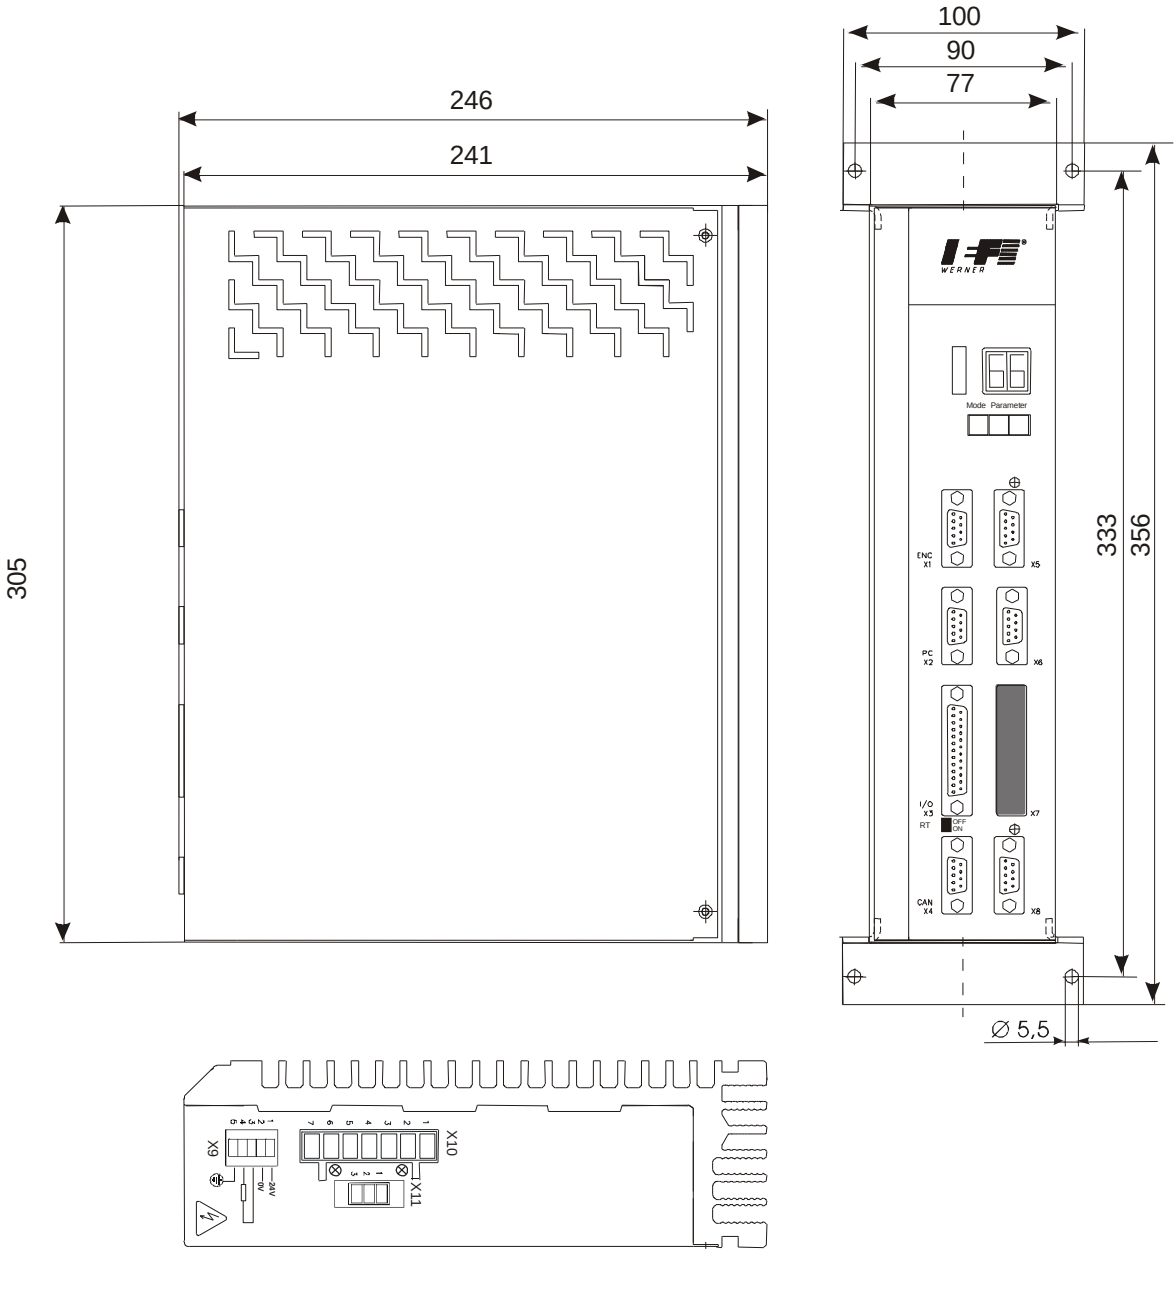

Figure 2: Outside measurements

1.4.4.2 Installation in a control cabinet

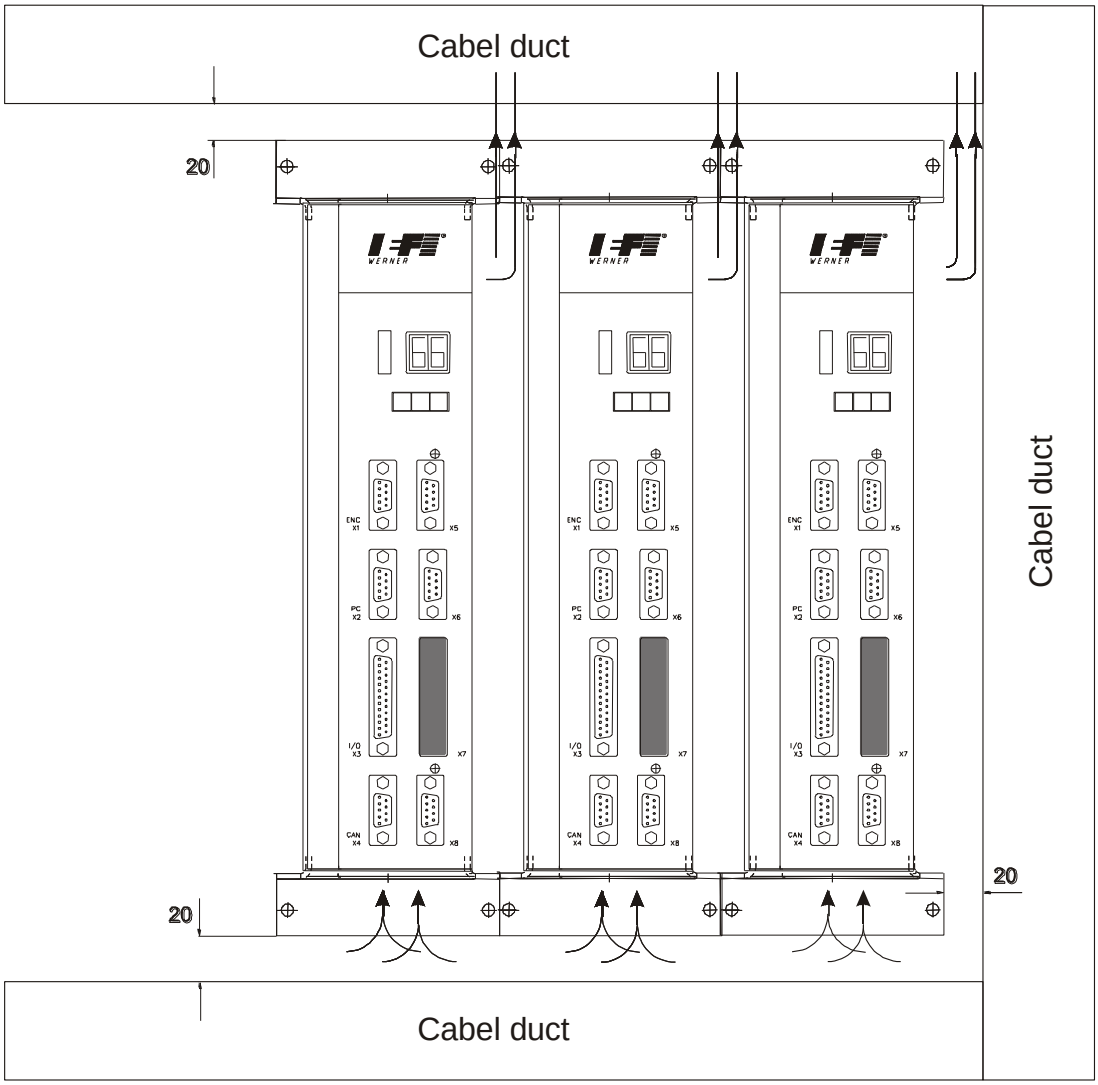

BILD806E

Figure 3: Ventilation in the case of installation in a control cabinet

1.4.4.3 Installation depth

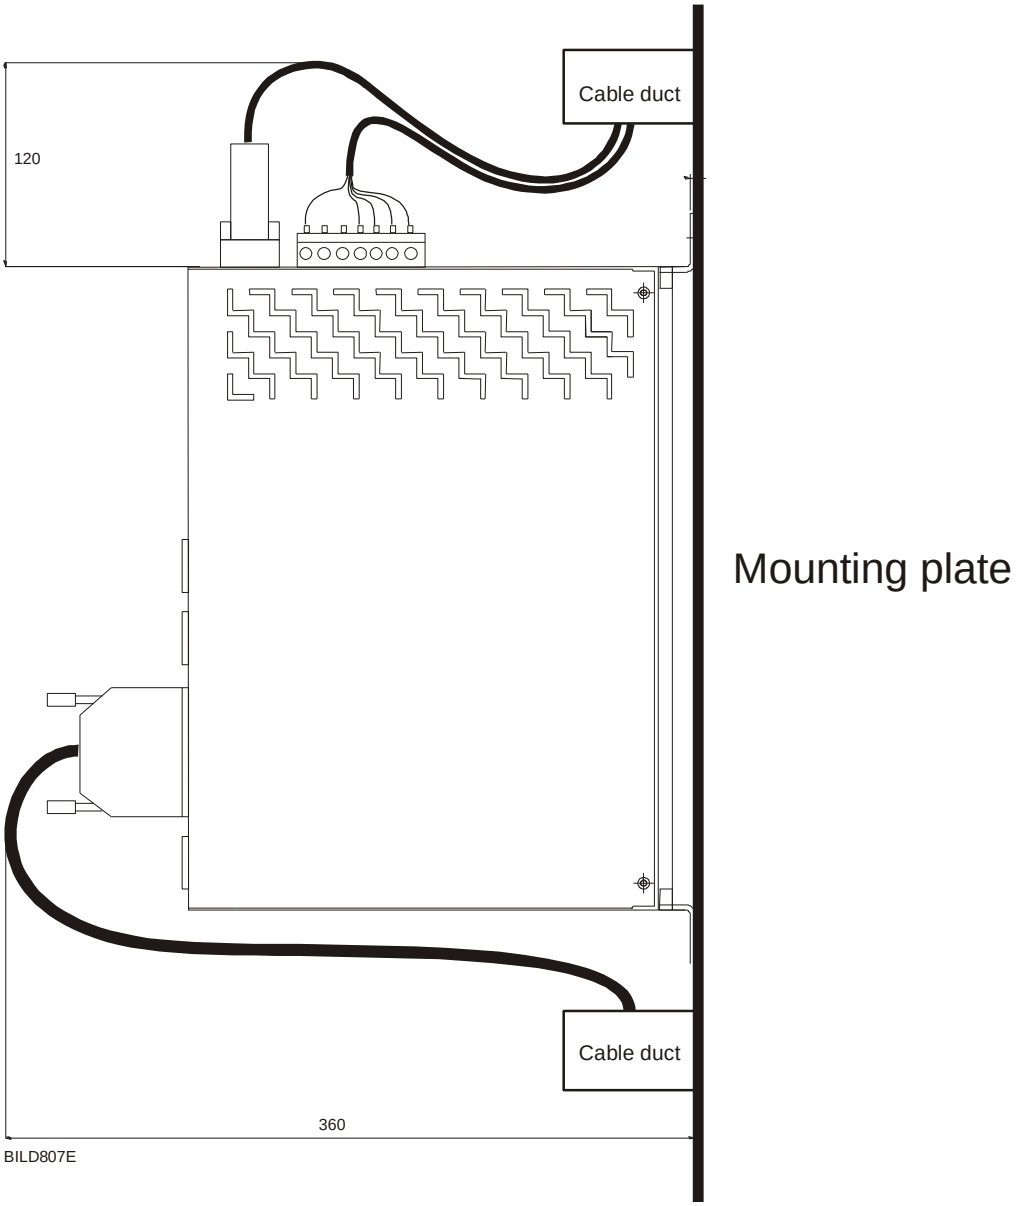

Figure 4: Prescribed Installation depth for installation in a control cabinet

2 Operator Interface

2.1 The Keyboard

NOTE

In principle, each variant of PA-CONTROL can be operated with or without a keyboard.
While the ex works equipment of PA-CONTROL Single, Compact and Steuer usually includes a keyboard integrated in the front panel, this possibility is not provided for the PA-CONTROL servoTEC or PA-CONTROL MP versions.
However, these controllers can also be provided with this convenient display and input output tool through connection of the optional IEF control console (see csection *6.9: IEF Control Console, page 151* onwards).

As an alternative to connection of the IEF control, a control console can be connected via CANopen bus. The front plate of PA-CONTROL can be simulated by means of this console.

Figure 1: The Keyboard of PA-CONTROL

The key of the key-operated switch has been removed. This is only possible in the vertical position. As a result, PA-CONTROL is in the "Automatic" mode. Other modes are only accessible with the key inserted (i.e. in the horizontal position). The diagnosis port is located at the bottom left.

PA-CONTROL has a complete alphanumeric keyboard (0-9, A-Z). There are also several special keys, whose functions are described in the following:

Special key	Name	Function
ESC	ESC key	Exit sub-menu, cancel input field
ALT	ALT key	no function assigned
CTRL	CTRL key	no function assigned
SHIFT	SHIFT key	Double assignment of keys, auxiliary key for cursor keys
↓	Arrow down key	Scrolling in the menu to next line (with autorepeat)
↑	Arrow up key	Scrolling in the menu to previous line (with autorepeat)
→	Arrow right key	Cursor one character to the right in the input field (with autorepeat)
←	Arrow left key	Cursor one character to the left (with autorepeat)
	Space bar	Inserts space in the editor
ENTER	Enter key	End input, end line in the editor, insert new line
INS	INS key	no function assigned
DEL	DEL key	Deletes the character on which the cursor is positioned
START	Start key	Starts automatic mode
STOP	Stop key	Stops automatic mode
Automatic | **Program**	Key-operated switch	Access lock for front plate (the key is removable in the position shown, only "Automatic" is possible)

2.2 General Operation

NOTE The menu structure differs depending on the equipment of the controller or the device type.

2.2.1 Switch-on of PA-CONTROL

After PA-CONTROL has been switched on, it first of all checks the hardware configuration. The extent of this check, and therefore also the messages which may be displayed, obviously depends on the configuration of PA-CONTROL. If a change is discovered, the following is displayed:

```
E127: Axis 1: new axis detected
Error Reset?              1=yes
```

If 1 is entered, i.e. Error Reset, PA-CONTROL displays the following menu:

```
System error – RE-Initialize
1 = reset error on system
```

```
2 = display list of errors
3 = display hardware configuration
4 = Communication via modem
```

NOTE With the key „SHIFT“ and „9“ and the key-operated switch in the position "Program" you may do RE-initialize of the PA-CONTROL.

```
Really  re-initialize PA-CONTROL
1  =  yes  /  key  =  no
```

```
delete all program and parameters ?
no = <ESC>   /   yes = <ENTER>
```

If the hardware configuration is correct, the devices on the CANopen bus are checked in the next step. The following is displayed during this check:

```
wait until all axis initialized
```

If an error occurs during the initialization, e.g. CAN axes not connected or a cable error, the following message is displayed after approx. 10s.

```
A 1: Time-Out during wait for axis
1 =  repeat
```

```
2 = Cancel, continue without this axis
3 = Cancel all, continue without axes
```

After successful initialization, a check of the parameters for all the axes in an LV-servoTEC is carried out. If this check finds any differences, the following error message appears on the display, and the flashing 7-segment display on the LV-servoTEC also provides information about the error.

```
A1 : Parameters different
1 = Send to all axes
```

```
2 = Ignore for all axes
3 = Accept from all axes
4 = Ignore for this axis
5 = Accept parameters from axis
```

As a rule, the main menu appears on the display at the end of the switch-on sequence:

```
           PA-CONTROL  4.xx
1 = Automatic                          →
```

The operator interface of PA-CONTROL is arranged in a menu structure. The structure and handling of the main menu and the various sub-menus are based on the same principle.

2.2.2 The Menu Principle

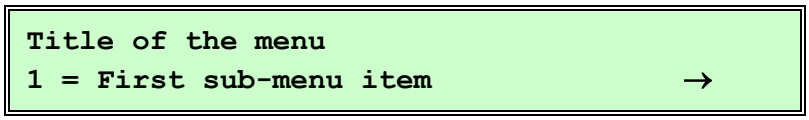


```
2 = Second sub-menu item
3 = Third sub-menu item
...
...
9 = Ninth sub-menu item
```

The number of menu sub-options in the individual menus was customized to the respective requirements and restricted accordingly. If an arrow is displayed on the far right of the second line, a secondary menu item is available in this menu.

Since only two lines are available on the display, only the title of the current menu and one of the menu sub-options is displayed in each case.

Navigating through the menu interface:

Key:	Action/effect:
Arrow down/Arrow right	next menu sub-option is displayed
Arrow up	previous menu sub-option is displayed
SHIFT + Arrow up	first menu sub-option is displayed
SHIFT + Arrow down	last menu sub-option is displayed
ENTER	The displayed menu sub-option is activated
ESC	Sub-menu is exited and the previous menu returned to (the first menu line is displayed in the main menu)

The input of the number prefixed to the menu item is another way of activating a menu item.

2.2.3 The Input Field

If the user is requested to enter a numerical value (parameter value, register value, or similar), an input field appears on the display.

The input field is bounded by two square brackets [_.....]. The current value and cursor are located between these two brackets (blinking field in the display).

The user can update the entry by pressing the relevant keys.

Assignment of the keys in the input field:

Key:	Reaction/effect:
Arrow left	Cursor one character to the left
Arrow right	Cursor one character to the right
SHIFT + DEL	Deletes character on the left of the cursor
DEL	Deletes character on which the cursor is positioned
ENTER	Conclusion of an entry; the entered value is checked and accepted if it is within the permitted limits. If is below or exceeds the limits, an error message is output and a new input expected.
ESC	Cancellation of the input, the old value is retained

2.2.4 Entry of a Program Name

If the controller expects the entry of a program name, the following appears in the display:

```
Please enter a new program name!
[ _                   ]
```

The cursor (blinking field in the display) is positioned at the first position of the input field. The user now enters the letters or numbers of the desired program name. After all the characters of the program name have been entered, the input is concluded by the pressing the "ENTER" key.

The input program name must fulfil certain conditions (see below) and is checked for these. In the event of a violation, the following message is displayed:

```
ERROR : Program name illegal!
Program : 3STAR%T
```

The error message is acknowledged by pressing a key, and the user can correct the error in the input field.

The program name must fulfil the following conditions:

- A character can be a number or a letter
- Spaces are not allowed in the name
- The length is restricted to 20 characters
- Only "_" and "-" are practical as special characters
- Uppercase letters

Moving the cursor in the input field:

Key:	Reaction/effect:
Arrow left	Cursor one character to the left
Arrow right	Cursor one character to the right
SHIFT + DEL	Deletes character on the left of the cursor
DEL	Deletes character on which the cursor is positioned
ENTER	Conclusion of an entry

2.2.5 Selection of a Name from the Program List

If the user wishes to access an existing program (e.g. change of the program, selection to define as the start-up program or similar), the user is provided with a list of the existing programs in alphabetical order with the possible program types.

```
Please select !  [                    ]
Program :    1   A_EXAMPLE.PNC
```

The user has two possibilities to make a selection:

1. The user can scroll in the list by means of the "Arrow up" and "Arrow down" keys until the desired program is displayed. The selection is concluded by pressing the "ENTER key" and the program is transferred for the action.
2. An empty input field ([ ]) is shown at the end of the first display line. The user can input the name of the desired program in this input field via the keyboard. The characters from the keyboard are only applied if a program name exists with the same character string. The display (second display line) is corrected according to the input field after each input character.

```
Please select !  [E                   ]
Program :   54 SETUPMODE.PNC
```

The selection is concluded by pressing the "ENTER key" and the program is transferred for the action.

The contents of the input field are deleted by pressing the "Arrow down" or "Arrow up" keys.

2.2.6 Display System Errors

If the PA-CONTROL is not in AUTOMATIC mode an there will be an error the error is displayed.

```
CAN : Sync Time Out with axis 1
error reset, 1=yes
```

```
System error – RE-Initialize
1 = reset error on system
```

```
2 = display list of errors
3 = display hardware configuration
4 = Communication via modem
```

NOTE With the key „SHIFT“ and „9“ and the key-operated switch in the position "Program" you may do RE-initialize of the PA-CONTROL.

```
Really  re-initialize PA-CONTROL
1  =  yes  /  key  =  no
```

```
delete all program and parameters ?
no = <ESC>   /   yes = <ENTER>
```

2.3 Menu Structure of PA-CONTROL

The menu items from item 2 are only accessible with the key switch in the horizontal position.

Main Menu:	Menu Sub-options:
1 = Automatic	- Start - Stop
2 = Manual	1 = Approach to reference point 2 = Move axes manually via front plate
3 = Programming	1 = Display program directory 2 = Create new program 3 = Alter existing program 4 = Copy program 5 = Rename program 6 = Delete program 7 = Display program memory occupancy
4 = Diagnosis	1 = Limit switch / stand-by 2 = Inputs (I) 3 = Outputs (O) 4 = Flag (M) 5 = Real number register (R) 6 = Integer register (N) 7 = CANOpen Diagnosis / manual 8 = D-A converter (CANOpen)
5 = Run definitions	- Start program - Program at STOP - Program START after STOP - Program at MALFUNCTION - Heading - initial-state-program
6 = Parameters	1 = Edit system parameters 2 = Edit axis parameters 3 = Edit AS-i BUS [1] 4 = Edit servoTEC parameters
7 = Basic settings	1 = Boot system parameters 2 = Boot axis parameters 3 = Delete program memory 4 = Re-initialize PA-CONTROL
8 = System diagnosis	1 = Display hardware configuration 2 = Clock 3 = Keyboard test 4 = Stop key test 5 = Start key test 6 = Key switch test 7 = Test COM ports
9 = Communication via modem	1 = Activate connection 2 = Display connection status 3 = Terminate connection 4 = Edit modem settings 5 = Select modem type

[1] only if AS-i bus available

2.4 Automatic

The program defined as the start program is executed in automatic mode. Further programs can be invoked as subprograms or programs which are to be processed in parallel. A running program may be interrupted by "STOP". A program is started or an interrupted program is continued by means of "START". The required input is assigned at parameter level for the functions external START and external STOP (see chapter 5 Parameters).

2.5 Manual

Overview of the manual menu

After selecting this menu item, the user is offered the following choice:

```
Manual
1 = Approaches to reference point
```

```
2 = Move axes manually via front plate
```

2.5.1 Approaches to Reference Point

After selecting this menu item, the user is informed:

```
"Wait until initialized    (ESC=Cancel)"
"Axis :. . . . . . . . (START=Continue)"
```

If an error occurs during the initialization of the axis, the following message is output via the display:

```
E900: A1 Parameter "VBUSBAL" different
Error, continue with <key>
```

If there is no error, the select menu for the axes is displayed:

```
Approach to reference point
1 = Axis 1
```

```
2 = Axis 2
..
n = Axis n
```

The number of axes available for selection depends on the configuration of PA-CONTROL (1, 2, 4, 8, 12, 16). After selection of the axis, the following is displayed:

```
Approach to reference point axis : 1
Start = <START>, Cancel = <key>
```

The user can start the approach to reference point by means of the "Start key", or return to the manual menu using any key. The following is displayed during the approach to reference point:

```
Approach to reference point axis : 1
Running, cancel with <STOP>
```

The approach to reference point can be cancelled at any time using the "Stop key".

If there is a malfunction, the following message may appear:

```
Approach to reference point axis : 1   E563
Limit switch reached   →      <Key>
```

Possible causes:

- The drive was at the positive limit switch before the approach to reference point.
- The drive moved to the positive limit switch during the approach to reference point, because the assignment of the rotational direction of the motor and the assignment of the limit switch do not coincide.
- The drive can be run down from this position in manual mode.

2.5.2 Move Axes manually via Front Plate

After selecting this menu item, the user is informed:

```
"Wait until initialized    (ESC=Cancel)"
"Axis :. . . . . .    .(START=Continue)"
```

If an error occurs during the initialization of the axis, the following message is output via the display:

```
E900: A1 Parameter "VBUSBAL" different
Error, continue with <key>
```

If there is no error, the select menu for the axes is displayed:

```
Axis selection
1 = Axis 1
```

Select the axis to be manually traversed by pressing the key with the relevant axis number (1..16). Depending on the configuration of the device, selection is limited to 1, 2, 4, or 16. The following will then be displayed (example for axis 1):

```
A 1 =          0.000000          V=3200.00
1=320.00       2=3200.00         3=6400.00
```

The following assignment applies for the display:

1st line:

A1 = 0.000000 → Current absolute position of axis, here A1

V = 3200.00 → Currently selected traversing speed

2nd line:

1 = 320.00 → Traversing speed, taken from the creep speed parameter

2 = 3200.00 → Traversing speed, taken from the manual speed parameter

3 = 6400.00 → Traversing speed, taken from the reference speed parameter

The following key assignment is valid for this status:

Key:	Reaction/effect:
Arrow left	Traverse in negative direction up to range limit (short actuation: single step; long actuation: continuous run)
Arrow right	Traverse in positive direction up to range limit (short actuation: single step; long actuation: continuous run)
SHIFT arrow left	Traverse in negative direction beyond range limit (short actuation: single step; long actuation: continuous run)
SHIFT arrow right	Traverse in positive direction beyond range limit (short actuation: single step; long actuation: continuous run)
Arrow down	To next axis
Arrow up	To previous axis
1	Set current traverse speed on value after 1= ...
2	Set current traverse speed on value after 2= ...
3	Set current traverse speed on value after 3= ...
ESC	End (back to previous menu)

2.6 Programming

Overview of programming menu

After selecting this menu item, the user is offered the following choice:

```
Programming
1 = Display program directory

2 = Create new program
3 = Alter existing program
4 = Copy program
5 = Rename program
6 = Delete program
7 = Display program memory occupancy
```

NOTE The application memory of PA-CONTROL is limited owing to the size of the RAM module on the CPU4. The free application memory can be displayed under menu item 7.

After activation of a menu sub-option in the programming menu, PA-CONTROL checks if there is enough free application memory for this action. If not, the activated function will not be executed and is cancelled with the following message display:

```
not enough free memory
```

Press any key to return to the menu.

If the user still wishes to create new programs, the free application memory must be expanded.

As an option, you can also expand the RAM.

Possibilities:

- Delete programs which are not required any more.
- Delete unimportant comments in the programs or transfer programs to PA-CONTROL without comments.

2.6.1 Display Program Directory

This menu item allows the user to scroll through the current program directory (in alphabetical order). The following display appears:

```
-No- --name.type --   Size S
  1   EXAMPLE.PNC    213 0
```

The following assignments apply:

No. : Consecutive numbering of the programs

Name: Program name

Type: Program type (PNC=NC program; PTX=Text program;
PAB=Parallel run program)

Size: Number of ASCII characters in the program

S: Program status (0=write/read access possible; 1=write protected;
2=horizontal checksum error in ASCII area; 3=horizontal checksum error in the code area)

2.6.2 Create New Program

When activating this menu item, the user is asked to enter a new program name (Refer to the description for Entry of program name).

The user must then select the program type:

```
Select program type
1 = PNC
```

```
2 = PTX
3 = PAB
4 = PNX
```

PNC program : Executable NC program with positioning and I/O commands

PTX program: Text program for labelling of inputs, outputs, etc.
(for more information refer to the sections *2.7 Diagnosis, page 46* and *2.8 Run Definitions, page 52*).

PAB program: Executable NC program with positioning and I/O commands und PAB behaviour.

PNX program : Executable NC program with positioning and I/O commands

After selection, the user finds himself in the 1st program line of the PA-CONTROL program editor.

NOTE Once a program type has been selected, it cannot be subsequently altered in the PAC.

2.6.3 Altering an existing Program

After activation of this menu item, a list of the available programs in alphabetical order is displayed. The user can scroll through the list and select the required program for programming by pressing the "ENTER key".

```
Please select ! [                    ]
Program :    1 EXAMPLE.PNC
```

After selection, the user finds himself in the PA-CONTROL program editor. The first two lines of the selected program are displayed.

2.6.4 Copy Program

Using this menu item, the user can copy the content of an existing program to a new program.

After activation of this menu item, a list of the available programs is displayed in alphabetical order. The user can scroll through the list and select the required program:

```
Please select ! [H                   ]
Program :   21  MANUAL_RELEASE.PNC
```

After selection, the user is asked to enter a new program name. After correct entry, the program is copied and added to the directory as a further program.

NOTE The program type cannot be changed during copying.

2.6.5 Rename Program

The user can change the name of an existing program in this menu item.

After activation of this menu item, a list of the available programs is displayed in alphabetical order. The user can scroll through the list and select the required program:

```
Please select ! [STOE                  ]
Program :   82  MALFUNCTION.PNC
```

After selection, the user is asked to enter a new program name. After entry, the program is added to the directory unaltered with a new name.

2.6.6 Delete Program

The user can delete an existing program (from the program memory) in this menu item.

After activation of this menu item, a list of the available programs is displayed in alphabetical order. The user can scroll through the list and select the required program:

```
Please select ! [L                    ]
Program :  44  L_LAMP.PAB
```

After selection, the user is again asked to confirm the selection and the deletion of the program:

```
Delete program  1=YES  /  Key=NO
L_LAMP.PAB
```

Pressing the "1" key will delete the program. Pressing any other key will cancel the selection and the program will not be deleted.

2.6.7 Program Memory Occupancy

The user can display the occupied and free bits of the application memory in this menu item.

```
ASCII free / occupied : 107949 / 507039
Code  free / occupied : 107949 / 202608
```

Press any key to return to the menu.

The maximum application memory available is divided into the areas ASCII format and Code format. In the ASCII area, the programs are stored in the originally created form. For faster execution, the programs are converted from ASCII to an internal code format.

NOTE The value for "free" varies depending on the development state and the equipment!

2.7 Diagnosis

Overview of the Program Test and Diagnosis menu

After selecting this menu item, the user is offered the following choice:

```
Diagnosis
1 = Limit switch / Stand-by          →
```

```
2 = Inputs (I)
3 = Outputs (O)
4 = Flag (M)
5 = Real number register (R)
6 = Integer number register (N)
7 = CANOpen
8 = D-A converter (CANOpen)
```

2.7.1 Limit Switch / Stand-by

This menu sub-option is used to check the limit switches of the individual axes as well as the stand-by of the motor power circuits. The displays vary in this menu item depending on the configuration of PA-CONTROL, because only the available motor axes are considered. After activation of this menu item, the following is displayed:

```
Selection of axis
1 = Axis 1                           →
```

```
2 = Axis 2
..
n = Axis n
```

Select the axis by pressing the key with the relevant axis number (1..16). Depending on the configuration of the device, selection is limited to 1, 2, 4,...,16.

The following key assignment applies for this status:

Key:	Reaction / effect:
Arrow down	To next axis
Arrow up	To previous axis

The following will then be displayed (example for axis 2):

```
Axis  2     Limit switch positive : 1
Ready: 1    Limit switch negative : 1
```

The following assignments apply:

0 : Power circuit not ready, limit switch (opener) actuated

1 : Power circuit ready, limit switch (opener) not actuated

2.7.2 Inputs, Outputs, Flags

These menu sub-options are used to manually check or change the status of inputs, outputs and flags. After activation of these menu items, the following is displayed (example for inputs):

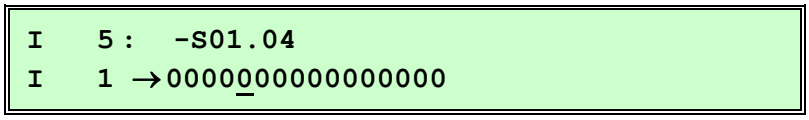

The following assignments apply:

1st Line: The number after the "I" input corresponds to the input on which the cursor field is positioned. "-S01.04" indicates the icon name for input 5 stored in the icon file. If the space bar is pressed, the assigned comment appears instead of the icon name, e.g. "Jog mode position 1"

2nd line: "I 1 →" means that, starting from input 1, the states of the next 16 inputs are displayed in this line. They are followed by the logic states of the inputs (0 or 1).

0: → Input cold, output or flag reset

1: → Input hot, output or flag set

Moving and actions in the display:

Key:	Reaction / effect:
Arrow right	Cursor field one digit to the right (to next element)
Arrow left	Cursor field one digit to the left (to previous element)
SHIFT + Arrow right	Cursor on last cursor field of the row (last element)
SHIFT + Arrow left	Cursor on first cursor field of the row (first element)
Arrow down	Display next group (e.g. input 17-32)
Arrow up	Display previous group (e.g. input 1-16)
SHIFT + Arrow down	Display last group (e.g. input 2027-2048)
SHIFT + Arrow up	Display first group (e.g. input 1-16)
ENTER	Select element directly, enter the required element in the input field and display with ENTER
1	Set the output or flag on which cursor field is positioned
0	Reset the output or flag on which cursor field is positioned
ESC	Quit sub-option
Space bar	Exchange icon name in the display for comment

If you are in the display for inputs I1...16, the following option for input can be reached by means of ENTER:

```
Enter new number
   0 <=      [ 25    ]  =< 2048
```

After input and confirmation of the required element number with ENTER, it will be displayed in its 16 group. This guarantees a targeted and rapid diagnosis.

The following is an example of a display for inputs 17 - 32:

```
I  25 : +8-X01.18/4
I  17 -> 0000000000000000
```

The information for diagnosis of outputs or flags is displayed in the same way.

The following is an example of a display for outputs 33 - 48:

```
O  34 : +9-a13
O  33 -> 0000000000000000
```

The following is an example of a display for flags 497 - 512:

```
M  504 :
M  497 -> 0000000100000000
```

NOTE The statuses of the outputs and flags are retained when the menu is exited! The number of actual inputs and outputs can vary depending on the equipment of the controller! See also *section 1.4.2: Inputs and Outputs of the PA-CONTROL MP, page 16* and the section on the CANopen bus in section *6.4: CANopen Interface, page 145.*

2.7.3 Real number register (R), Integer register (N)

These menu sub-options are used to manually check or alter the contents of the real number and integer register. After activation of these sub-options, the following is displayed (example for real number register):

```
R   1 :Axis 1
R   1 = 2.50000
```

The following assignments apply:

1st Line: The number after "R" (real number register) is the number of the displayed register. "Axis 1" indicates the icon name for real number register 5 stored in the icon file. If the space bar is pressed, the assigned comment appears instead of the icon name, e.g. "Intermediate position in press DO"

2nd Line: R 1= 2.50000 is the content of the displayed register.

Moving and actions in the display:

Key:	Reaction / effect:
Arrow down	Display next register
Arrow up	Display previous register
SHIFT + Arrow down	Display register number +10
SHIFT + Arrow up	Display register number -10
SHIFT + Arrow left	Last register
SHIFT + Arrow right	Display first register
ESC	Quit sub-option
Numeric key (1..9-+)	The character is applied at the first position of the displayed value (automatic activation of the input field)
Arrow right	Activation of the input field
ENTER	Conclude the input after input of a value
ENTER	Select element directly, enter the required element in the input field and display with ENTER
ESC	Cancel the input, the old value is retained
Space bar	Exchange icon name in the display for comment

See the section on *section 2.2: General Operation, page 30* in this chapter for the key assignment in the input field.

The input value is only transferred to the register if it is within the defined value limits (+/- 8.000.000).

Example for the integer register:

```
N 465 : TEACH_hfkt. ST5
N 465 = 71
```

The following assignments apply:

1st Line: The figure after "N" (= integer register) is the number of the displayed register. "TEACH-hfkt. ST5" indicates the icon name for integer register 465 stored in the icon file. If the space bar is pressed, the assigned comment appears instead of the icon name, e.g. "n+4 characters of string"

2nd Line: N 4656 = 71 is the content of the displayed register.

2.7.4 CANopen

After selecting this menu item, the following messages are shown in the display:

```
CANOpen Diagnosis / Manual
1 = Display hardware configuration

2 = Reset all CAN axes
3 = Create list of current devices
```

Menu item "Display CANopen devices"

The user can view the current configuration of the axes as devices on the CANopen bus in this menu item.

Example:

The following devices were on the CANopen bus after booting PA-CONTROL:

- An LV-servoTEC with the address 1
- A PA-CONTROL-MP with the address 2 and
- An LV-servoTEC with the address 4

NOTE Only the devices which directly follow each other are transferred during booting. The LV-servoTEC with the address 4 is therefore not transferred to the configuration!

The following is displayed:

```
List of CANopen devices
Address 1 : CANopen servoTEC

Address 2 : CANOpen EP
Address 3 : -----
Address 4 : ----
```

Menu item "Reset all CAN axes"

The user has the possibility of activating a reset/cold start for the connected LV-servoTEC axes in this menu item. This resets possible errors.

Menu item "Create list of current devices"

A list of the current devices on the CANopen bus is created in this menu item. Here PA-CONTROL attempts to read the "device type" of addresses 1 to 20. The result is displayed as follows:

Example:

The following devices were on the CANopen bus after booting PA-CONTROL:

- An LV-servoTEC with the address 1
- A PA-CONTROL-MP with the address 2 and
- An LV-servoTEC with the address 4
- An unknown device at address 6

After selecting the menu item, the following message appears for approx. 2 seconds:

```
Current devices on the CANopen
--------------------    (ESC=cancel)
```

The search for the devices is activated and the following appears on the display:

```
Current devices on the CANopen
12.?.....A..    (ESC=cancel)
```

. no device

1 LV-servoTEC

2 PA-CONTROL-EP (as Slave)

A IO modules

? unknown device

2.7.5 D-A Converter (CANopen)

PA-Control can operate up to 4 analog outputs (DA1 to DA4) via the CANopen bus. The user can specify a new D-A value for the D-A converter in this menu item.

Example:

The value 2345 is to be specified

```
DA 1 :     2345
```

The D-A value to be output is "2345". If you press the ESC key, you can left the menu.

2.8 Run Definitions

Overview of the run definition menu

Definitions for the automatic run of PA-CONTROL are set in this menu. After selecting this menu item, the user is offered the following choice:

```
            PA-CONTROL   4.xx
5 = Run definitions                    →
```

```
Start program
Program : START.PNC
```

```
Program at stop
Program start after stop
Program at malfunction
Heading
initial-state-program
```

Except for the start program, which always has to be defined, the other assignments can be optional.

NOTE The start program, program after stop, program start after stop, and program at malfunction must be different programs. In the case of double use of a program, the error message "Assignment not possible" is displayed at storage.

2.8.1 Start Program

The PA-CONTROL starts in automatic mode with this program. In principle, this program is the main program.

2.8.2 Program at Stop

Special actions (e.g. closing valves) can be carried out with this assignment when "STOP" is detected in automatic run. This program is run after the axes have been stopped.

CAUTION

In the program after stop, the set of commands has the following restriction:

1. This program may not invoke any further programs as subprograms or programs to be processed in parallel.
2. Positioning commands are not permissible in this program.
3. The commands "Wait for logical state of..." inputs, outputs and flags may not be used.
4. Any time monitoring which is still active is reset by the operating system without a message and is not reactivated at "Start".

NOTE The following commands may not be used in the program "after STOP":

SUB, CASE.SUB
RUN, CASE.RUN
G22
Ai:=n, Ai:=Rn
G01
G25.A, G26.A
G212, G222

PA-CONTROL checks in automatic mode and generates the errors E506, E507 or E508 if an error is found

2.8.3 Program Start after Stop

If "STOP" has been activated during the automatic run of PA-CONTROL and the program is to be restarted with "START" (automatic mode has not been exited), the program "Start after Stop" will be executed before continuation of the interrupted program. This option can be used to reset actions which were triggered by a stop.

NOTE This program may not invoke any further programs as subprograms or programs to be processed in parallel. Positioning commands are not permissible in this program.

SUB, CASE.SUB
RUN, CASE.RUN
G22
Ai:=n, Ai:=Rn
G01
G25.A, G26.A
G212, G222

The PA-CONTROL checks in automatic mode and generates the errors E506, E507 or E508 if an error is found

2.8.4 Program at Malfunction

With this assignment, special actions (e.g. closing valves) can be implemented when a malfunction is detected during the program run (e.g. error messages such as value too large, power circuit not ready...).

NOTE This program may not invoke any further programs as subprograms or programs to be processed in parallel. Positioning commands are not permissible in this program.

2.8.5 Heading

The user can replace the title in the main menu "PA-CONTROL Vxx.xx" by a customised user-defined title. To do this, the user must create a text program (type: PTX) and assign this text program under the menu item "Title". The first program line of this text program is then displayed as a title in the main menu.

2.8.6 Initial-State-Program

This program will activated without changing to automatic mode.

Table of Commands they are not allowed in “initial-state-program” :

- A1:=, FA1:=, … (move of axis)
- SUB, G22, … (Subroutines)
- RUN,CANCEL,SLEEP, … (parallel tasks)

2.8.7 Activation of Run Definition

A list in alphabetical order of the possible programs of the type "PNC/PAB" is displayed after activation of these sub-options. The user can scroll through the list and select the required program with "Enter".

```
Please select !   [                    ]
Program :    1   SOLDER_MAIN.PNC
```

After selection has been made, a second confirmation is required.

If confirmation with 1=yes is not made, the "old" assignment remains in effect.

```
Apply changes ?        1=yes
```

NOTE This assignment has to be made with the utmost of care, because the complete machine run is influenced.

2.8.8 Deletion of Assignments

If the user wishes to delete an assignment (Start program,..., Text program), the assignment to be deleted must be displayed in the second line of the display. By pressing the "DEL" key, the user informs PA-CONTROL that this assignment is to be deleted. The user must confirm the action before the assignment is deleted.

```
Start program
Delete program assignment ?     1=Yes
```

2.9 Parameters

Overview of the parameter menu

After selecting this menu item, the user is offered the following choice:

```
Parameters
1 = System parameters                    →
```

```
2 = Axis parameters
3 = Edit AS-i BUS
4 = Edit servoTEC parameters
5 = drive parameters load
6 = drive parameters send
7 = drive parameters display
```

There are two types of parameter in PA-CONTROL, the system parameters and the axis parameters.

The meaning of the individual parameters and their useful application is explained in Programmer Manual.

After entering the "System parameters" sub-option, the list of parameters is displayed as follows:

```
Parameters (definitions)
Min.val. <=: Act.val. <=Max.val.
```

The following is displayed for the first system parameter, language selection:

```
Language (1=Ger, 2=Eng, 3=Fre)
1        <=      1          =< 3
```

In this example, the set language is German.

The user can scroll through the parameter list and edit the required parameter by activating the input field by means of the corresponding numeric key or the cursor key "Arrow left". The input (altered) value must be within the min. and max. value limits, otherwise an error message is displayed after conclusion of the input. The input must be repeated or cancelled by "ESC".

Before entering the axis parameters, the user must first select the desired axis.

The submenu "Edit servoTEC parameters" can only be invoked if one or more LV-servoTECs are connected to PA-Control via CANopen bus.

2.9.1 AS-i Parameters

After selecting this menu item, the following is displayed:

```
Edit AS-i BUS
1 = Apply actual configuration
```

```
2 = Display status
3 = Activate automatic programming
4 = Change mode
5 = Display configuration
6 = Program slave
7 = Transfer configuration to AS-i Master
```

2.9.1.1 Apply actual Configuration

```
Are you sure you want to apply the actual con-
figuration                          1=Yes
```

```
Key = no
```

2.9.1.2 Display Status

Example:

```
OFL APF NORM PROJ Aavai Aakti LDs.0 OK
0   0    1    1    0     1     0    1
```

OFL : Offline mode
APF : AS-i power supply is down
NORM : Normal mode
PROJ : Configuration mode
Aavai : Auto programming of the slave address is possible
Aakti : Auto programming of the slave address is active
LDs.0 : Slave with address 0 exists
OK : There are no configuration errors

2.9.1.3 Activate automatic Programming

```
AS-i BUS Automatic slave programming
Activated : yes (ENTER/ESC)
```

```
Activated : no (ENTER/ESC)
```

You can toggle between yes and no by means of the Enter and the ESC key.

2.9.1.4 Change Mode

```
Protected mode (automatic)
Activated : no (ENTER/ESC)
```

2.9.1.5 Display Configuration

The configuration of the individual slaves on the AS-i bus is displayed in this menu item. You can scroll by means of the arrow keys, ESC means end.

Example:Slave 0

```
ASi Actual : no
Activated : yes (ENTER/ESC)
```

Example: Slave 1

(detected and configured, 4 inputs and 4 outputs)

```
ASi Actual : yes 4E/4AI : 1100
1-1 Pro : yes 4E/4°O : 0000
```

2.9.1.6 Program Slave

Only for changing a slave address

1.

```
ASi Slave is  Address [01]
```

2.

```
ASi Slave is    Address [1]
ASi Slave should be Address [12]
```

3.

```
ASi Slave is    Address [1]
ASi Slave should be Address [12] ENTER
```

4.

```
OK, continue with key
```

2.9.1.7 Transfer Configuration to AS-i Master





2.9.2 Edit servoTEC Parameters

After selecting this menu item, the following is displayed:

```
LV-servoTEC Parameters
1 = Display (all)
```

2.9.2.1 Display all

```
Display (all)
1 = Axis 1
```

```
2 = Axis 2
```

After selection of the desired axis, the user can display the current parameter values of the LV-servoTEC.

Example:

```
A1 LV-servoTEC Parameters
O (P)-No. 3500 (hex) MAXSDO = 0
```

```
O (P)-No. 3501 (hex) ACC = 10
O (P)-No. 3502 (hex) ACCR  = 200
 ...
O (P)-No. 3672 (hex) DRVCNFG = 0
```

Functions of the keys:

Key	Function
Arrow down	Next parameter (increment 1)
Arrow up	Previous parameter (increment -1)
SHIFT + Arrow down	Next parameter (increment +16)
SHIFT + Arrow up	Previous parameter (increment –16)
SHIFT + Arrow left	First parameter
SHIFT + Arrow right	Last parameter
ESC	Exit menu

2.10 Basic Settings

Overview of the basic settings menu

After selecting this menu item, the user is offered the following choice:

```
Basic settings
1 = Load system parameter default values→
```

```
2 = Load axis parameters default values
3 = Delete program memory
4 = Reinitialize PA-CONTROL
5 = CANopen baud rate
```

The user can set PA-CONTROL in a defined initial state by means of these functions.

NOTE

On selection of these functions, all the current machine parameters will be overwritten and programs will be deleted.

These functions should only be selected by qualified and authorized personnel.

Always carry out a data backup beforehand using WINPAC or hardcopy!

2.10.1 Load System Parameter Default Values

The system parameters (language, PA-CONTROL address, etc.) are set to the default values (external stop input no.= 0; external start input no.= 0).

2.10.2 Load Axis Parameter Default Values

The parameters can either be set to default values for a selected axis or for all axes.

2.10.3 Delete Program Memory

All the programs in the program memory are deleted.

2.10.4 Reinitialize PA-CONTROL

PA-CONTROL is reinitialized in the following order:

- Determine the hardware configuration of PA-CONTROL
- Number of axes, axis types
- Number and type of IEF modules
- Number of COM ports
- Number of AS-is
- Number of other hardware components
- Load default parameters as per the determined hardware configuration
- Delete complete contents of the program memory

HINWEIS External stop input no. = 0
External start input no. = 0
etc.
During this action, all flags are reset, all registers are et to 0, all programs are deleted and the parameters are loaded with the initial values.

Reinitialization of PA-CONTROL is essential in the following cases:

- For the initial start-up of the CPU4 for PA-CONTROL (carried out at IEF-Werner)
- After changing the battery on the CPU4
- Change of the hardware configuration (other cards and modules)

Example - Load System parameter default values:

The following appears on the display:

```
Load system parameter default values
1  = yes  /  Key = no
```

The user can start the boot of the system parameters by pressing the numeric key "1" or cancel the action by pressing any other key.

The user can also start this function via WINPAC (see section *2.10.5: Reinitialization for Devices without a Display and Keyboard, page 62*).

2.10.5 Reinitialization for Devices without a Display and Keyboard

Reinitialisation of PA-CONTROL is also essential in the following cases:

- For the initial start-up of the CPU4 for PA-CONTROL (carried out at IEF- Werner)
- After changing the battery on the CPU4
- Change of the hardware configuration (other cards and modules)

Reinitialization can only be carried out by means of "WINPAC" and a PC via the serial port for devices with a 7 segment display.

Proceed as follows:

- Start WINPAC
- Select
- "PA-CONTROL" and
- "Reinitialize PA-CONTROL" in the "Settings" menu.

NOTE During this action, all flags are reset, all registers are set to 0, all programs are deleted and the parameters are loaded with the initial values.

2.11 System Diagnosis

A further menu list is displayed after activation of this sub-option:

```
System Hardware Diagnosis
1 = Display hardware configuration    →
```

```
2 = Clock
3 = Keyboard test
4 = STOP key test
5 = START key test
6 = Key switch test
7 = Test COM port
8 = display list of errors
```

2.11.1 Display Hardware Configuration

The user can call up the configuration of his PA-CONTROL in this sub-option.

```
PA-Control hardware configuration
Serial number         : 123456
```

Example:

```
PA-CONTROL Version      :  4.50
CPU Type                :  CPU 4
CPU Version             :  2.0
ROM Size                :  1024k*8
RAM Size                :  1024k*8
Number of axes/AbsPoSys.:  4/ 0
Axis types (A1)         :  PLS7 V4.02.1
Profibus                :  0
Number of AS-i Masters   : 1
Number of COMs          :  2
Number of AD converters :  0
Interbus-S              :  0
```

The current values are determined by the controller after reinitialization.

2.11.2 Clock

PA-CONTROL contains a battery-buffered clock module. The information for this module can be displayed and altered in this menu item.

```
Date    >DD<MM YYYY WD     Time HH MM SS
         02.05.2000 3-Wednesday 14:36:38
```

The selected element is framed by the characters > <. The individual elements (DD=day etc.) are selected by means of the keys → and ←. Information about the selected element is obtained by means of the ENTER key. It can then be modified in the input field.

2.11.3 Keyboard Test

After selection of this sub-option, the following is displayed:

```
Keyboard test, ESC = End!_
```

On actuation, the keys are shown on the display or executed according to their described function (See Chapter 2 "User interface" Heading Keyboard). Exceptions: Arrow keys, INS, DEL, ENTER, START, STOP, ALT, CTRL.Stop Key Test

After selection of this sub-option, the following is displayed:

```
Stop key test, ESC = End !
Actuated : no_
```

On pressing the stop key, the display switches from "no" to "yes". This function refers to the stop key on the front plate. The possible external stop input can be checked via diagnosis inputs.

2.11.4 System Diagnosis - Start Key Test

After selection of this sub-option, the following is displayed:

```
Start key test, ESC = End!
Start key actuated: no_
```

On pressing the start key, the display is toggled from "no" to "yes". This function refers to the start key on the front plate. The possible external start input can be checked via diagnosis inputs.

2.11.5 Key Switch Test

After selection of this sub-option, the following is displayed:

```
Key switch test, ESC = End !
is on : Program
```

On turning the key switch, the display is toggled from "program" to "automatic".

2.11.6 Test of the COM Port

The hardware connection (RS232 cable) as well as the setting of the serial port can be tested by means of this function.

After selection of this sub-option, the following is displayed:

```
Test of the COM Ports
1 = COM 1                              →
```

The input window is switched to by means of the arrow keys or by entering a number between 1 and 4 of the port to be checked.

All characters received are output to the display. After pressing a key, they are immediately output via the port.

```
Test COM 1 (ESC=End)2211112233445566778
899aabbccddeeAABBCCDDEE
```

2.12 Communication via Modem

Communication between WINPAC and PA-CONTROL can be effected via modem. In this case, the operator can execute the following via the modem:

- Load and transfer programs
- Load and transfer parameters
- Load and transfer register values
- Diagnosis
- Load and transfer register values

Aus Sicherheitsgründen sind folgende Funktionen nicht integriert:

- Start / Stop of the PA-CONTROL
- Direct modification of outputs, flags and registers in PA-CONTROL
- Manual traversing of the axes of PA-CONTROL

The modem can be connected to PA-CONTROL via the diagnosis port. A remote user can access PA-CONTROL by this means. Connection can be activated by means of the menu sub-option `Activate connection` (keyboard) or using the input defined in the system parameters.

If a teleservice input has been defined (system parameters), the modem can be activated using the defined input. Depending on the setting, the service PC is called or the modem switches to reception. The connection can be started either in the main menu or during automatic run.

A defined teleservice output indicates the connection status:

- Fast flashing: PA-CONTROL is calling WINPAC (approx. 200ms)
- Slow flashing: PA-CONTROL is waiting for call (approx. 1 sec)
- Continuous light: Connection between PA-CONTROL and WINPAC has been established

2.12.1 Overview of the Modem Menu

After selecting menu item 9, the user is offered the following choice:

```
Modem
1 = Activate connection                →
```

```
2 = Display connection status
3 = Terminate connection
4 = Edit modem settings
5 = Select modem connection type
```

2.12.2 Activate Connection

```
Are you sure you want to activate modem
communication ?     1 = yes  / key = no
```

Once the modem has been connected and switched on, press key 1. The connection is set up - the steps which are carried out are shown in the status display.

```
Status Communication via modem
7: Init OK, waiting for call
```

Any problems are indicated by the corresponding status number and a plain-text message, e.g.:

```
Status Communication via modem
17 : Error: modem not ready
```

Normally, the next message to be displayed is:

```
Status Communication via modem
8 : Call arrived, waiting for connect
```

After the connection has been successfully set up, the following is displayed:

```
Status Communication via modem
9: Connected, OK
```

The user must now return to the main menu by means of the **ESC** key, so that the modem communication can ensue without restriction.

```
           PA-CONTROL  4.xx
1 = Automatic                        →
```

2.12.3 Display Connection Status

The current status is indicated by the corresponding status number and a plain-text message.

```
Status Communication via modem
9: Connected, OK
```

2.12.4 Terminate Connection

If a connection is active, the following is displayed:

```
Terminate modem communication ?
1 = yes  /  Key = no
```

If there is no connection at this time, the following is immediately displayed:

```
Status Communication via modem
0: not activated
```

2.12.5 Edit Modem Settings

```
Modem: Connection type
: Extension
```

In this menu, the user can select the modem commands for the initialization of his modem using the ↑ ↓ keys.

The settings can be edited by means of the → key. You will need the manufacturer's specifications for the modem.

If modems supported by PA-CONTROL are used (refer to "Select modem type"), the initialization string is generated by PA-CONTROL.

```
Modem: Initialising
: AT&FX3S0=1
```

The initialisation string is transmitted to the modem when it is called. Refer to the operating instructions of the modem for details of the initialization commands. The initialization string can be extended depending on the type of telephone installation.

```
Modem:PA-CONTROL will call service PC(1=yes)
: 0
```

If PA-CONTROL is to call a service PC, select "**1**". PA-CONTROL initializes the modem and automatically dials the specified number of the service PC. If PA-CONTROL is to a call from the service PC, "**0**" is set, the modem is initialized and waits for an incoming call.

```
Modem: Service PC tel. no.
:07723-925180
```

If the PA-CONTROL setting is "PA-CONTROL will call service PC" = 1, the number specified here is called.

The command string is sent to the modem before the telephone number (refer to the manual of the modem manufacturer).

```
Modem: Dial prefix
: ATDT0W
```

The command string is sent to the modem after the telephone number (refer to the manual of the modem manufacturer).

```
Modem: Dial suffix
:
```

2.12.6 Select Modem Type

The basic settings for the recommended modems are stored for modem communication.

```
Are you sure you want to select another
connection type?     1 = yes / key = no
```

A list of modems recommended by us is displayed by pressing key **1**.

```
List types (connection type)
1 = User defined
```

```
2 = Public exchange connection
3 = Extension
4 = Extension, internal connection
```

Only analog modems are supported.

2.12.7 Examples of Communication Setup Sequences

Communication Example: Service calls customer (WINPAC → PA-CONTROL)

Service person with PC and WINPAC	Customer with PA-CONTROL
Set up connection from PC to the telephone network via modem and switch on the device. Select modem type Edit connection data (name, telephone number)	Connect PA-CONTROL to the telephone network via modem. Execute modem settings "1 = activate connection" or make a remote connection using teleservice input.
Wait until customer is ready with PA-CONTROL	
"Select connection" using WINPAC (red telephone) and wait until message "Connected" (green LED) is displayed.	
	The following message appears on the display of PA-CONTROL: Status communication via modem 9: Connected, OK The assigned output is permanently active with teleservice.
PA-CONTROL can now be accessed via WINPAC.	If necessary, exit this menu item to allow all access options via WINPAC.

Disconnection can be executed via WINPAC or PA-CONTROL (3=terminate connection or teleservice input).

Communication Example: Customer calls service (PA-CONTROL → WINPAC)

Customer with PA-CONTROL	Service person with PC and WINPAC
Connect PA-CONTROL to the telephone network via modem. Execute modem settings (normally only needs to be carried out once).	Set up connection from PC to the telephone network via modem and switch on the device. Select modem type Activate WINPAC "Wait for call"
Wait until programmer is ready with WINPAC.	
"1 = activate connection" or make a remote connection with teleservice input.	Wait for a connection
The following message appears on the display of PA-CONTROL: Status communication via modem 9: Connected, OK The assigned output is permanently active with teleservice.	
If necessary, exit this menu item to allow all access options via WINPAC.	PA-CONTROL can now be accessed via WINPAC.

Disconnection can be executed via WINPAC or PA-CONTROL (3=terminate connection or teleservice input).

3 Commands of the PA-CONTROL-Family

The commands of the PA-CONTROL-family are led from the document version from September 2008, exclusively in the Programmer's Manual named:

File name: "MAN_EN_1086949_PAC_ProgrammersManual_Rxx.doc".

4 Startup

4.1 Important Information

PA-CONTROL may only be operated in combination with motors approved by IEF-Werner. The ground connection of the motors must be executed correctly. The cables and lead wires used must comply with EN60204.

All power lines and signal lines must be shielded. The shielding must have low impedance (large surface connection). Warranties for trouble-free operation only apply if original IEF cables are used.

Control cables and power cables must be laid separately at a minimum distance of 10 cm apart. Electrical connections on the device may only be disconnected in a no-voltage condition.

NOTE Installation and start-up may only be carried out by qualified personnel in accordance with EN60204.

4.2 Installation of a PA-CONTROL MP

Ambient conditions such as temperature, dirt or humidity influence the perfect operation of positioning and execution control system. Limit values (temperature 0°C to 40°C) and certain conditions must be considered for the installation of PA-CONTROL. PA-CONTROL may not be placed near strong electric or magnetic fields (e.g. welding transformer) or be subject to mechanic interferences (e.g. vibrations).

Ensure that air can circulate freely (air inlet and outlet ports must be kept free!).

NOTE Safety instructions must be followed to the letter (See section *1.3: Safety Instructions, page 13*).

WARNING

Protection from electric shock! The controller must be installed in accordance with EN 60204, in order to prevent personnel from coming into direct contact with it.

NOTE The fitting dimensions and instructions are described in *section 1.4.4: Fitting dimensions, page 25.*

4.2.1 Installation in a control cabinet

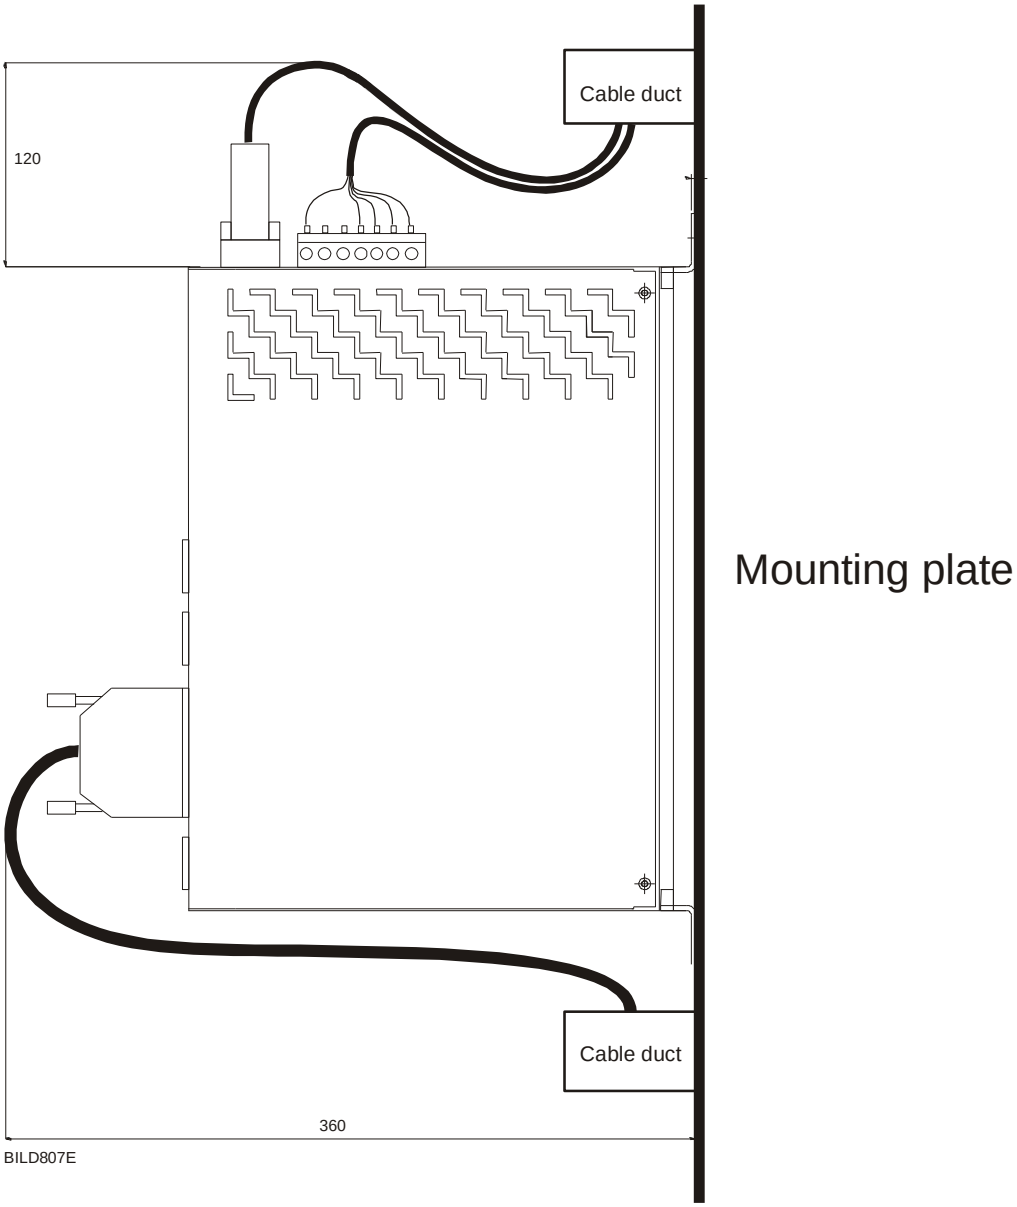

Figure 5: Side view

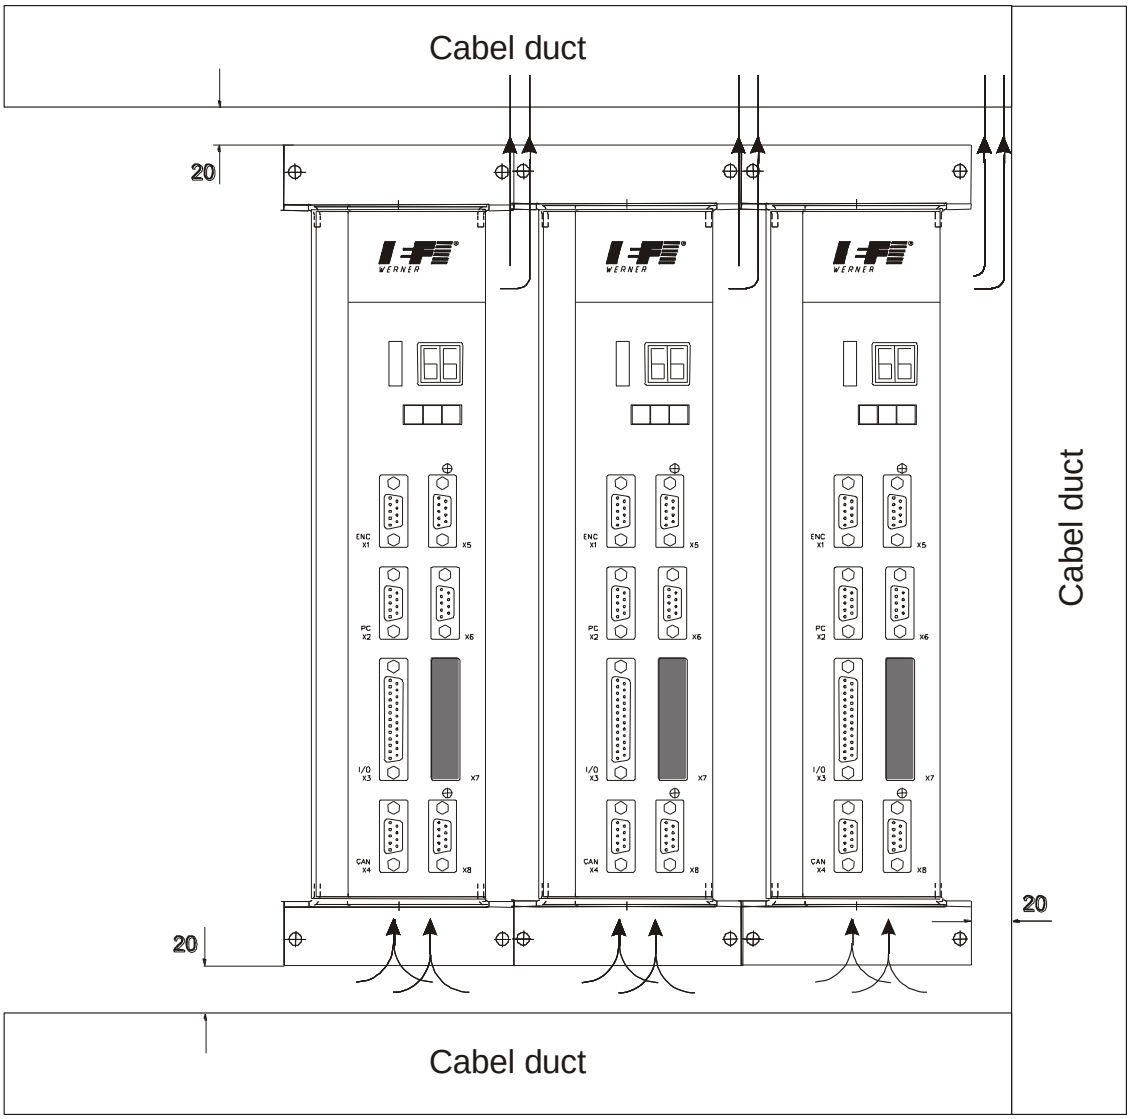

BILD806E

Fig. 6: Front view with several PA-CONTROL MPs

NOTE Ensure that air can circulate freely!

4.3 Electrical Installation of the PA-CONTROL MP

The grey fields indicate the connections which have to be made.

		Required	Important	Optional
PE conductor	X11			
Power supply 230VAC	X11			
24 VDC system	X3			
Motor	X10			
Rotary encoder	X1			
Brake	X9			
Limit switch	X3			
IEF wiring module	X3			
Inputs/outputs	X3*			
Stop input**	X3*			
External 24V for I/O	X3*			
Diagnosis line	X2			
IEF control console	X6			
Profibus	X5			
RS232	X5, X8			
A-D converter	X5, X8			

Refer to *Section 4.4, page 80* for the assignment of the individual connectors. Connection examples for the individual connectors are also shown there. Original IEF cables must be used to ensure trouble-free operation. Furthermore, EMC-compatible screw connections (e.g. on motors) and EMC-compatible Sub-D housings (metallized) must be used.

WARNING

The housing must be connected to the PE conductor! Connectors may only be inserted or removed in a no-voltage condition! A maximum voltage of 140V/6A may be applied at the connections U_{zin}-U_{zout}.

* Can also be connected to the optional "IEF wiring module".

** Input 10/I10 is used as standard.

4.3.1 Wiring of the PA-CONTROL MP

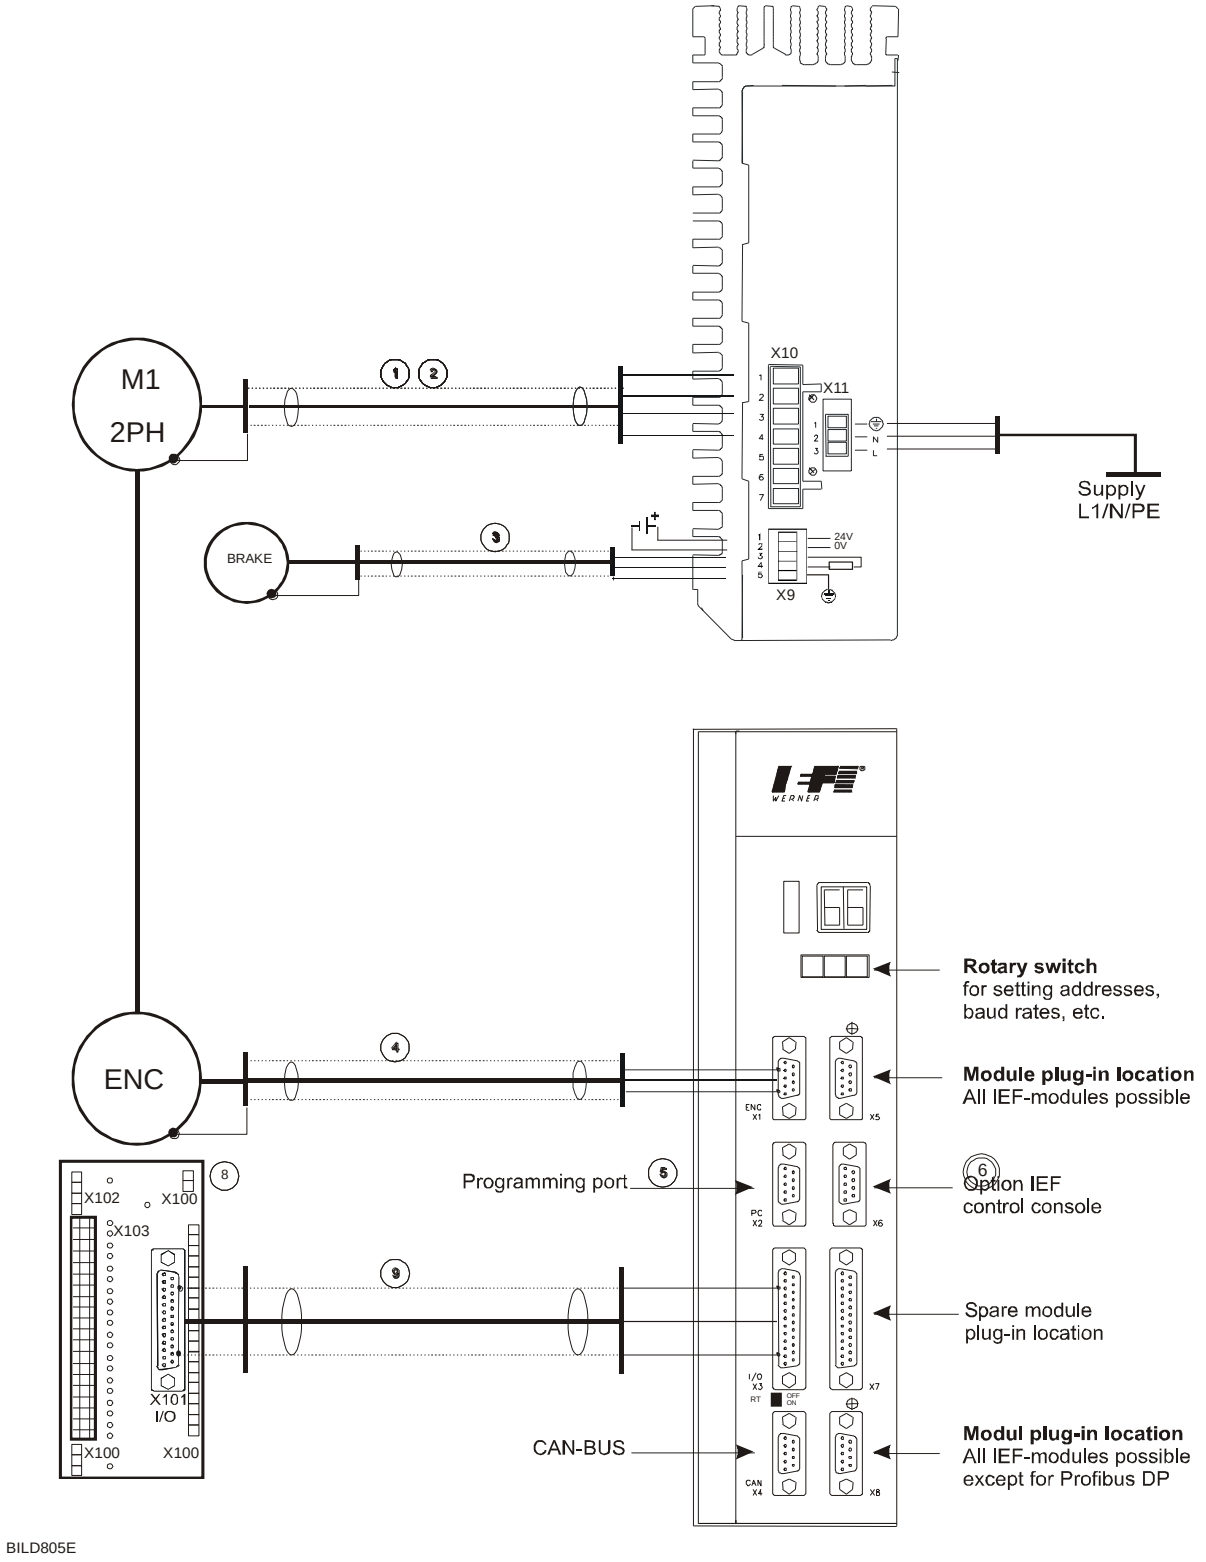

Figure 7: Wiring of the PA-CONTROL MP

4.3.2 Additional components

No.	Description	IEF no. for cables (standard length)		IEF no. for cables (special length)	
		Connector on motor		Connector on motor	
1	Motor cable for PA-CONTROL MP 2Ph 5x1.0² Motors up to 8 amperes (open cable head)	231 780	-	231 783	
	Motor cable for PA-CONTROL MP 2Ph 5x1.0² Motors up to 8 amperes (with circular connector RC 6)	-	231 777	-	231 778
2	Motor cable for PA-CONTROL MP 2Ph 5x1.5² Motors up to 12 amperes (open cable head)	231 781	-	231 784	-
	Motor cable for PA-CONTROL MP 2Ph 5x1.5² Motors up to 12 amperes (with circular connector RC 6)	-	231 795	-	231 796
3	Brake cable for PA-CONTROL MP (open cable head)	231 782	-	231 785	-
	Brake cable for PA-CONTROL MP (with connector)		231 798		231 799
4	Rotation monitoring line type 2Ph (open cable head)	230 804	-	230 979	-
	Rotation monitoring line type 2Ph (with connector)	-	230 781	-	230 782
5	Interface cable PC ↔ PA-CONTROL MP	231 766		-	
6	IEF control console for surface-mounting on walls	231 764		-	
	IEF control console for flush-mounting in walls	1022752			
	Port for IEF control console	527 452		-	
	Interface cable for IEF control console	231 766		1002839	
	Interface cable for diagnosis	231585		231586	

Table, continued

No.	Description	IEF no. (standard length)	IEF no. (Special length)
With wiring module			
7	Wiring module MP/SC/Single Varioface 25 poles	1030818	-
8	I/O cable 25 poles 25x0.34	231 601	231 602
Without wiring module			
9	Limit switch cable 1A 5x0.25 open	231 542	231 543
10	I/O cable 25 poles 25x0.34 open	231 603	231 603
11	WINPAC (prog. development system)	231 726	
12	Software update for PA-CONTROL MP	230 714	
Option	RS 232 port	527 450	
Option	Profibus-DP Interface	527 184	
Option	A-D converter	527 451	

Further options on inquiry.

4.4 Connector Assignments

Refer " for detailed information on the individual connector assignments and ports see section *7: Technical Annex, page 178*).

4.4.1 Inputs and outputs X3

Connector assignment:

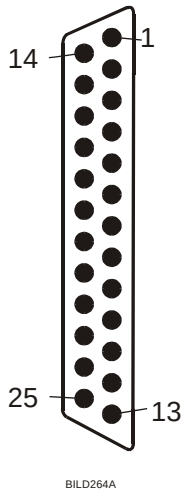

1	Input 1	14	Output 1
2	Input 2	15	Output 2
3	Input 3	16	Output 3
4	Input 4	17	Output 4
5	Input 5	18	Output 5
6	Input 6	19	Output 6
7	Input 7	20	Output 7
8	Input 8	21	Output 8
9	Input 9	22	24V for outputs
10	Input 10*	23	0V-GND for outputs
11	Limit switch positive	24	0V-GND for outputs
12	Limit switch negative	25	0V-GND for system
13	+ 24 VDC for system		

Figure 8: Sub-D, 25 poles; pins

NOTE If the "External stop" has been defined, it must always be under voltage * (input closed). However, an "external stop" can be dispensed with under certain circumstances. In this case, the "External stop" must be deselected via the WINPAC program!

NOTE If the PA-CONTROL is supplied with 24VDC via PIN 13 and 25, the 230VAC supply can be disconnected, in order to open a protective enclosure on the machine. A safe area for the operator is thereby created.

* Input 10 is specified as the "External stop" on delivery.

Wiring example:

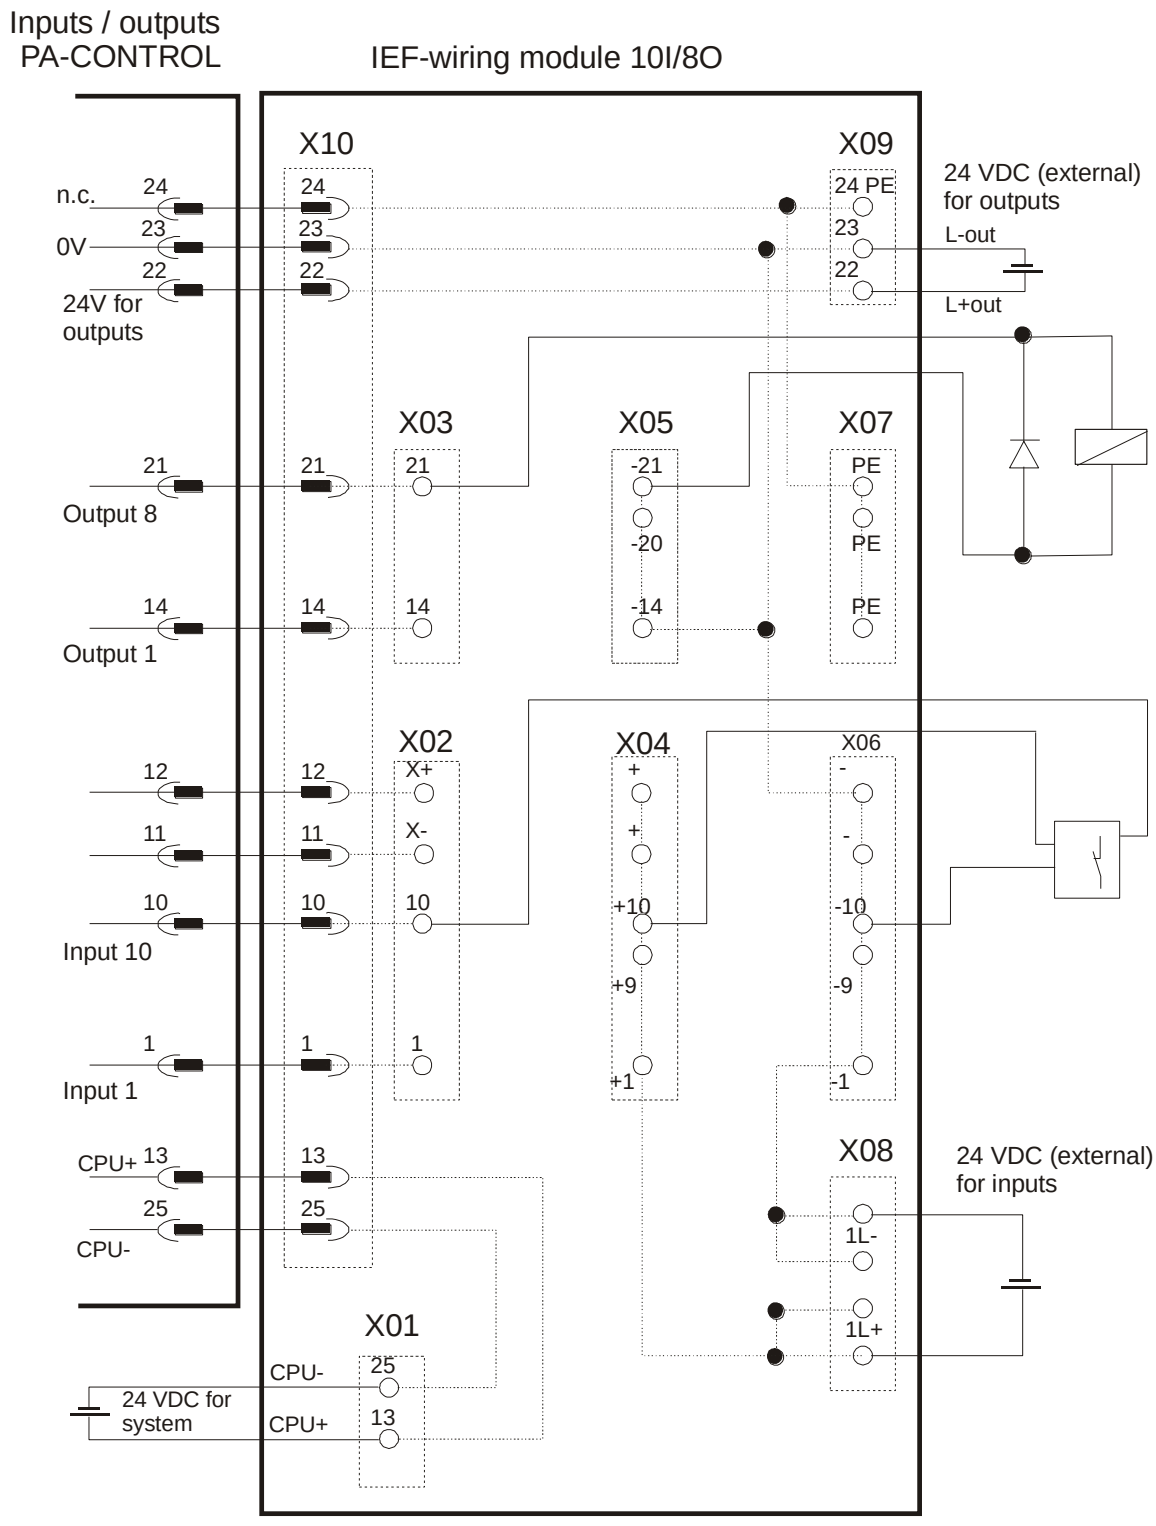

Figure 9: Connection of the inputs and outputs for PA-CONTROL MP

As an option, a voltage of 24 VDC can be applied via terminals X01/13 and X01/25. This system supply voltage maintains the system if e.g. the 230VAC supply voltage of the PA-CONTROL MP is disconnected as a result of an emergency stop.

4.4.2 Diagnosis port X2

Connector assignment:

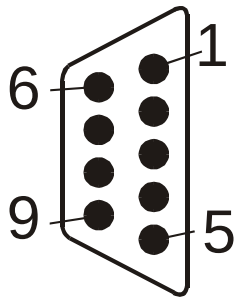

1	DCD, Reception level
2	RXD, Receive Data
3	TXD, Transmit Data
4	DTR, Terminal ready
5	GND
6	N.C.
7	RTS, switch on transmitter
8	CTS, ready for transmission
9	RI, incoming call

Figure 10:Sub-D, 9 poles; pins

NOTE The assignment corresponds to the asynchronous standard of the RS232 port. A shielded line must be used to ensure the troublefree exchange of data.

The assignment of the connecting cable between the PC and PA-CONTROL is shown in the following table.

PA-CONTROL			PC (9 poles)	
DCD	1	-	DTR	4
RXD	2	-	TXD	3
TXD	3	-	RXD	2
DTR	4	-	DCD	1
GND	5	-	GND	5
N.C.	6			6
RTS	7	-	CTS	8
CTS	8	-	RTS	7
RI	9	-	RI	9

4.4.3 Rotation Monitoring X1

Connector assignment:

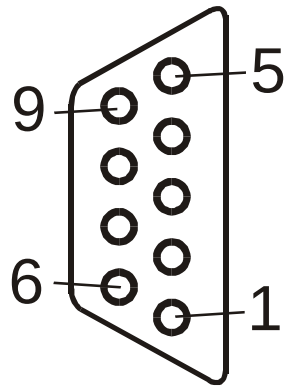

1	A+
2	+5V / 100mA
3	C+
4	C-
5	B-
6	A-
7	+5V / 100mA
8	GND
9	B+

Figure 11:Sub-D, 9 poles; socket

4.4.4 Motor connector X10

Connector assignment:

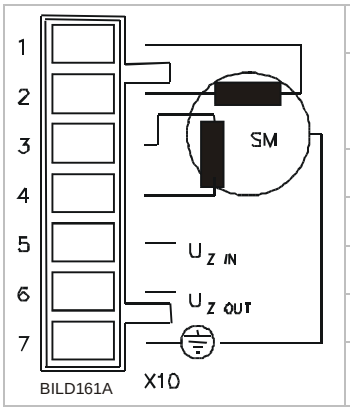

1	Motor winding 1
2	Motor winding 1
3	Motor winding 2
4	Motor winding 2
5	DC link in
6	DC link out
7	PE, system earth

Figure 12: Connector assignment

NOTE Connections 5 (U_{zin}) and 6 (U_{zout}) are bridged in the as-delivered condition. No motor current can flow if these are not connected, and the connection should therefore not be opened. There is the possibility of installing a separate supply for the system and motor.

WARNING

Connectors may only be inserted or removed in a no-voltage condition. A maximum voltage of 90VDC can be applied at the connections U_{zin}-U_{zout}.

4.4.5 Brake connector X9

Connector assignment:

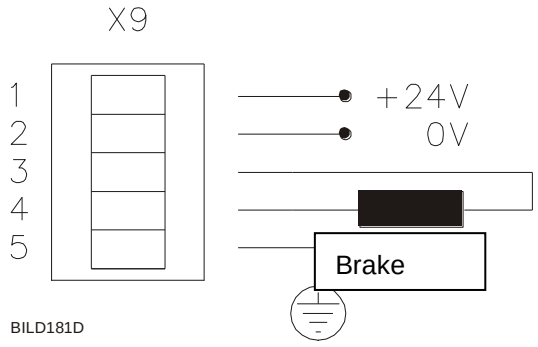

1	Brake voltage +24V
2	Brake voltage GND
3	- Connection for brake coil
4	+ Connection for brake coil
5	PE for brake

Figure 13: Connector assignment

4.4.6 Mains connector X11

Connector assignment:

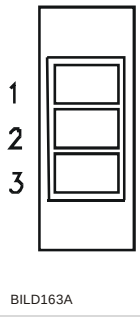

Connection	230VAC with L1/N/PE	USA supply network between two phases
1	PE	PE
2	N	L2
3	L1	L1

Figure 14 : Connector assignment

WARNING

Connectors may only be inserted or removed in a no-voltage condition

4.4.7 CAN Bus X4

Communication with other PA-CONTROL MPs is possible via the CAN bus. Please refer to the "CAN bus documentation" for further information.

Connector assignment:

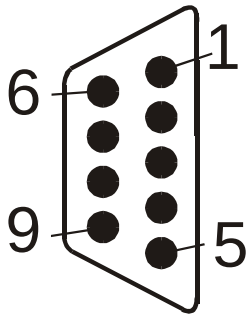

1	N.C.
2	CAN_L
3	CAN_GND
4	N.C.
5	N.C.
6	(GND)
7	CAN_H
8	N.C.
9	(CAN_V+)

Figure 15: Sub-D, 9-poles; pins

CAUTION

DIN ISO 11898 must be complied with when the CAN bus is installed.

4.4.8 Profibus Option X5

The PA-Control MP can be integrated in a Profibus network as a slave. Please refer to the "Profibus documentation" for further information.

Connector assignment

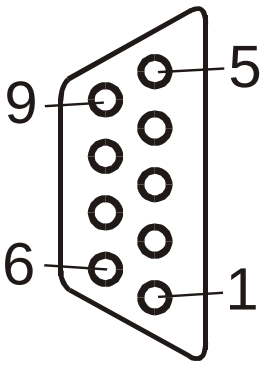

1	N.C.	
2	N.C.	
3	B	
4	RTS	These signals are required if signal amplification is necessary owing to a bus extension.
5	GNDO	
6	+5V	
7	N.C.	
8	A	
9	N.C.	

Figure 16: Sub-D, 9-poles; socket

CAUTION

EN 50170 and the Profibus-DP installation guidelines must be complied with the Profibus option is installed.

4.5 Startup of the Function- and condition check of PA-CONTROL MP

4.5.1 Functional check of the device via keyboard

The inputs and outputs of PA-CONTROL can be checked using the sub-menu item "Diagnosis" (See Chapter 2 " " for a description).

The following checks must be carried out without fail:

Check	Menu item
Limit switches	Diagnosis → Limit switches, Stand-by
Inputs	Diagnosis → Inputs (I)
Outputs	Diagnosis → Outputs (O)
Motor control	Manual

4.5.1.1 Parameter Settings

Please refer to *section 5 Parameters, page 98* for the parameter settings.

CAUTION

The parameters must be checked in accordance with the prevailing conditions!

4.5.1.2 Creating a PNC program

The main menu must be exited to create a new PNC program. The PA-CONTROL program editor opens after selection of the menu items "Programming → Create new program" and entry of a program name of the type *.PNC.

An example of a simple PNC program, which carries out a small test on the A1 axis, is shown below.

The PNC program is to execute the following functions:

- Approach to reference point with axis A1
- Set the absolute measuring system
- Set positioning speed to 500 mm/s [$^{AE}/_{s}$] einstellen
- Traverse with axis A1 to position 100
- Wait 2 seconds
- Traverse with axis A1 to position 10, wait 1 second

The program will be named "EXAMPLE":

CAUTION

Please make sure, that the program is necessarily available at the present machine.

Use the following keys in the program editor to create this program:

Program : EXAMPLE

Program:	Entry by pressing the keys:								
G90.A1	G	9	0	ENTER					
G25.A1	G	2	5	.	A	1	ENTER		
FA1:=500	F	A	1	:	=	5	0	0	ENTER
A1:=100	A	1	:	=	1	0	0	ENTER	
T200	T	2	0	0	ENTER				
A1:=10	A	1	:	=	1	0	ENTER		
T100	T	1	0	0	ENTER				
END	E	N	D	ENTER					

The program input is concluded and exited by pressing the "ESC" key and then confirming storage of the program.

ESC

- - End editor Enter "**1**"
- - Store program Enter "**1**"

If errors or incorrect commands were input during the program input, relevant error messages are output to the display.

These errors must be remedied, otherwise the program cannot be stored.

4.5.1.3 Specification of the start program

Before a created program can be processed, PA-CONTROL must be informed about which PNC/ PNX/ PAB program is to be used to start the automatic run.

This is specified in the menu item "Run definition → Start program" (see section *2.8: Run Definitions, page 52*).

4.5.1.4 Program execution

PA-CONTROL must be switched to automatic mode to run a program (main menu 1st line). The program is executed after pressing the start key. It can be stopped by means of the stop key.

The following is displayed during the program run:

1st line: Program name

2nd line: Current program line number with the commands

Example:

```
EXAMPLE
1 G90.A1
```

The program EXAMPLE from Section 4.6 executes the following steps:

Display (2nd line)	Execution of PA-CONTROL
G90.A1 system.	The following positions are executed in the absolute dimension
2 G25.A1	PA-CONTROL performs an approach to reference with axis A1.
3 FA1:=500	The traversing speed of axis A1 is set to 500 AE/sec.
4 A1:=100	PA-CONTROL moves with axis A1 to position 100.
5 T200	PA-CONTROL waits 2 seconds before the next command is executed.
6 A1:=10	The PA-CONTROL moves with axis A1 to position 10.
7 T100	PA-CONTROL waits 1 second before the next command is executed.
8 END	The automatic run is ended.

PA-CONTROL returns to the main menu.

4.5.2 Functional check of the device with WINPAC

The following information is provided to ensure that start-up is executed in a suitable sequence without danger for man or machine.

1. Check installation	In a no-voltage condition
2. Check protective conductor system	Protective conductor measurement to EN 50178
3. Connect PA-CONTROL MP to PC and start WINPAC	The correct PC port must be entered in the WINPAC program.
4. Switch on 24V supply for inputs/outputs	When using the IEF wiring module, the LEDs IN (green) and OUT (red) are lit.
5. Switch on AC input power supply	If the wiring is correct, the message E01 (in start position) appears on the status display of the PA-CONTROL MP.
6. Connect the PC and PA-CONTROL MP	If the connection was successful, the message "ONLINE" appears at the bottom edge of the screen. 
7. Create a project folder and set and transfer the motor parameters.	See section *5: Parameters, page 98*.
8. Check inputs/outputs and test stop input	See section *5: Parameters, page 98*.
9. Traverse axes manually	See section *2.5.2. Move Axes manually via Front Plate, page 40*.
10. Put optional subassemblies into operation.	See documentation in the section *6: Options, page 143*.
11. Create program and transfer to PA-CONTROL MP	

Good luck!

4.5.2.1 Creating a project folder

After wiring has been completed and the connections checked, the controller can now be put into operation via WINPAC.

To do this, a current project folder must first of all be created.

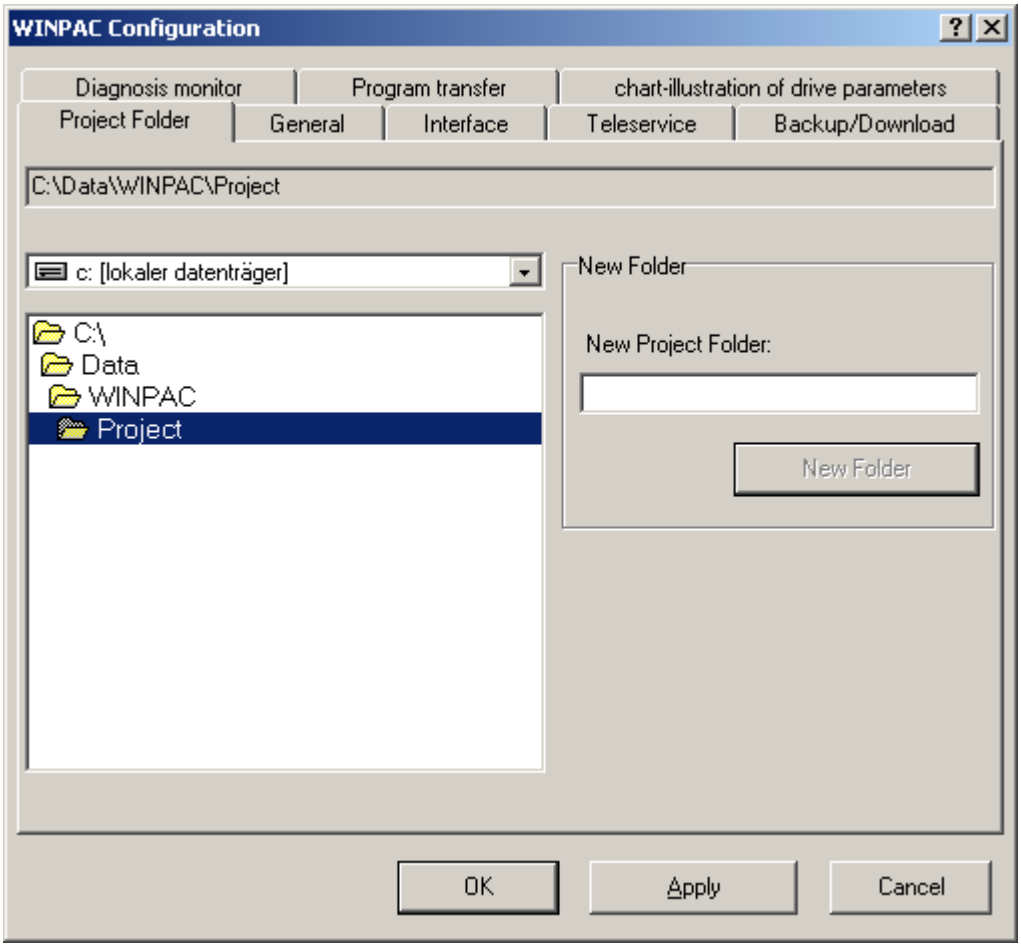

Figure 17: WINPAC, creating a project folder

General settings for the configuration of WINPAC are stored in the new project folder.

For more information, please see the WINPAC-online help.
For this purpose, click help tap, select manuals and open the desired manual.

4.5.2.2 Parameters of the PA-CONTROL MP

After a project folder has been successfully created, the following parameters must be set:

- Axis parameters
- Traversing parameters
- Motor parameters

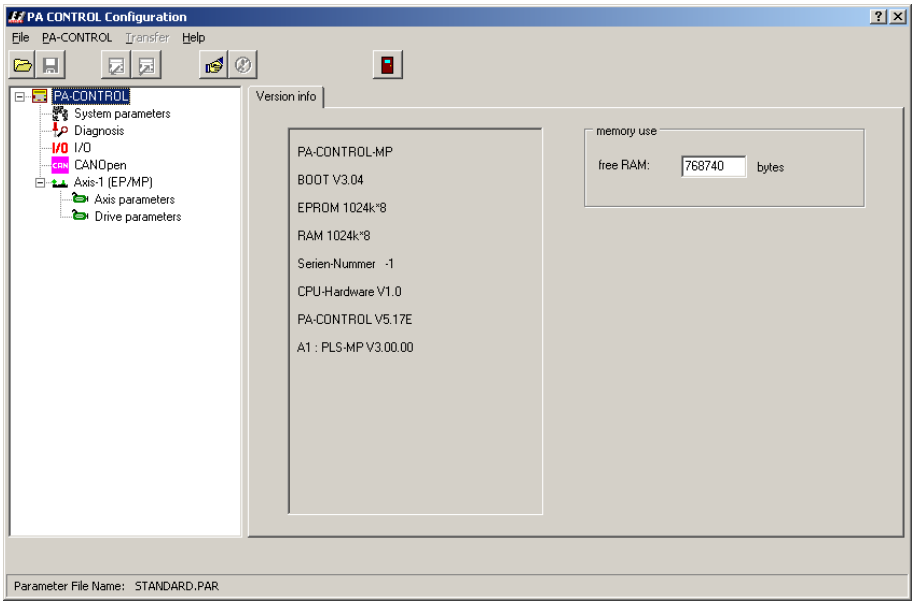

Figure 18: Main screen, setting the PA-CONTROL parameters

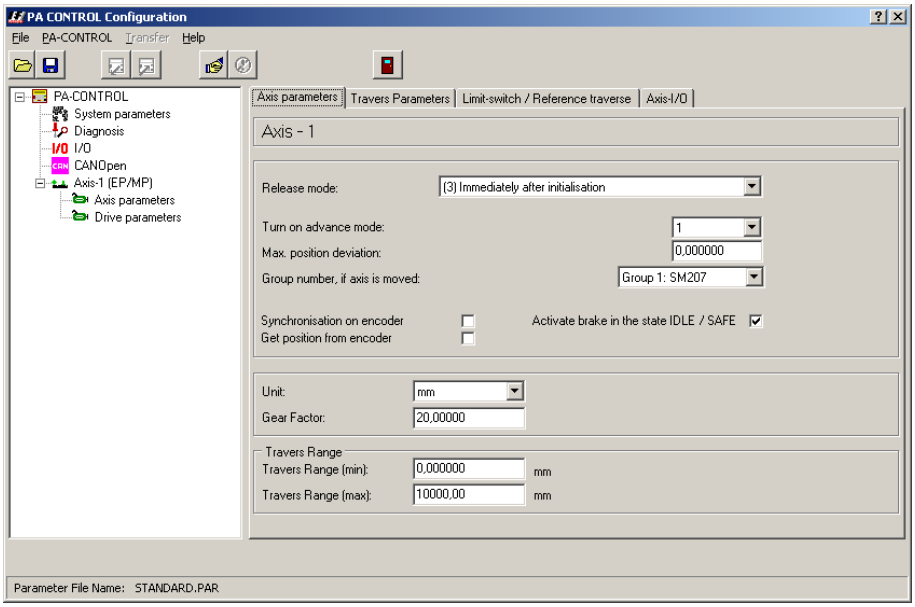

Figure 19: WINPAC, setting the axis parameters

Refer to Section 5, Parameters, for a description of the individual parameters.

After the desired parameters have been set, a connection to PA-CONTROL MP must be set up to transfer the set parameters.

4.5.2.3 Function and condition check

The function and status check is effected by means of the WINPAC program package or the optional IEF control console.

By means of WINPAC, you can check the following points in the [Diagnosis] sub-menu for their function, value and status:

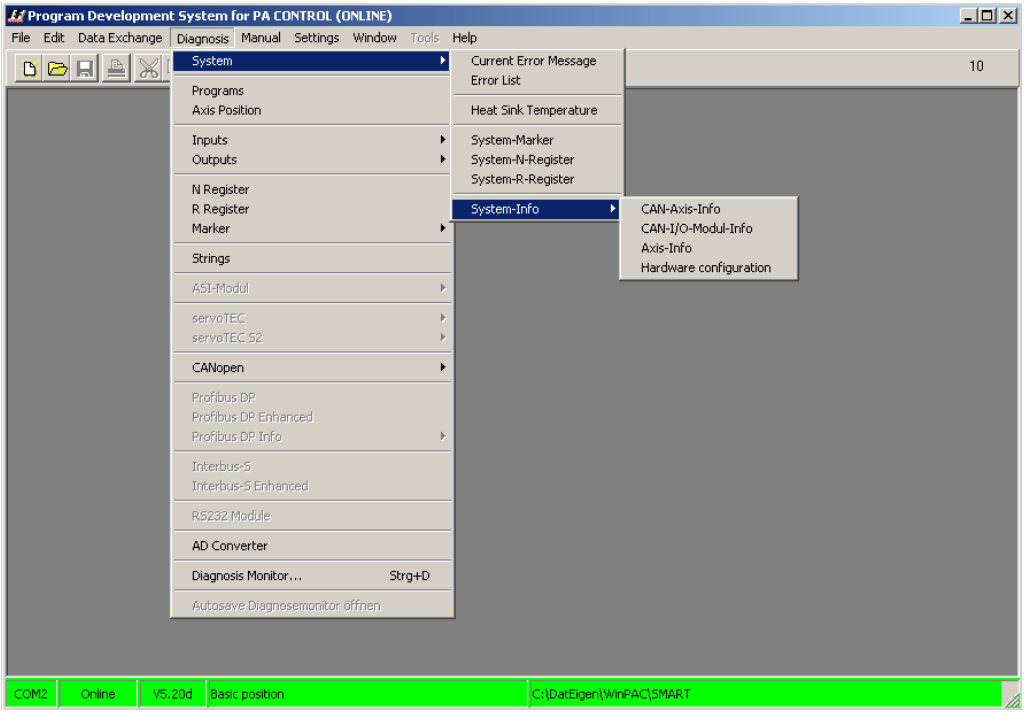

Figure 20: Diagnosis of PA-CONTROL

Function check:

- Programs
- Manual traversing
- System inputs (functions of the limit switches)
- Error message

Status check: ("0" "OFF" or "1" "ON")

- Inputs
- Outputs (can be changed with right mouse button)
- Flags (can be changed with right mouse button)

Value check:

- N register (integer register)
- R register (real number register)

CAUTION

Please make sure that no danger to the machine or personnel can arise if an output is incorrectly set or the drive does not move as intended.

CAUTION

Before the initial start-up of the motor, the function and position of the axis limit switches must be checked to ensure that they are correct.

Example for changing an output:

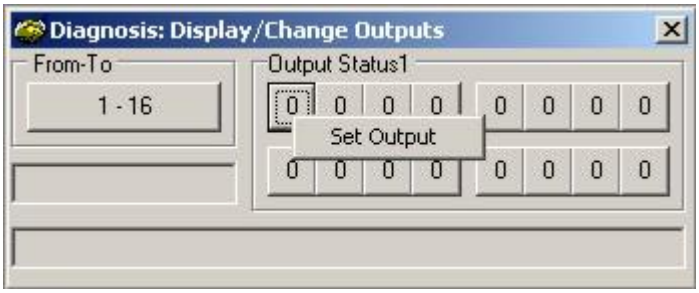

Figure 21: Changing an output, setting

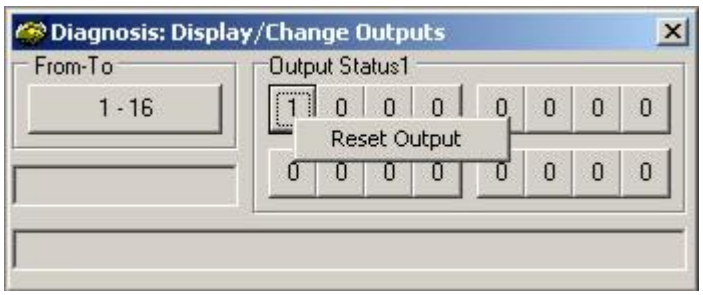

Figure 22: Changing an output, resetting

Example: Manual traverse

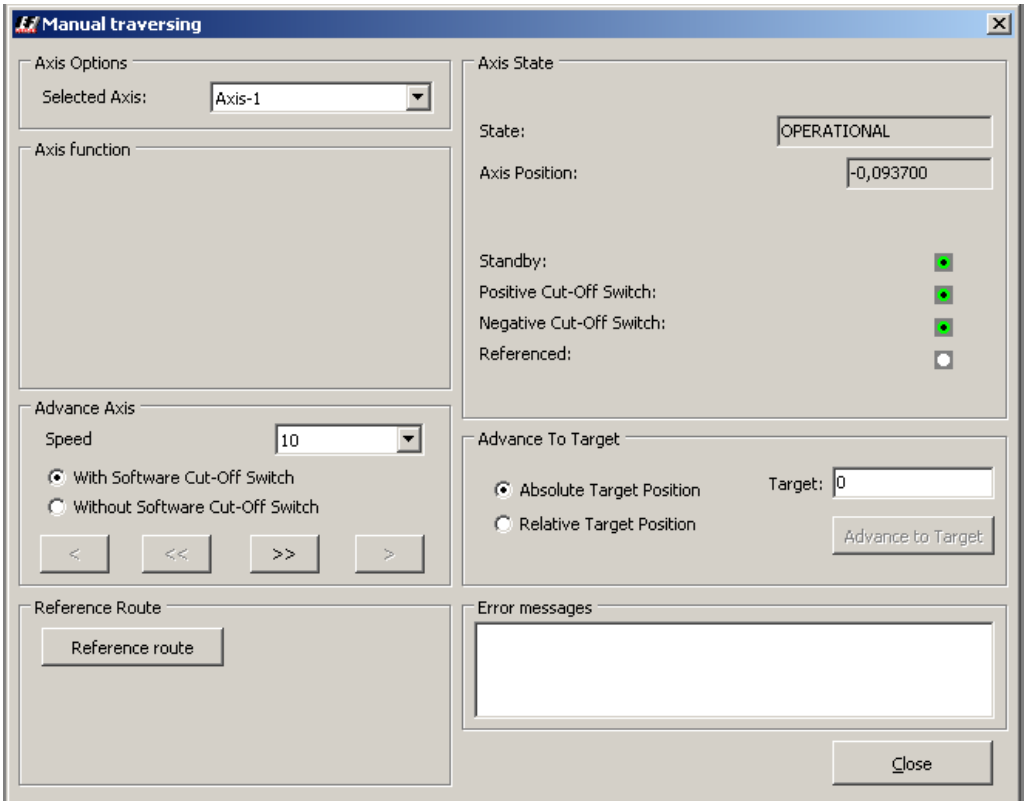

Fig. 23: Manual traverse of an axis

The motor can be manually moved to the left or the right by clicking the two buttons << and >> with the left mouse button.

The axis can be moved within the range of the two axis limit switches.

4.5.2.4 Error diagnosis

Errors which occur during operation or start-up are stored in the controller and can be read and printed out by means of the WINPAC program.

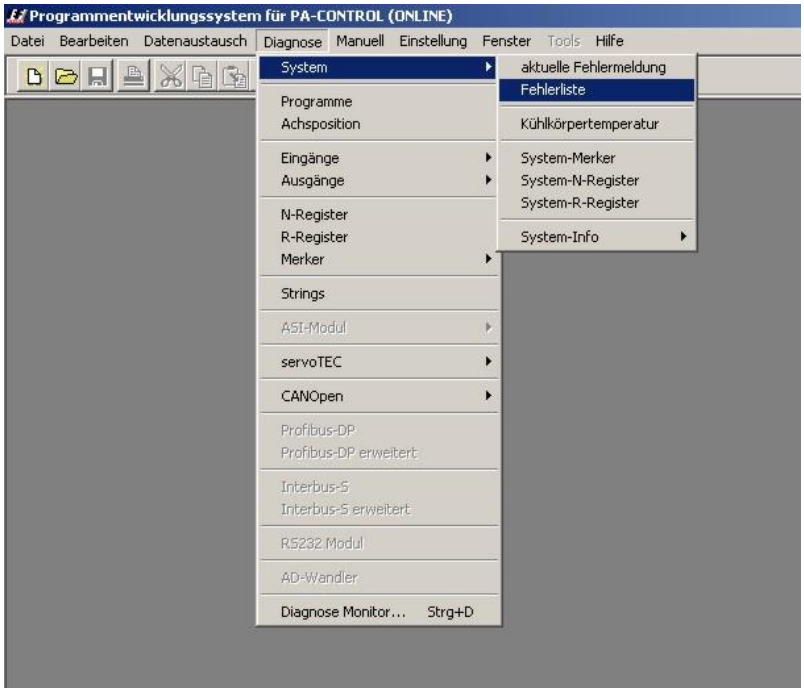

Figure 24: Diagnose PA-CONTROL MP

4.5.2.5 First Aid

The table below is for "First aid". Depending on the conditions of use, there may be other causes of malfunctions.

Error:	Possible cause:
No connection to PA-CONTROL MP possible	Diagnosis cable defective/not plugged in
	Incorrect PC port set in the project parameters in WINPAC
	PA-CONTROL MP is not switched on
Motor does not turn	Mechanical problems
	Motor cable not plugged in
	Motor incorrectly connected
	Intermediate-voltage circuit U_{zin}-U_{zout} not closed
	Limit switches X+/X- not active/transposed
	Axis is at limit switch
	Brake not opened
	Incorrect motor parameters
Motor stops after only a few steps	Motor incorrectly connected
	Rotary encoder not/incorrectly connected
	Axis is at limit switch
No connection to I/O level	I/O cable not plugged in or is defective
	Connect and/or check external 24V supply for I/O level
	IEF Vario module defective

Please refer to section 7.1.1: Status and operational Status Messages, page 179 for further information on error messages.

5 Parameters

5.1 General Information on Parameters

PA-CONTROL has several types of parameters:

- System parameters: Parameters that concern the general system, such as user language, serial port, etc.
- Drive parameters: Parameters that concern the axes, such as traversing speed, motor steps, acceleration, etc.
- Option parameters: Profibus, RS232, etc.

Various basic settings have to be made before an appropriate program run can take place. This means that differentiated settings have to be made for various axes which are variously dimensioned and have varying loads.

The conditions for acceleration, maximum speed, gear factor etc. also have to be set for the individual axes. There are several motor and axis parameters available depending on the number of axes.

All the parameters can be modified using the Winpac program, some of them on the front plate of the device. The parameters of the diagnosis port are an exception, as they cannot be altered.

NOTE Parameters in the Winpac program which are displayed on a grey background are not available depending on the version of PA-Control.

This interface will be used for description purposes as all parameters can be altered using WINPAC. Access to the parameters via the front plate of the device is similar, but **not** possible for certain parameters

The configuration window is called by the following menu items to edit the parameters:

Zum Editieren der Parameter wird das Konfigurationsfenster über folgende Menüpunkte aufgerufen.	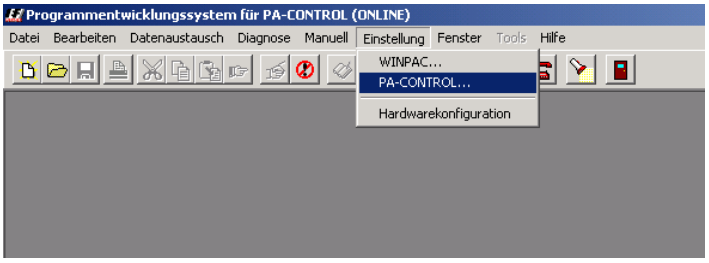

Figure 25: General Information

5.1.1 Configuration Window

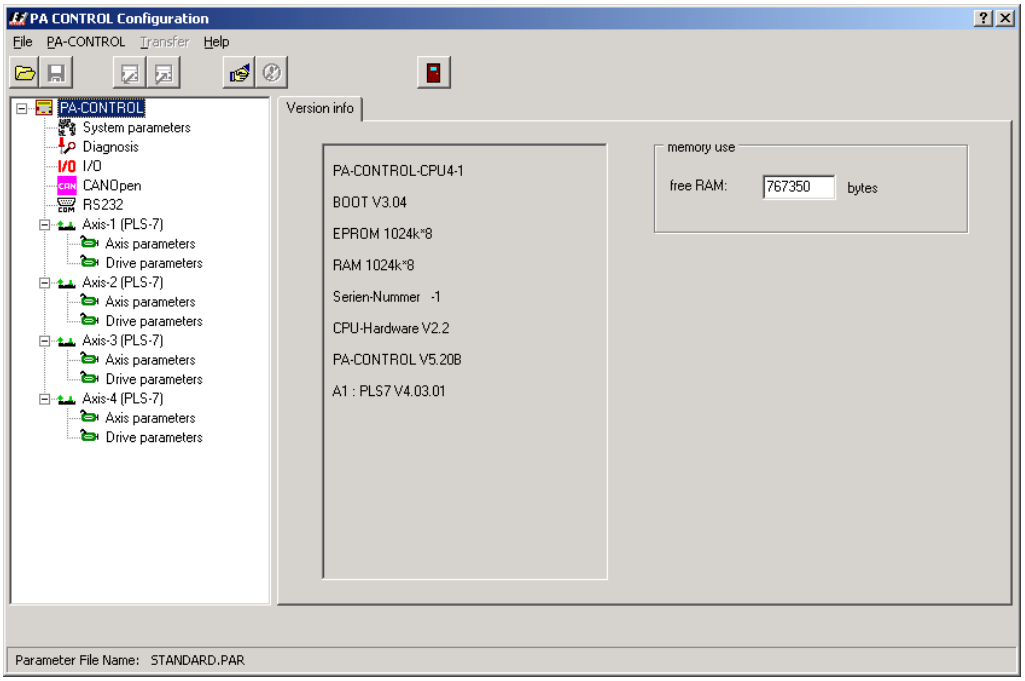

Figure 26: Configuration Window

All parameters of the PA-CONTROL are edited in this window.

5.2 System Parameter

5.2.1 System Parameter Tab

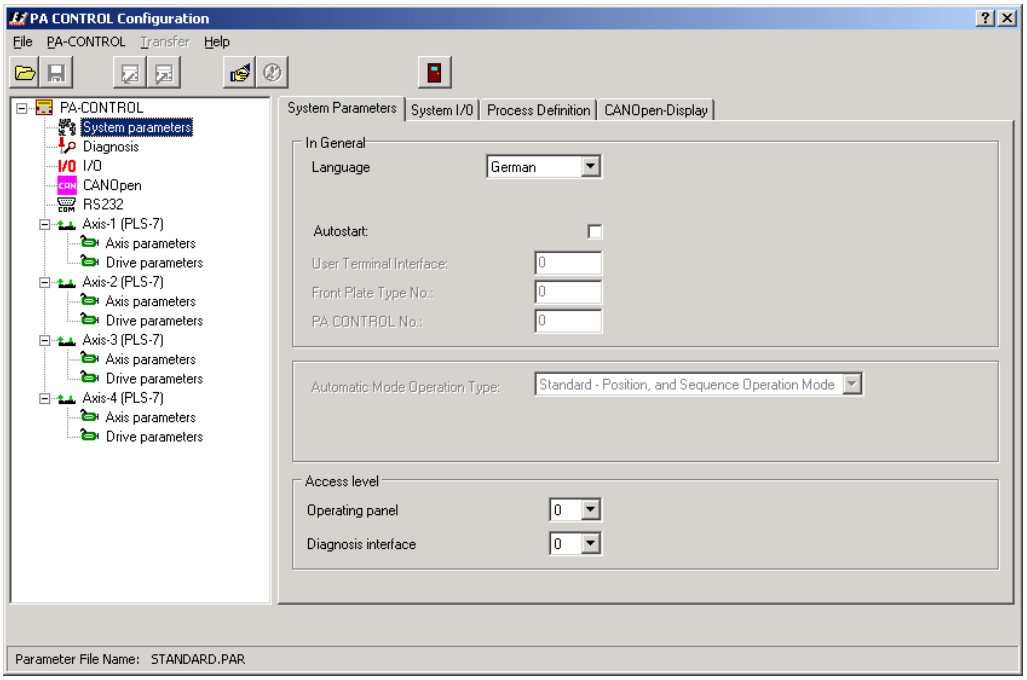

Figure 27: System Parameters

5.2.1.1 Language

Value of Parameter	Meaning
1	German
2	English
3	French

5.2.1.2 Autostart

Value of Parameter	Meaning
1	If the parameter Autostart is set to 1, **PA-CONTROL** begins to run the start program after being switched on (reset), i.e. it automatically switches into the automatic mode. **Prerequisites:** - Start program must be defined - An input must be defined as an external stop and be hot **NOTE**: The Autostart function is only executed once after switch-on (reset). If the program is to be executed several times, either an endless loop must be programmed or the program must be called again via a start input

5.2.1.3 Acces Level

The system parameter "Control console access level" regulates the operator actions which can be executed via a keyboard integrated in the device or via an IEF control console.

The system parameter "Access via diagnosis port" regulates the operator actions which can executed via the diagnosis port by means of the WINPAC program.

Both parameters are set to "0" on "Boot of PA-CONTROL". The parameter value can be altered in this status either via the integrated keyboard, the IEF control console or by means of the WINPAC program. If it is not equal to "0", it can only be reset by "Boot of PA-CONTROL". There are two possibilities here:

By means of the WINPAC program or

After switch-on, if a change in the hardware configuration is detected and the key-operated switch is in the "Program" position.

Control console access level						
PA-CONTROL - Menü	**Note / Meaning**	**Value of parameter**				
		0	**1**	**2**	**3**	**4**
1 = Automatic		-	-	-	-	-
2 = Manual		-	-	-	X	X
3 = Programming	type of Program : *.PNC, *.PAB, *.PTX	-	X	X	X	X
	type of Program : *.PNX	-	-	-	-	X
4 = Diagnosis		-	-	X	X	X
5 = Run definitions		-	X	X	X	X
6 = Parameters		-	X	X	X	X
7 = Basic settings		-	X	X	X	X
8 = System diagnosis		-	-	-	-	-
9 = Communication via modem	4 = Edit modem settings 5 = Select modem type	-	X	X	X	X
9 = Communication via modem	1 = Activate connection 2 = Display connection status 3 = Terminate connection	-	-	-	-	X
		- : access X : no access				

Diagnosis port access level	
Value of parameter	**Meaning**
0	No restrictions
1	Programs cannot be loaded from PA-CONTROL
2 ... 255	No function at present

5.2.2 System I/O Tab

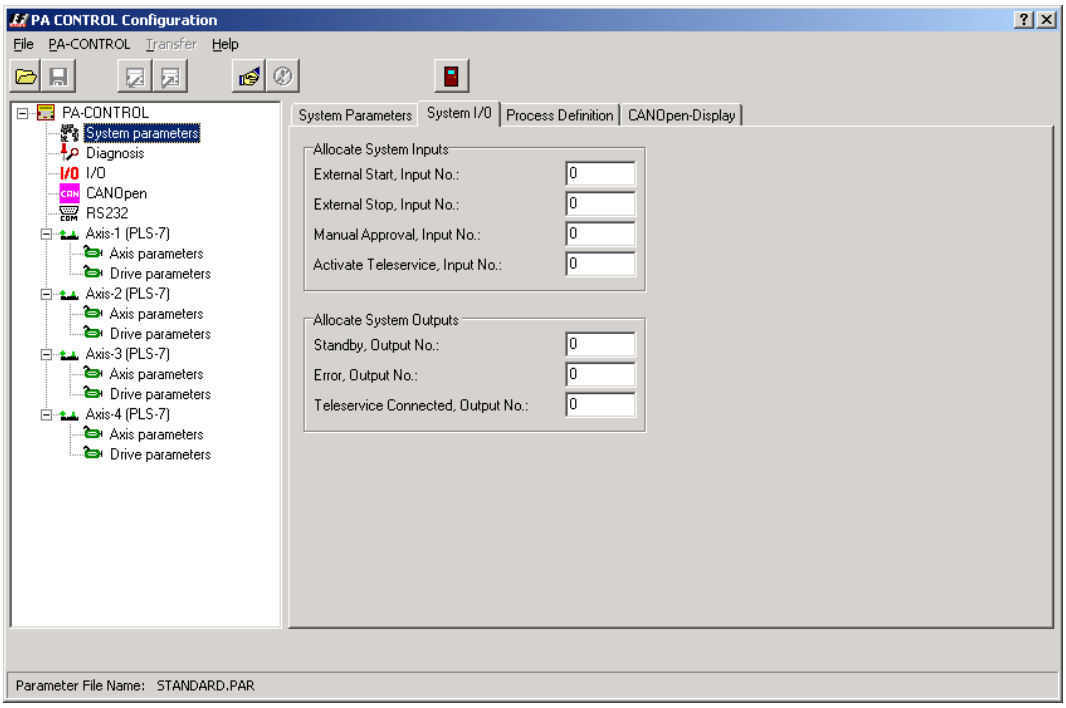

Figure 28: Display and Change of the System I/Os

NOTE Any input or output in the system can be used for the system I/Os.

5.2.2.1 External Start, Input-No.

Any input can be specified for the external start signal of **PA-CONTROL**. If 0 is entered, which is the standard value, there is no possibility for an external start.

The following applies for the start:

The transition from cold to hot triggers the start, i.e. NO contact function, positive edge evaluation.

5.2.2.2 External Stop, Input-No.

CAUTION
Any input can be specified for the external stop signal of **PA-CONTROL**. If 0 is entered, which is the standard value, there is no possibility for an external stop.

The following applies for the stop: If an external stop is defined, the selected input must be hot. Automatic mode is interrupted when the voltage supply is interrupted (principle of wire-break protection), i.e. NC contact function, status-driven.

The stop button stops **only** the tasks started as a PNC program as well as all positions. Tasks started as a PAB program are not affected and continue to run!

5.2.2.3 Manual Release, Input-No.

Only active with "Manual via front plate"!

5.2.2.4 Standby, Output-No.

Any output can be specified for the output of stand-by in **PA-CONTROL**.

5.2.2.5 Malfunction, Output-No.

Any output can be specified for the output of a malfunction which has occurred in automatic mode in **PA-CONTROL** (e.g. limit switch actuated, value too high, etc.). If a malfunction occurs in automatic mode, the output is set. If the automatic mode is aborted and you return to the main menu, the output is reset.

5.2.2.6 Activate Teleservice, Input-No.

Any input can be specified in **PA-CONTROL** for activation of the teleservice function. The function is activated when the input is hot.

5.2.2.7 Teleservice Connected, Output-No.

Any output in **PA-CONTROL** can be specified for the status display of the teleservice function. Flashing indicates the connection set-up, steady light indicates connection.

5.2.3 Run Definitions

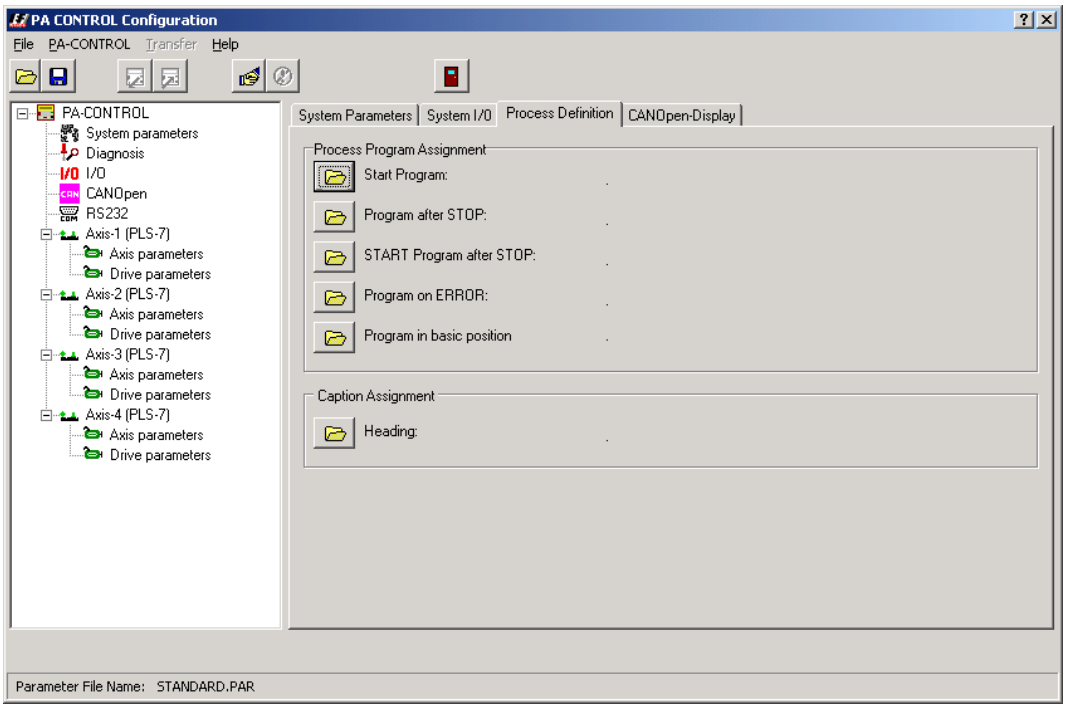

Figure 29: Display and Change of the Run Definition

NOTE Each program may only be registered once

NOTE

Any PNC, PNX or PAB programs can be registered in each case.

EXCEPTION: Only a PTX program is allowed for the title

5.2.3.1 Start Program

PA-CONTROL starts in automatic mode with this program. In principle, this program is the main program.

5.2.3.2 Program at Stop

Special actions (e.g. closing valves) can be carried out with this assignment when "STOP" is detected in automatic run. This program is run after the axes have been stopped.

CAUTION

The command set has the following restrictions in the Program after Stop:

1. This program may not invoke any further programs as subroutines or programs to be processed in parallel.
2. Positioning commands are not permissible in this program.
3. The commands "Wait for logical status of..." inputs, outputs and flags may not be used.
4. Any time monitoring which is still active is reset by the operating system without a message and is not reactivated at "Start".

NOTE The following commands may not be used in the program "after STOP":

SUB, CASE.SUB
RUN, CASE.RUN
G22
Ai:=n, Ai:=Rn
G01
G25.A, G26.A
G212, G222

PA-CONTROL checks in automatic mode and generates the errors E506, E507 or E508 if an error is found

5.2.3.3 Program Start after Stop

If "STOP" was actuated during the automatic run of PA-CONTROL and the program is then to be restarted with "START" (automatic mode has not been exited), the program "Start after Stop" is executed before continuation of the interrupted program. This option can be used to reset actions which were triggered by a stop.

NOTE This program may not invoke any further programs as subroutines or programs to be processed in parallel. Positioning commands are not permissible in this program.

SUB, CASE.SUB
RUN, CASE.RUN
G22
Ai:=n, Ai:=Rn
G01
G25.A, G26.A
G212, G222

PA-CONTROL checks in automatic mode and generates the errors E506, E507 or E508 if an error is found

5.2.3.4 Program at Malfunction

Special actions (e.g. closing valves) can be implemented with this assignment when a malfunction is detected during the program run (e.g. error messages such as: Value too large, power circuit not ready...).

NOTE This program may not invoke any further programs as subroutines or programs to be processed in parallel. Positioning commands are not permissible in this program.

5.2.3.5 Program in Basic Position (Program in Initial Position)

The "Program in initial position" is activated via the window "Display and change of the Run definition" (see section *5.2.3 Run Definitions, page 104*).

The following are not allowed in the "Program in initial position":

- Traversing of axes (G25, ..., A1:=, ...)
- Activation of parallel TASKS (RUN, ...)
- Use of subroutines (SUB, G22, ...)

The program itself is started in the following situations:

- After switch-on
- On exiting the automatic mode
- On exiting the manual mode
- On exiting the diagnosis

NOTE System flag SM67 is set after the initial position program has been processed

5.2.3.6 Heading

The title PA-CONTROL Vx.xx is replaced by the first line of the assigned *.PTX file.

5.2.4 CANopen Control Console

NOTE Only devices of SÜTRON & Co. are specified as control consoles on the CANopen bus of PA-CONTROL!

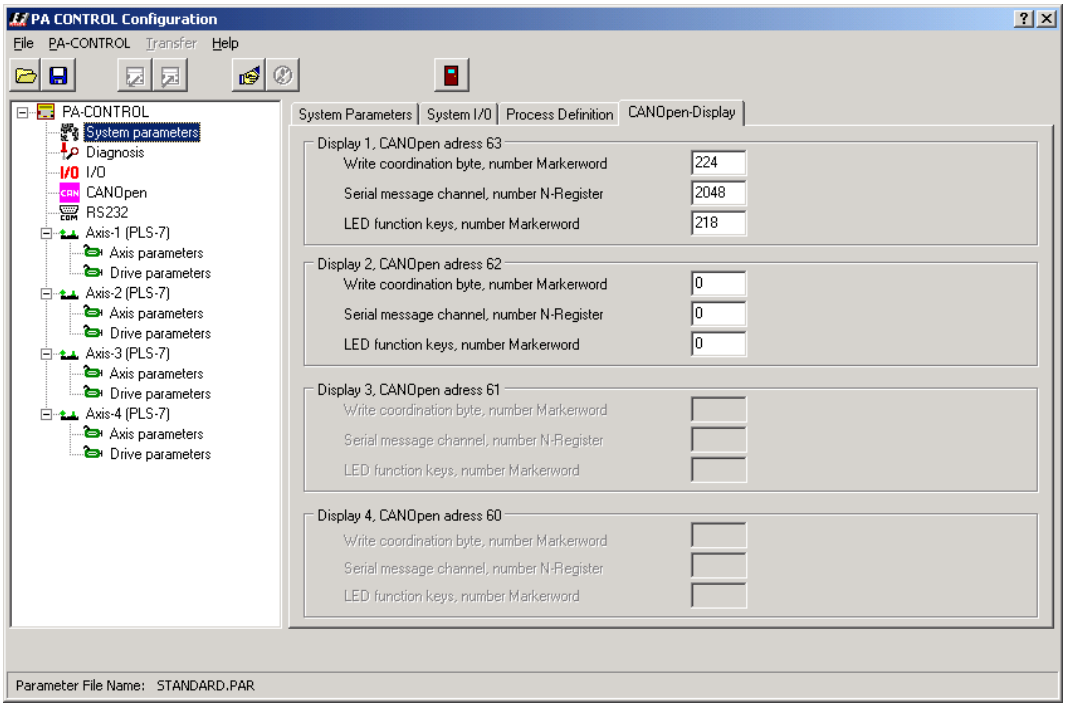

Figure 30: Display and Change

System parameters for the "poll range" are provided for control console 1 (CANopen address 63) and control console 2 (CANopen address 62) in PA-CONTROL.

Default settings after reinitialization of PA-CONTROL

Parameter	Type	Console 1	Console 0
Coordination byte	Number of flag word	224	0
Serial signalling channel	Number of N register	2048	0
LEDs function keys	Number of flag word	218	0

A tab for changing the default setting is available in the WinPAC program.

NOTE Please refer to the "SÜTRON control console" documentation for further information on the control console on the CANopen bus.

5.3 Diagnosis

5.3.1 System and Diagnosis Port

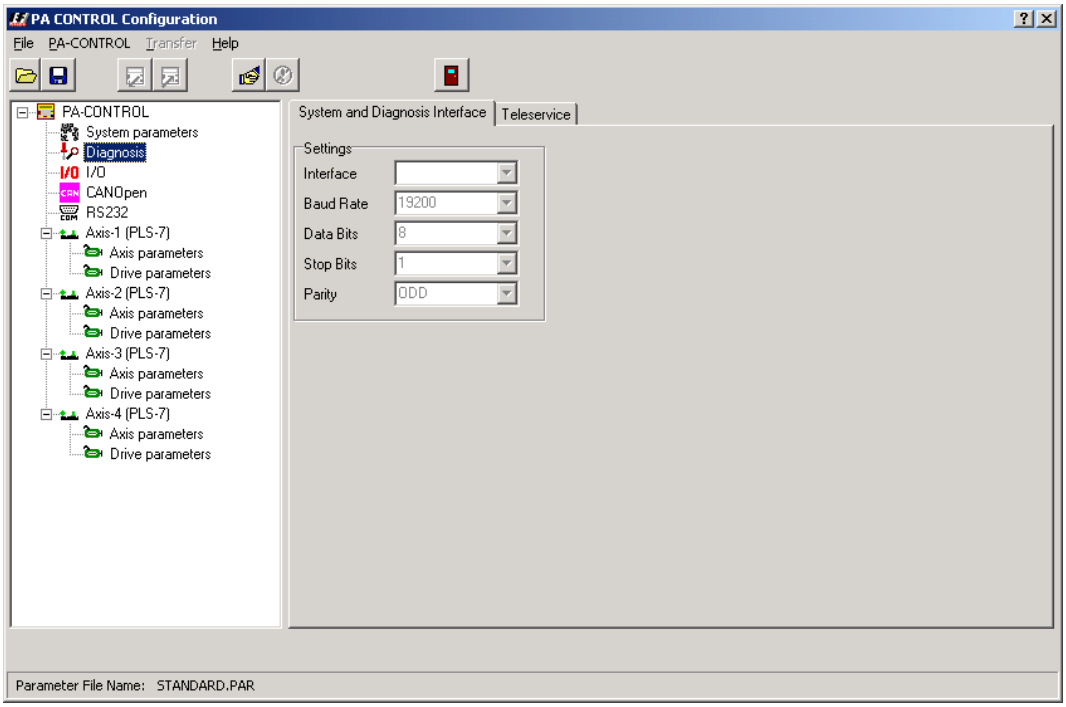

Figure 31: System and Diagnosis Port

System and diagnosis port

Parameter	Meaning
Port	Parameter is permanently set and can only be displayed and not changed
Baud rate	From V4.68 or higher, PA-CONTROL automatically adapts the baud rate of the port to the baud rate pre-selected in the WINPAC program. The baud rate can either be 19.2 or 57.6 Kbaud. The preset value is 19.2 Kbaud.
Data bits	Parameter is permanently set and can only be displayed and not changed
Stop bits	Parameter is permanently set and can only be displayed and not changed
Parity	Parameter is permanently set and can only be displayed and not changed

5.3.2 Teleservice Tab

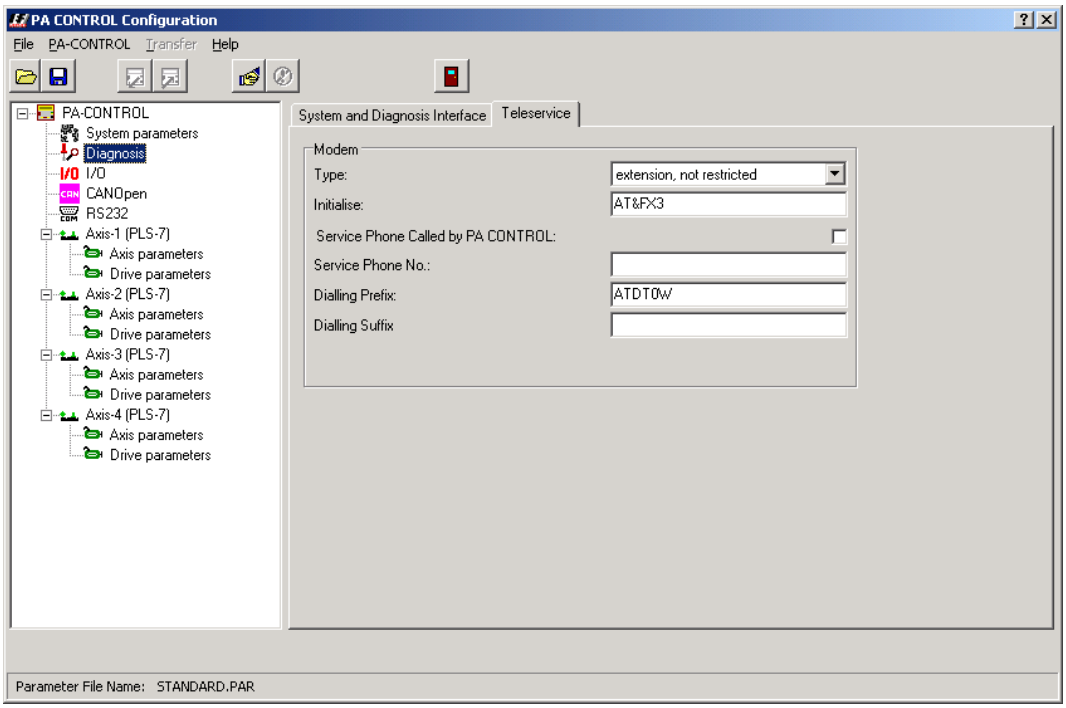

Figure 32: Setting the Teleservice Parameters

Teleservice

Parameter	Meaning
Type	Selected modem type
Initialise	Initialisation of modem
Service telephone no.:	Telephone number which is dialled by the modem
Dial prefix	String before telephone number
Dial suffix	String after telephone number

5.4 CANopen Bus Tab

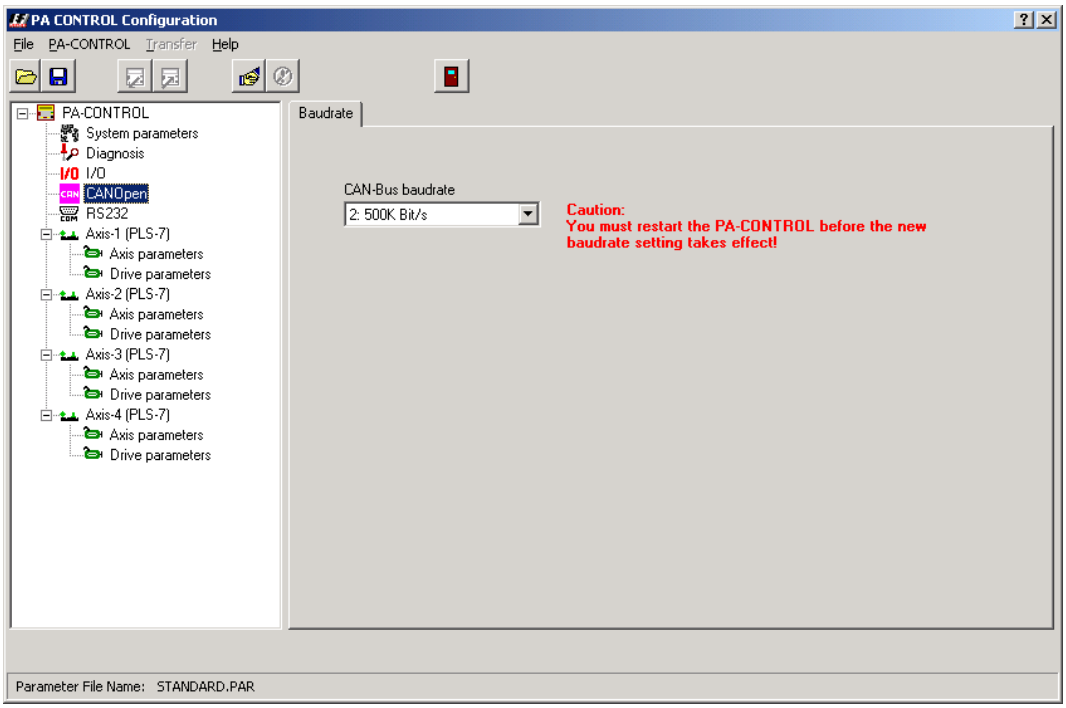

Figure 33: Setting the Baud Rate of the CANopen Bus

Baud rate of the CANopen bus

Parameter	Meaning
Baud rate	Standard= 500Kbaud, Selection: 125, 250, 500, 1000Kbaud

5.5 RS232 Port Tab

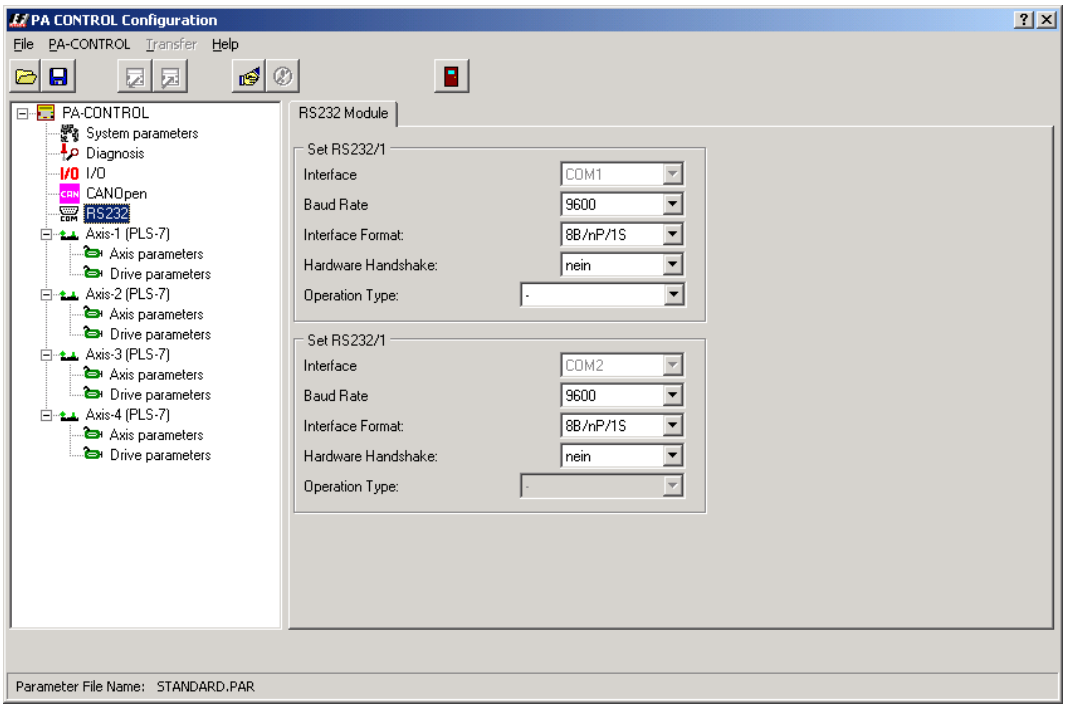

Figure 34: Setting the RS232/1 Port

5.5.1 COM1 Port

Parameter	Meaning
Baud rate	Standard = 9600Bd, Selection: 110,300, 1200, 2400, 4800, 9600, 19200.
Port format	Standard = 8B,nP,1S Selection: 8B,nP,1S or 7B,nP,1S or 7B,eP,1S or 7B,oP,1S
Hardware handshake	Standard : no Selection : yes/no
Mode	This port can be changed over for various modes. ▪ 0 = Commands of the G500.xx group use this port ▪ 1 = ONLINE command port (see interface manual) ▪ 2 = Modem port (only for CPU4)

5.5.2 COM2 Port

Baud rate	Standard = 9600Bd, Selection: 110,300, 1200, 2400, 4800, 9600, 19200.
Port format	Standard = 8B,nP,1S Selection: 8B,nP,1S or 7B,nP,1S or 7B,eP,1S or 7B,oP,1S
Hardware handshake	Standard : no Selection : yes/no
Mode	Only commands of the G500.xx group use this port

5.6 Profibus Tab

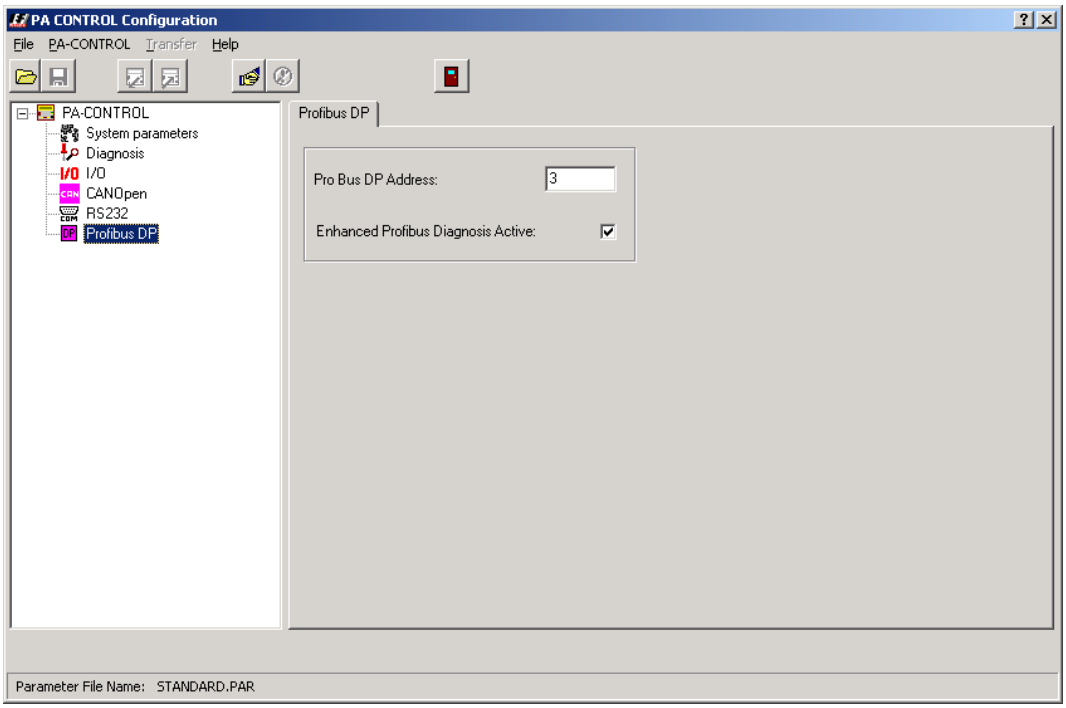

Figure 35: Setting the Profibus-DP Address

Setting the Profibus-DP address

Parameter	Meaning
Profibus-DP address	Standard = 0, i.e. no Profibus-DP module activated Selection: 2 to 126 **IMPORTANT**: Address 126 is only permitted for commissioning. User data may not be transferred using address 126!

5.7 Axis Parameters

5.7.1 Axis Parameter Tab

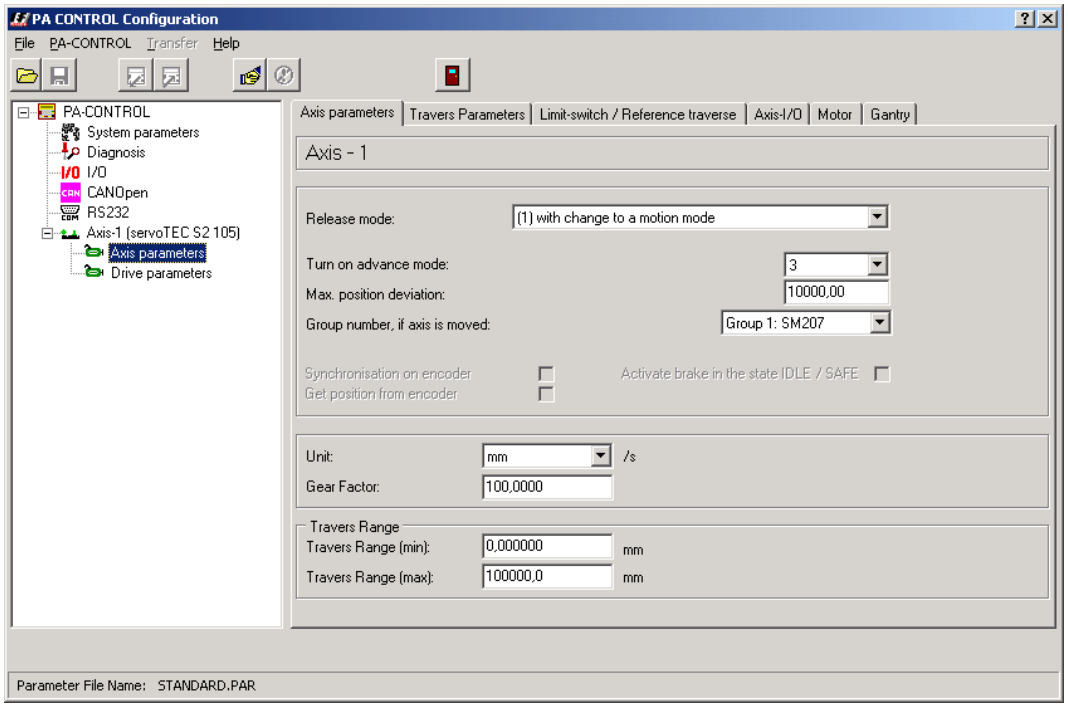

Figure 36: PA-CONTROL, Tab Axis Parameters

5.7.1.1 Release Mode

The enabling mode specifies the operating mode or the change of operating mode in which the axis is enabled.

Value of parameter	Meaning
0	Axis disabled
1	Enabling of the axis on change-over to a traversing mode
2	Enabling of the axis at a command in AUTOMATIC operation (G140-G141 commands)
3	Enabling of the axis immediately after initialization
4	Enabling of the axis on change-over to a traversing mode and STOP or START in the AUTOMATIC and ONLINE operating mode

5.7.1.2 Turn on Advance Mode

The way in which the axis is traversed by the operating system after the axis has been switched from the status "IDLE / SAFE" to the status "OPERATIONAL" can be set in the "Switch-on traversing mode".

Irrespective of whether the axis was traversed (the OFF-AXIS function interrupted a traversing command) or the axis was in position, a decision is made for the respective axis according to the following criteria:

Value	Meaning
0	The axis stops and is not traversed, even if it was moved or a traversing command interrupted
1	(DEFAULT) A traversing command which was interrupted by the operating system with the "STOP" function is continued. Otherwise the axis stops where it is and the current position is transferred.
2	The operating system moves the axis to the position at which the axis was located before it was switched to the "IDLE / SAFE" status. A traversing command which was interrupted by the function "OFF-AXIS" is continued.
3	The operating system checks whether the axis was moved in the "IDLE / SAFE" status. If the difference is greater than the value specified in the axis parameter "Maximum deviation of position", a system error (Exxx) is generated. Otherwise the axis is traversed to the position it was located at before change-over to the "IDLE / SAFE" status, or the interrupted traversing command is continued.
4	The operating system checks whether the axis was moved in the "IDLE / SAFE" status. If the difference is greater than the value specified in the axis parameter "Maximum deviation of position", a system flag (SM191, SM192,...) is set. Otherwise the axis is traversed to the position it was located at before change-over to the "IDLE / SAFE" status, or the interrupted traversing command is continued. If this system flag is set, the axis cannot be traversed and a system error will be generated. If this option is selected, the system flag must be requested in the application in the program (LD SM191, G21 SM191, ...) This request resets the system flag.

5.7.1.3 Max. Position Deviation

This parameter can be used to specify the amount by which the axis position may deviate when the axis is switched from the "IDLE / SAFE" status to the "OPERATIONAL" status. The status of the axis (IDLE / SAFE / OPERATIONAL ...) is influenced by the following:

- System input OFF-AXIS / ON-AXIS
- Command OFF-AXIS / ON-AXIS
- STOP / START-AFTER-STOP in automatic operation (see further axis parameters)
- STOP / START in ONLINE (see further axis parameters)

The way in which the value is interpreted and what the following procedure should be are specified in the axis parameter "Switch-on traversing mode".

5.7.1.4 Group Number, if Axis is moved

If an axis was moved by more than the value specified in the axis parameter "Maximum deviation of position" during the change-over from the "IDLE / SAFE" status to the "OPERATIONAL" status, the associated system flag is set (axis[1…] – SM[191…])

Value of parameter	group	System-Flag (SM)
0	no	
1	1	SM207
2	2	SM208
3	3	SM209
4	4	SM210

In the case of a multi-axis system, axes can be assigned to a group, in order to ensure that no axis continues to traverse as soon as an axis was moved beyond the maximum permitted deviation

If the system axis flag (SM191,...) is set, the group flag is also set. As long as one of these two flags is set; the axis cannot be traversed.
The flags are deleted by:

- Query in AUTOMATIC operation (LD SM191 ..., G21 SM191 ... , LD SM207 ...)
- Termination of AUTOMATIC operation or ONLINE

NOTE A group flag cannot be deleted directly. The group flags is deleted by delelting all the flags in the group

5.7.1.5 Synchronisation on Encoder

One edge of the rotary encoder is synchronized to during referencing and when exiting the measuring mode, in order to increase the accuracy (resolution) for transfer of the position of the rotary encoder.

This parameter is only valid for PA-CONTROL EP/MP.

5.7.1.6 Get Position from Encoder

The current position of the rotary encoder is transferred as an axis position when the measuring mode is exited with the "G141 command".

This parameter is only valid for PA-CONTROL EP/MP.

5.7.1.7 Aktivate Brake in State IDLE / SAFE

Prevents a vertical axis from "falling through".

This parameter is only valid for PA-CONTROL EP/MP.

5.7.1.8 Unit

Setting for the desired display device. It is possible to add further units. The gear factor must be considered when setting the display device.

5.7.1.9 Gear Factor

Setting for the gear factor. See section *5.11 Parameter Calculation, page 141* for a calculation example

5.7.1.10 Traversing Range (min.)

Lower traversing limit (software limit switch)

5.7.1.11 Traversing Range (max.)

Upper traversing limit (software limit switch)

5.7.2 Limit Switches / Approach to Reference Point

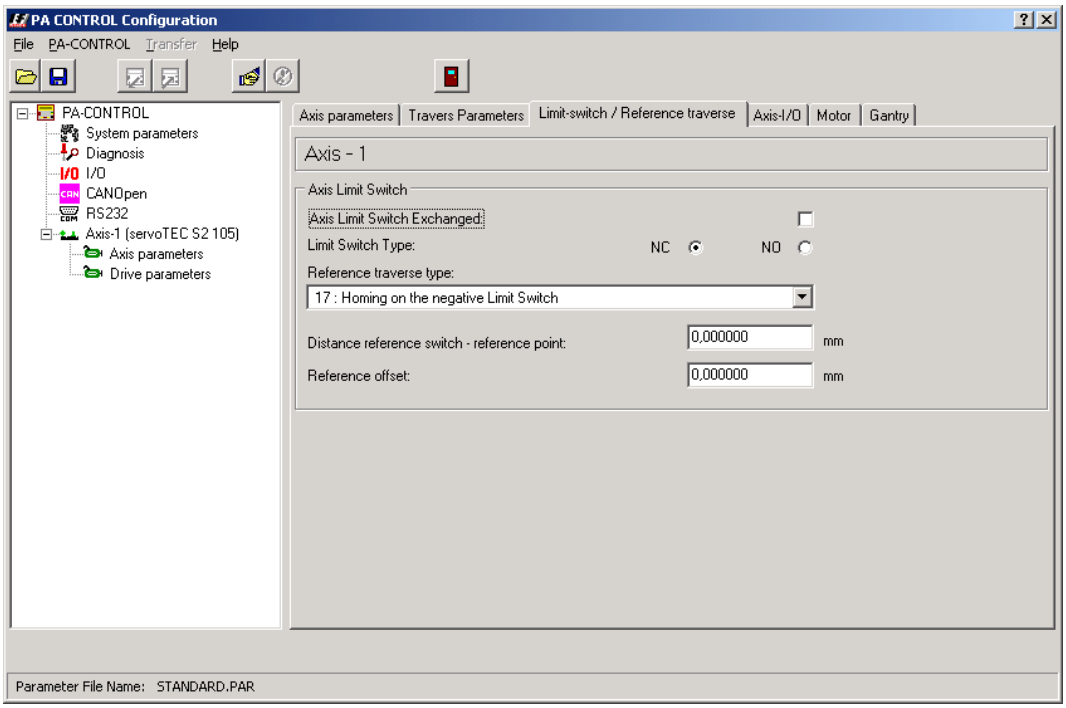

Figure 5-37: Limit switches and approach to Ref. Point for PA-CONTROL Compact

NOTE You will find a list of the minimum and maximum values and the standard value in section *5.8.4 Limit values of the axis parameters, page 126.*

5.7.2.1 Axis Limit Switch exchanged

Positive and negative limit switches can be exchanged without changes to hardware

5.7.2.2 Limit Switch Type

Selection of the contact type used:

- Normally closed contact
- Normally open contact

5.7.2.3 Reference run

Definition of the way of referencing. It depends on the type of axis.

5.7.2.4 Distance of the Reference Switch Zero Point

Entry for zero shift after approach to reference point

5.7.2.5 Reference Offset

Any desired absolute position can be assigned to the reference position (zero position) reached at the end of referencing by means of the parameter "Reference offset".

5.7.3 Limit Switches / Approach to Reference Point for Axis Type servoTEC Tab

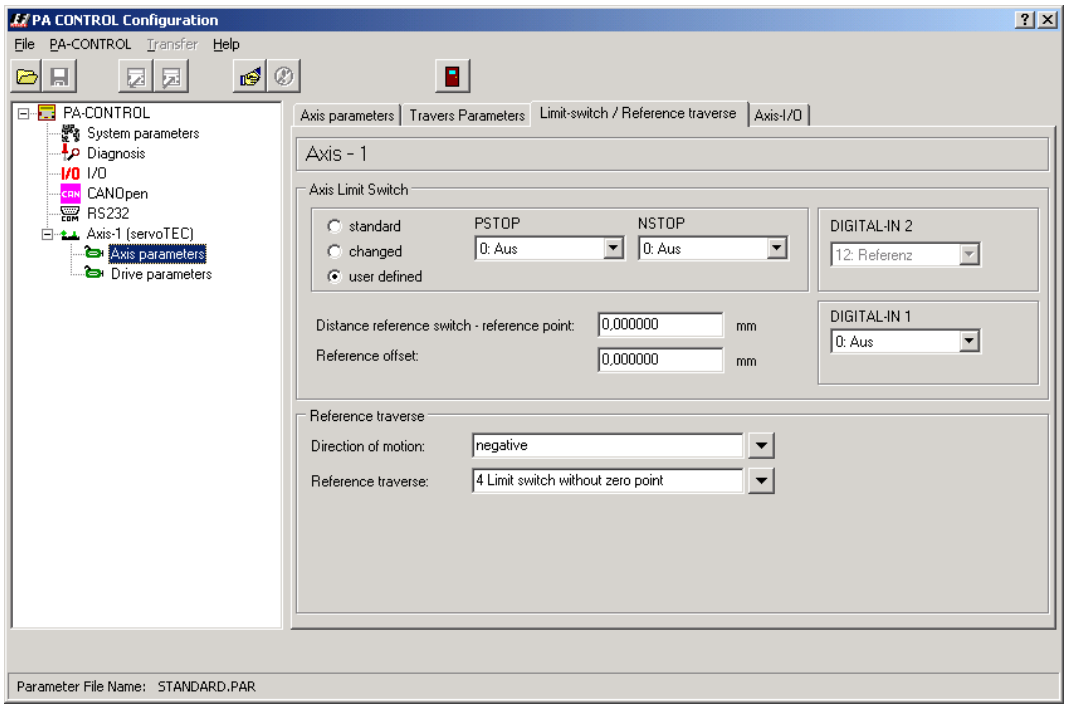

Figure 5-38: Limit Switches / Approach to Reference Point for Axis Type servoTEC

5.7.3.1 Distance of the Reference Switch Zero Point

Entry for zero shift after approach to reference point

5.7.3.2 Reference Offset

Any desired absolute position can be assigned to the reference position (zero position) reached at the end of referencing by means of the parameter "Reference offset".

5.7.3.3 Direction of Motion and Reference Traverse

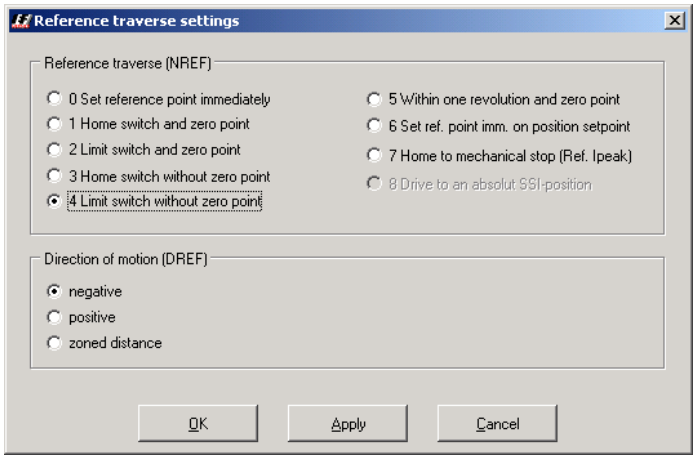

Figure 39: Reference Traverse Settings

5.7.4 Axis-I/O

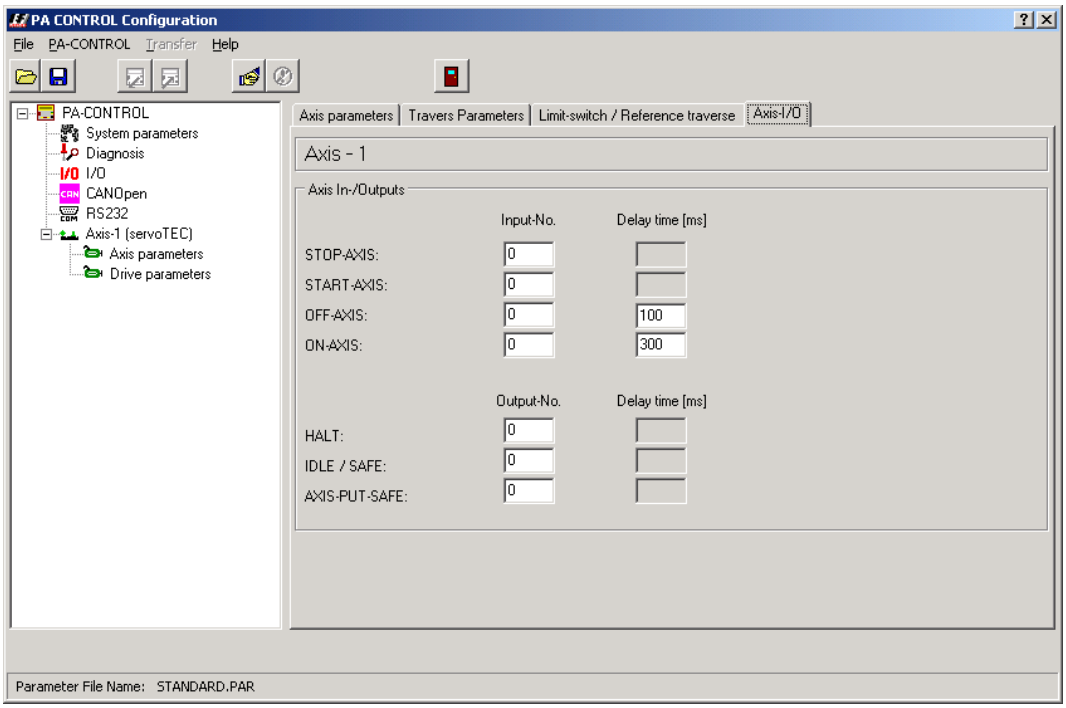

Figure 40: PA-CONTROL, Axis-I/O

5.7.4.1 STOP-Axis Input-No

Number of a digital input which is to be used for this function (0 ... 2048)

If the value for this parameter is not equal to zero, the input must be under voltage if the axis is to be traversed in AUTOMATIC mode. Otherwise the traverse is not started or is interrupted if the input is not under voltage during the traverse.

The "STOP-AXIS" function is only active in the AUTOMATIC and ONLINE mode of PA-CONTROL.

5.7.4.2 START-Axis Input-No

Number of a digital input which is to be used for this function (0 ... 2048)

If the value for this parameter is not equal to zero and the axis is in the "HALT WHILE OPERATIONAL" or "HALT WHILE ACTIVE" status, the axis can be restarted by supplying this input with voltage (STOP-AXIS input must be under voltage). If the axis was previously in the "IDLE / SAFE" status, the situation is checked in the switch-on traversing mode and the relevant procedure selected before axis START.

The "START-AXIS" function is only active in the AUTOMATIC and ONLINE mode of PA-CONTROL.

5.7.4.3 OFF-Axis Input-No

This axis parameter can be used to specify whether and which digital input activates the "OFF-AXIS" function. The "OFF-AXIS" function is only active in the AUTOMATIC and ONLINE mode of PA-CONTROL. The input must be under voltage, otherwise the "OFF-AXIS" function is activated.

Function:

- If the axis is in the OPERATIONAL oder HALT WHILE OPERATIONAL or HALT WHILE ACTIVE status, the axis is switched to the IDLE or SAFE status.
- If the axis is running, it is stopped immediately, i.e. the positioning is interrupted and the axis changes to the HALT WHILE ACTIVE status. The axis is subsequently switched to the IDLE or SAFE status.

5.7.4.4 ON-Axis Input-No

This axis parameter can be used to specify whether and which digital input activates the "ON-AXIS" function. The "ON-AXIS" function is only active in the AUTOMATIC and ONLINE mode of PA-CONTROL.

Function:

- If the input is under voltage, the axis is switched from the IDLE or SAFE status to the HALT WHILE OPERATIONAL/ACTIVE status. The OPERATIONAL or ACTIVE status is subsequently changed over according to the axis parameter "Switch-on traversing mode".
- The function "ON-AXIS" can only be active if the "OFF-AXIS" function has not been activated (e.g.: "OFF-AXIS" input under voltage). The digital output IDLE / SAFE would blink in this case.

5.7.4.5 ON-Axis Delay time

Time delay for ON-AXIS

5.7.4.6 OFF-Axis Delay time

Time delay for OFF-AXIS

5.7.4.7 HALT Output-No

Number of a digital output which is to be used for this function (0 ... 2048). If this axis output has been activated (parameter value not equal to zero), the output is set if the axis is in the HALT WHILE OPERATIONAL/ACTIVE status, otherwise it is reset. The output is only active in the AUTOMATIC and ONLINE mode of PA-CONTROL.

This output blinks if the "START-AXIS" function is active and the "STOP-AXIS" function is also still active.

5.7.4.8 IDLE / SAFE Output-No

Number of a digital output which is to be used for this function (0 ... 2048). If this value for the parameter is not equal to zero, the digital output is set if the axis has been switched to the IDLE or SAFE status by the "OFF-AXIS" function. If the "PUT-SAFE" function has been activated, the "AXIS IS IDLE/SAFE" output is not set until the "SAFE" status has been reached. The "AXIS IS IDLE/SAFE" function is only active in the AUTOMATIC and ONLINE mode of PA-CONTROL.

This output blinks if the "ON-AXIS" function is active and the "OFF-AXIS" function is also still active.

5.7.4.9 AXIS-PUT-SAFE

Number of a digital output which is to be used for this function (0 ... 2048)

The "AXIS-PUT-SAFE" function is only active in the AUTOMATIC and ONLINE mode of PA-CONTROL.

If this parameter has been activated (value not equal to zero), the axis is switched to the SAFE status and not to the IDLE status by the "OFF-AXIS" function.

In this respect, the enabling of the power amplifier is reset, the corresponding time allowed to elapse, the output "AXIS-PUT-SAFE" set (AS relay on servoTEC) and a waiting time of 100 milliseconds inserted before the axis receives the "SAFE" status.

A waiting time of 100 milliseconds is also inserted before the axis receives the OPERATIONAL or HALT status during switch-on of the axis, i.e. during change-over to the OPERATIONAL or HALT status.

NOTE Each axis must have its own PUT-SAFE output. A PUT-SAFE output cannot be used for several axes.

5.8 Travers Parameters

5.8.1 Travers Parameters Menu

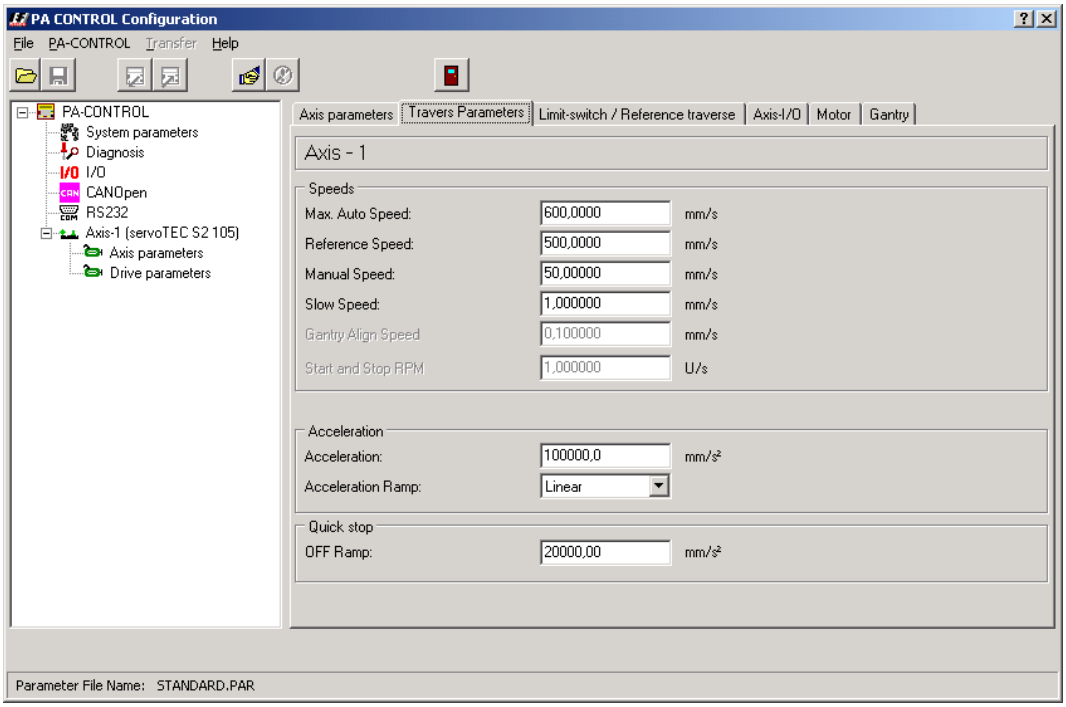

Figure 41: Travers Parameters

5.8.1.1 Traversing Speed

Maximum permissible traversing speed.

5.8.1.2 Reference Speed

Speed at which the approach to reference point is executed

5.8.1.3 Manual Speed

Speed at which manual traversing is executed

5.8.1.4 Creep Speed

Speed at which the limit switch is cleared during the approach to reference point

5.8.1.5 Start/stop Rotational Speed

Rotational speed at which the acceleration starts

5.8.1.6 Acceleration

Change in speed per sec.

5.8.1.7 Ramp Type (Acceleration)

Sets the form of the Ramp Linear $Sin^2(t)$

5.8.1.8 OFF-Ramp

Change in speed if switching the axis OFF

5.8.2 Motor

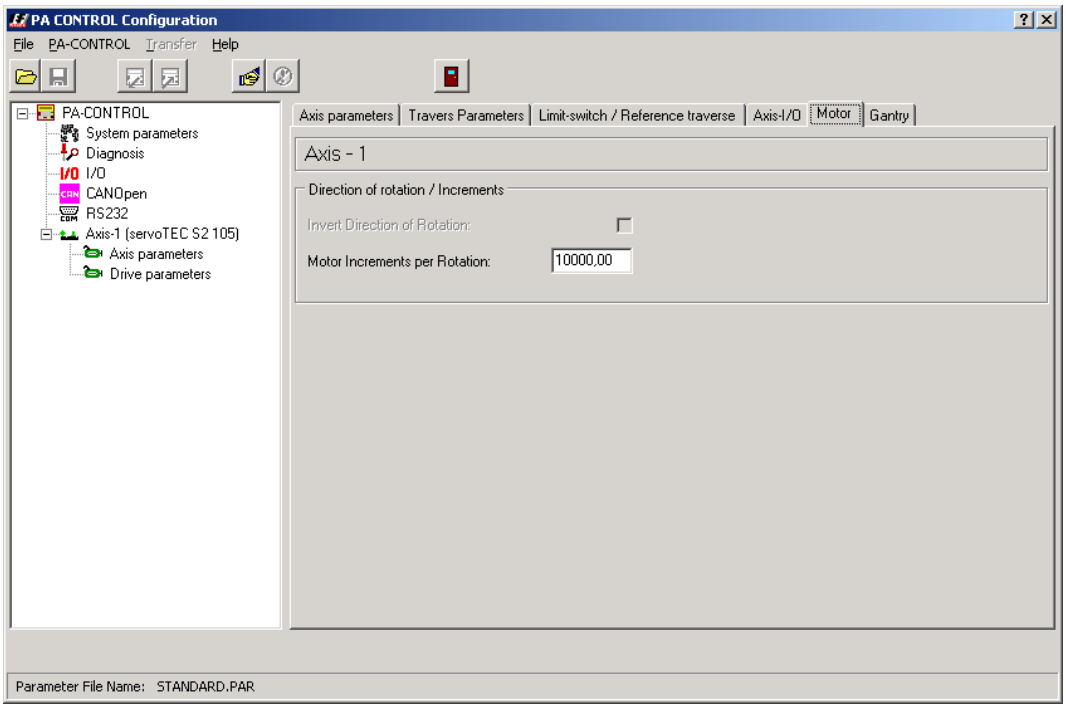

Figure 42: Motor

5.8.2.1 Invert Direction of Rotation

Reversal of the rotational direction of the motor.

5.8.2.2 Motor Increments per Rotation

Number of motor steps for the electromagnetic design.

5.8.3 Gantry

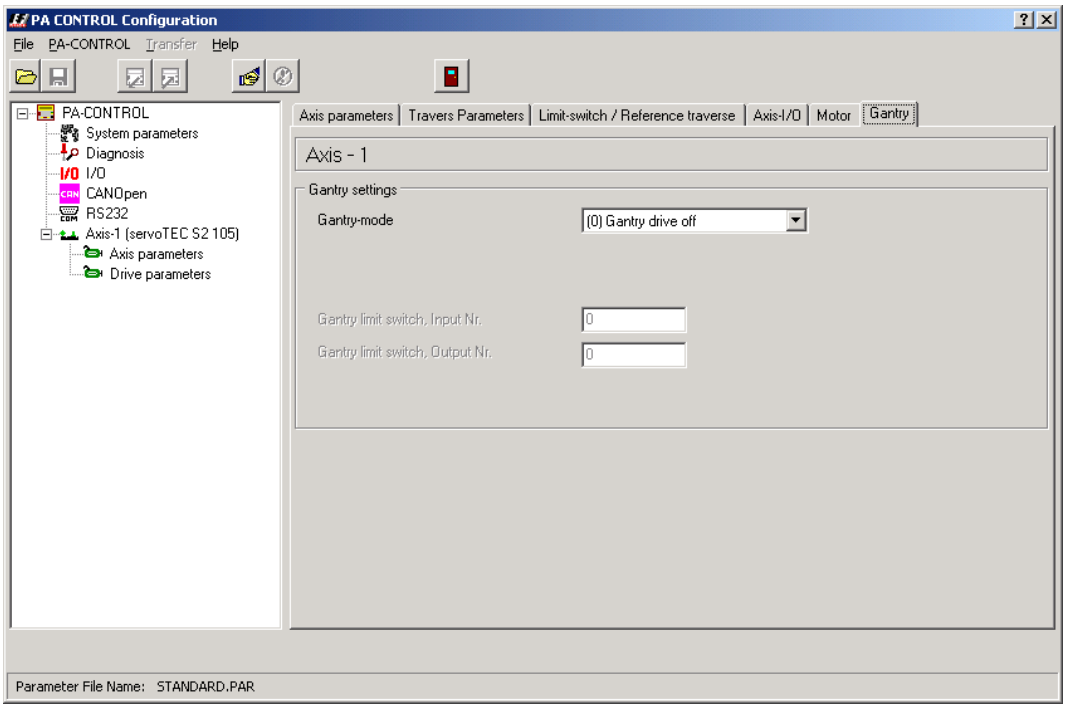

Figure 43: Gantry

5.8.3.1 Gantry mode

Type of Axis	Gantry system 1	Gantry system 2	Gantry system 3
Stand alone Axis	00	00	00
Gantry system MASTER-Axis	11	21	31
Gantry system SLAVE-Axis	12	22	32

5.8.3.2 Gantry Limit Switch, Input-No.

The number of the digital input, where the “gantry-limit switch” is connected

5.8.3.3 Gantry Limit Switch, Output-No.

The number of the output, which is connected to the negative limit switch of drive assembly

5.8.4 Limit values of the axis parameters

No.	Parameter name	Display device	Minimum value	Standard value	Maximum value
1	Traversing speed "1"	AE/s	0.0005 "3"	600.0	10000000 "3"
2	Reference speed "1"	AE/s	0.0005 "3"	100.0	10000000 "3"
3	Manual speed "1"	AE/s	0.0005 "3"	50.0	5000000 "3"
4	Creep speed "1"	AE/s	0.0005 "3"	10.0	1000000 "3"
5	Motor start/stop rotational speed "1"	rev/s	0.0	0.5	10
6	Acceleration "1"	AE/s²	0.08 "3"	2000.0	134217727
7	Gear factor	-	0.001	100.0	20000.0
8	Traversing range, minimum	AE	-8000000"3"	0.0	8000000 "3"
9	Traversing range, maximum	AE	-8000000"3"	10000.0	8000000 "3"
24	Rotational direction	CW/CCW "2"	0	0	1
26	Motor steps per revolution	Steps/rev	200.0	3200.0	20000.0
27	Motor full steps/revolution	Full steps/rev	200.0	200.0	500.0
28	Axis limit switch exchanged	0 or 1	0	0	1
32	Limit switch type NOC	0 or 1	0	0	1
33	Distance of the zero point to the limit switch	AE	0.0	0.0	10000.0
37	Absolute dimension system activated	0 or 1	0	0	1

"1" The marked parameters have purely theoretical values (min. / max.) The values change if the gear factors for PLS6 / 7 / 8 / 9 change as shown in the following tables for gear factors 1 to 40:

"2" CW=clockwise; CCW=counter clockwise

"3" These values are theoretical limit values which change depending on the gear factor.

Application example 1:

Parameter	Gear factor = 1		Gear factor = 10	
	Minimum	Maximum	Minimum	Maximum
Traversing speed [AE/s]	10	50000	1	5000
Reference speed [AE/s]	10	50000	1	5000
Manual speed [AE/s]	10	50000	1	5000
Creep speed [AE/s]	10	50000	1	5000
Motor start/stop rotational speed [U/s]	0	10	0	10
Acceleration [AE/s^2]	7000	1500000	700	150000

Application example 2:

Parameter	Gear factor = 20		Gear factor = 40	
	Minimum	Maximum	Minimum	Maximum
Traversing speed [AE/s]	0.5	2500	0.25	1250
Reference speed [AE/s]	0.5	2500	0.25	1250
Manual speed [AE/s]	0.5	2500	0.25	1250
Creep speed [AE/s]	0.5	2500	0.25	1250
Motor start/stop rotational speed [U/s]	0	10	0	10
Acceleration [AE/s^2]	3500	75000	1750	37500

5.9 Drive Parameters Stepper Motor Axis

5.9.1 Motor Parameters of a Stepper

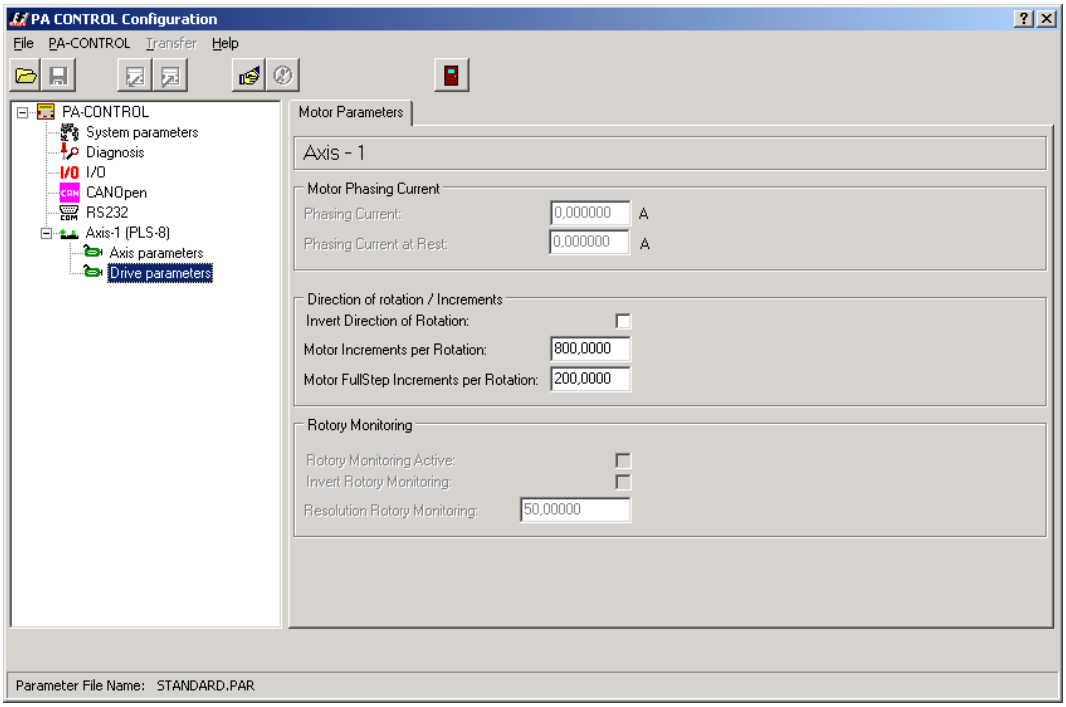

Figure 44: Motor Parameters of a Stepper

5.9.1.1 Motor Phase Current

Maximum phase current, the setting can be found on the rating plate of the connected motor

5.9.1.2 Motor Phase Current at Rest (Standstill)

Motor current at standstill, i.e. the PA-CONTROL MP is switched on and ready or a defined position is being maintained

5.9.1.3 Invert Direction of Rotation

Reversal of the rotational direction of the motor

5.9.1.4 Motor Steps per Revolution

Permanently set at 3200 steps/revolution in the PA-CONTROL MP

5.9.1.5 Motor Full Steps per Revolution

Number of motor steps possible as a result of the electromagnetic model (Standard is 200)

5.9.1.6 Rotation Monitoring active

Activation of the rotation monitoring

5.9.1.7 Invert Rotary Encoder

Change in the counting direction of the rotary encoder

5.9.1.8 Resolution of the Rotary Encoder

Resolution of the rotary encoder in increments per revolution

5.10 Drive Parameters servoTEC S2 Axis

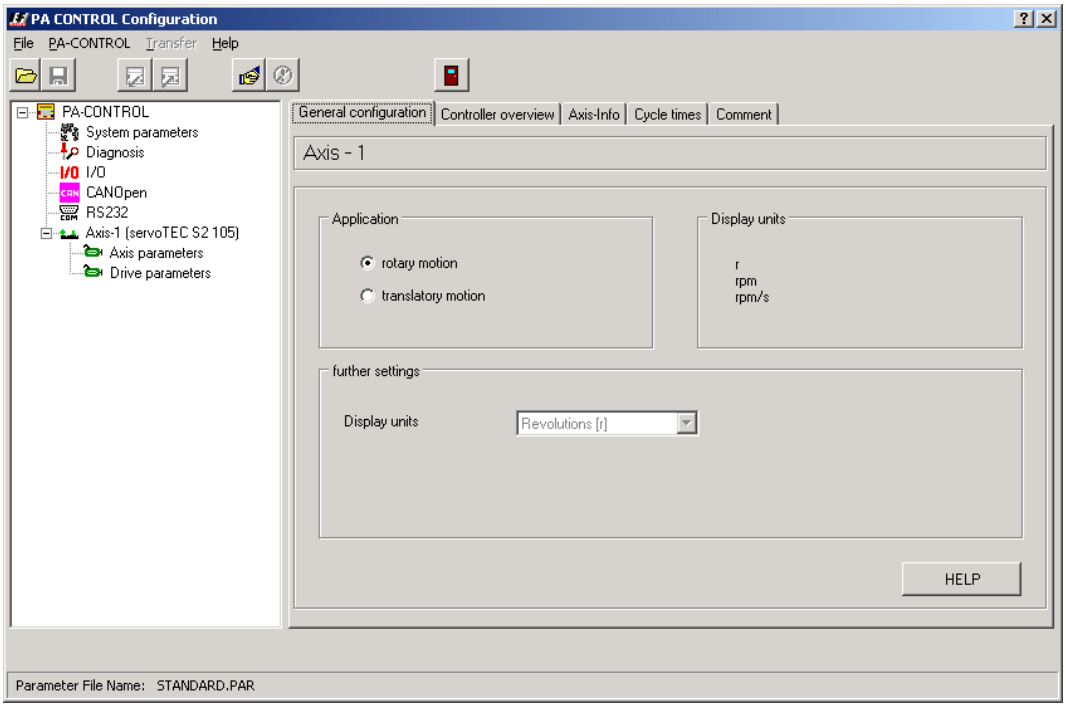

Figure 45: Drive Parameters

More information you may get in the help of WINPAC.

5.10.1 Drive Parameters of servoTEC

5.10.1.1 Drive Parameters for Positioning

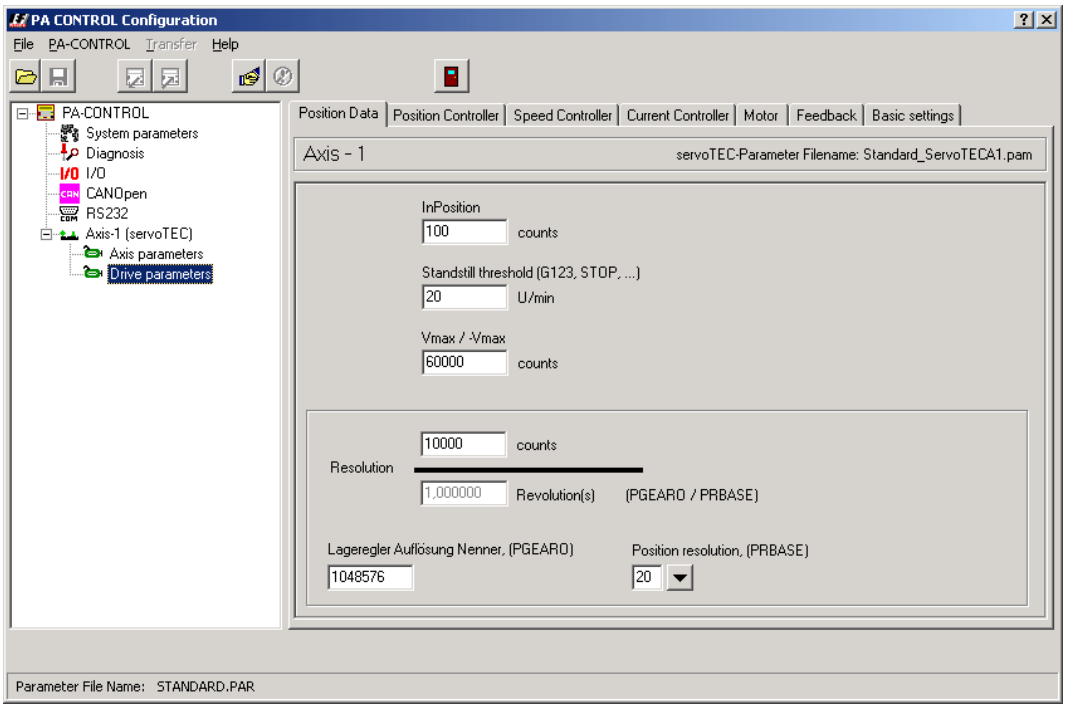

Figure 46: Drive Parameters for Positioning

WINPAC Parameters	Designation in the ASCII object reference	Short description
In Position	**PEINPOS**	Status message for traversing job
Standstill threshold	**VEL0**	Speed threshold for standstill message
V_{max}	**PVMAX**	Maximum speed which may not be exceeded by a traversing set
Resolution	**PGEARI**	Increments per motor revolution

5.10.1.2 Drive Parameters for Position Controller

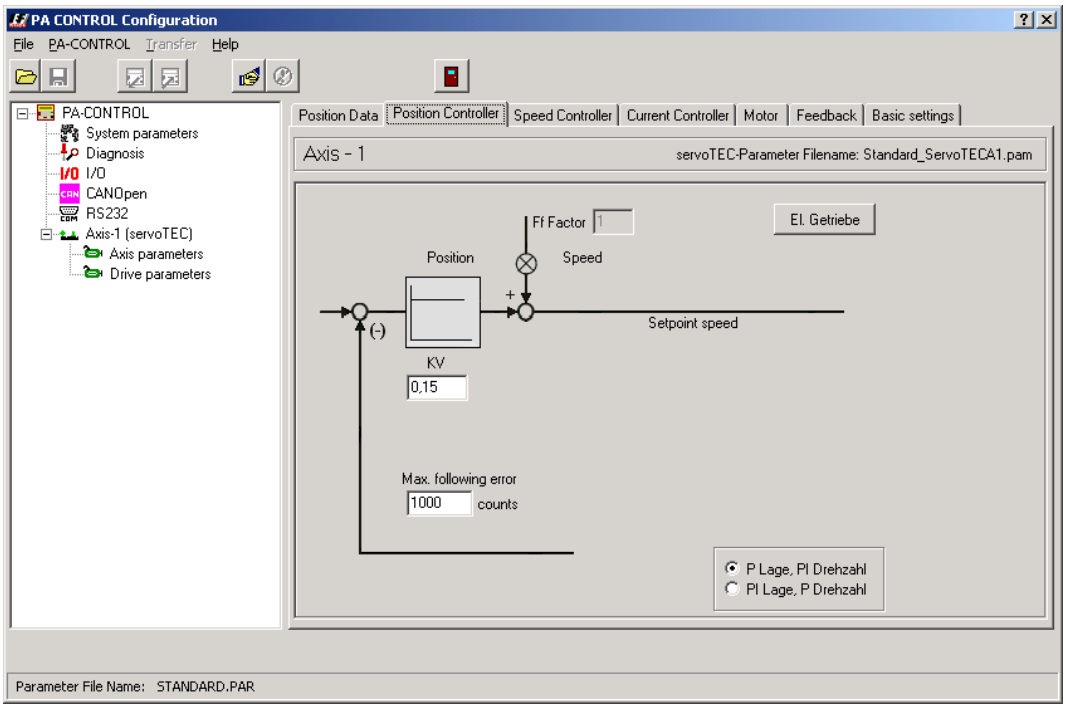

Figure 47: Drive Parameters for Position Controller

WINPAC Parameters	Designation in the ASCII object reference	Short description
KV	**GP**	Position controller: proportional gain
KP	**GPV**	Amplification of the speed controller when using the PI position controller
Tn [ms]	**GPTN**	Position controller: integral-action time
Max. tracking error	**PEMAX**	Tracking error monitoring

5.10.1.3 Drive Parameters for Speed Controller

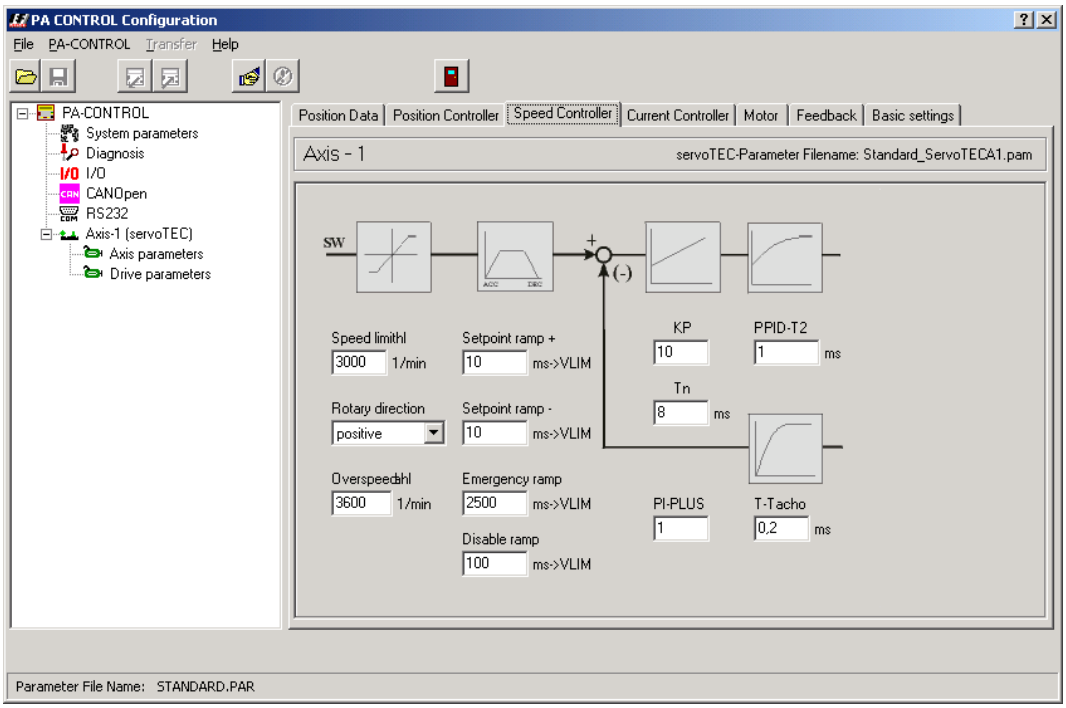

Figure 48: Drive Parameters for Speed Controller

WINPAC Parameters	Designation in the ASCII object reference	Short description
Maximum speed	**VLIM**	Maximum speed for speed control
Direction of rotation	**DIR**	DIR=1, positive counting direction – positive rotational speed, speed and current settings cause the motor shaft to turn in a clockwise direction DIR=0, negative counting direction
Overspeed	**VOSPD**	Definition of the tripping threshold for error message F08 (overspeed)
SW ramp +	**ACC**	Acceleration ramp of the speed controller in msec
SW ramp -	**DEC**	Braking ramp of speed controller in msec
Emergency ramp	**DECSTOP**	Ramp for emergency stop - Error - Emergency stop input
Disable ramp	**DECDIS**	Speed of braking ramp on disabling the output stage, enable=0

5.10.1.4 Drive Parameters for Current Controller

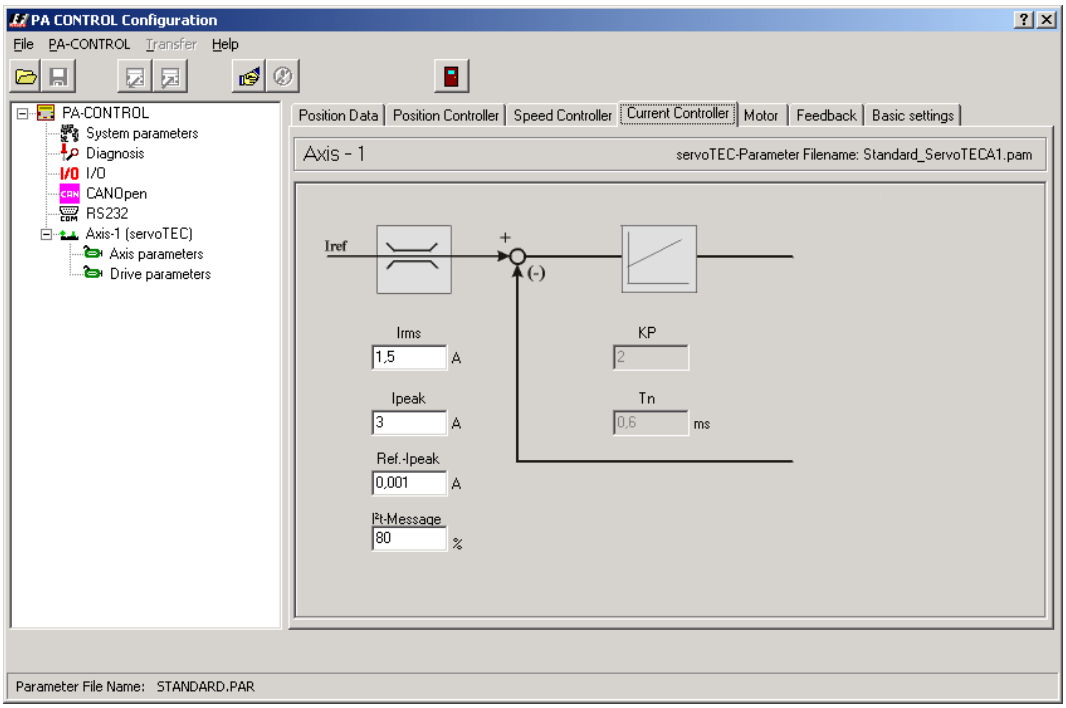

Figure 49: Drive Parameters for Current Controller

WINPAC Parameters	Designation in the ASCII object reference	Short description
I_{ms}	**ICONT**	The constant current required by the application, corresponds to 100% I^2T current
I_{peak}	**IPEAK**	Sets the desired maximum current
Ref.-I_{peak}	**REFIP**	Definition of the peak current for the reference point approach to stop
I^2t message	**I2TLIM**	I^2t message threshold

5.10.1.5 Drive Parameters for Motor

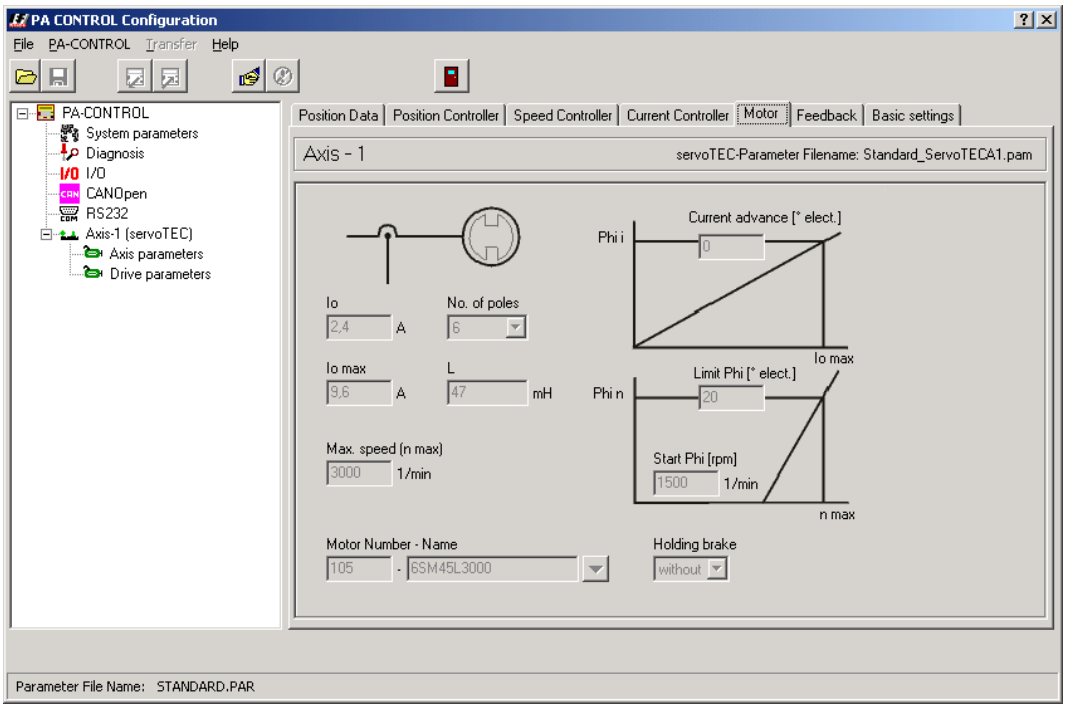

Figure 50: Drive Parameters for Motor

WINPAC Parameters	Designation in the ASCII object reference	Short description
I_O	**MICONT**	Rated current of the motor
$I_{O\ max}$	**MIPEAK**	Peak current of the motor
Number of poles	**MPOLES**	Number of motor poles
L	**L**	Stator inductivity of the motor
Limit speed	**MSPEED**	Maximum speed of the motor
Motor no. name	**MNUMBER/MNAME**	Loading of a motor data set / motor name
Current advance	**MTANGLP**	Current advance
Final value Phi	**MVANGLF**	Speed-dependent advance (Final value Phi)
Service	**MVANGLB**	Speed-dependent advance (Service Phi)
Brake	**MBRAKE**	Preselection for motor brake

5.10.1.6 Drive Parameters for Feedback

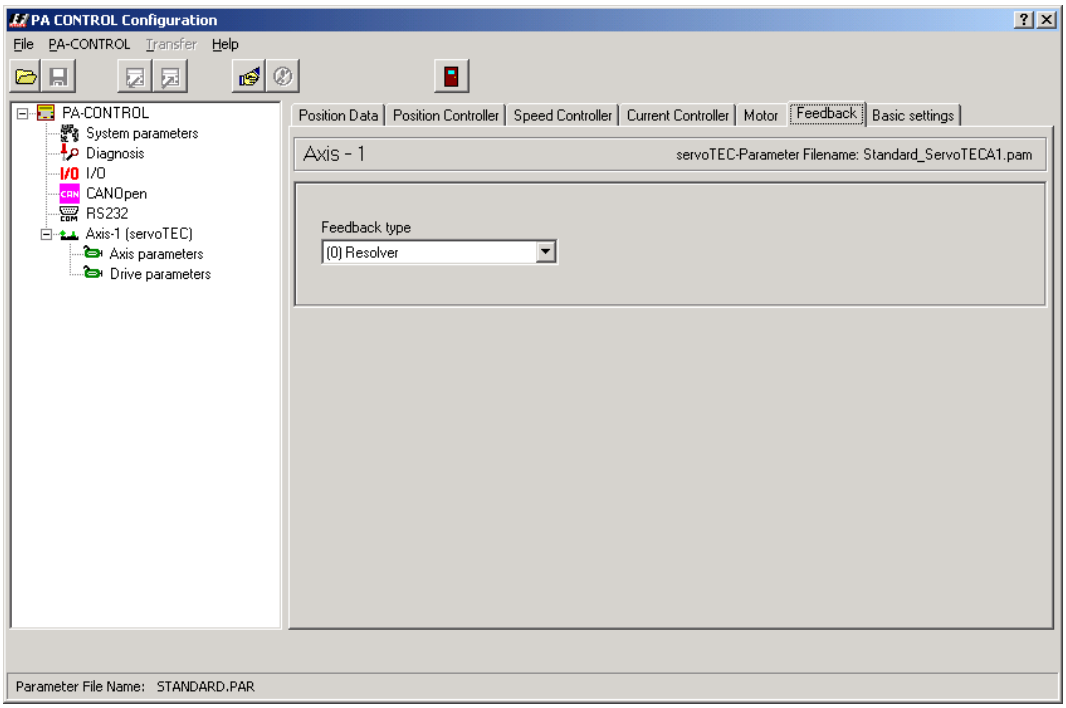

Figure 51: Drive Parameters for Feedback

WINPAC Parameters	Designation in the ASCII object reference	Short description
Feedback	**FBTYPE**	Preselection of the feedback unit

5.10.1.7 Drive Parameters for Basic Settings

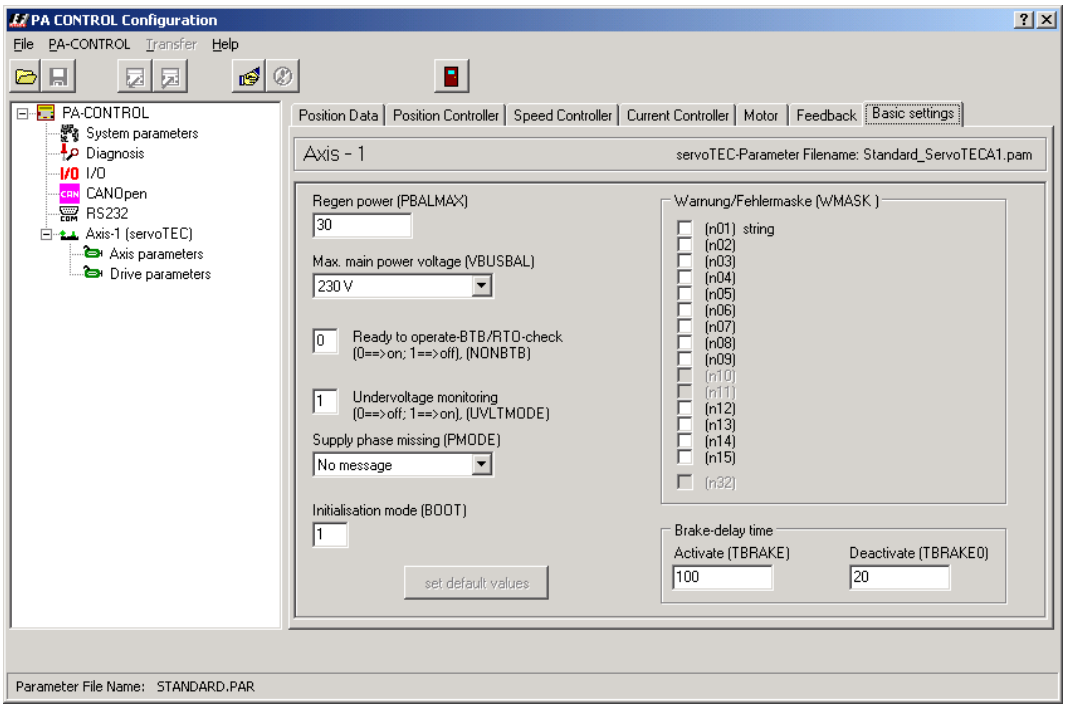

Figure 52: Drive Parameters for Basic Settings

WINPAC Parameters	Designation in the ASCII object reference	Short description
Ballast performance	**PBALMAX**	Maximum ballast performance
Max. supply voltage	**VBUSBAL**	Maximum supply voltage
Check supply system BTB	**NONBTB**	Check BTB for supply system on/off
Undervoltage monitoring	**UVLTMODE**	Undervoltage mode
Warning/fault mask	**WMASK**	Warning/fault mask
Initialization type for amplifier	**BOOT**	Type of initialization at the start of the amplifier
Mains phase missing	**PMODE**	Mains phase mode
Brake reaction time	**TBRAKE**	Disable delay time for braking
Deactivate	**TBRAKE0**	Brake release time

5.10.2 Drive Parameters flexmoTEC

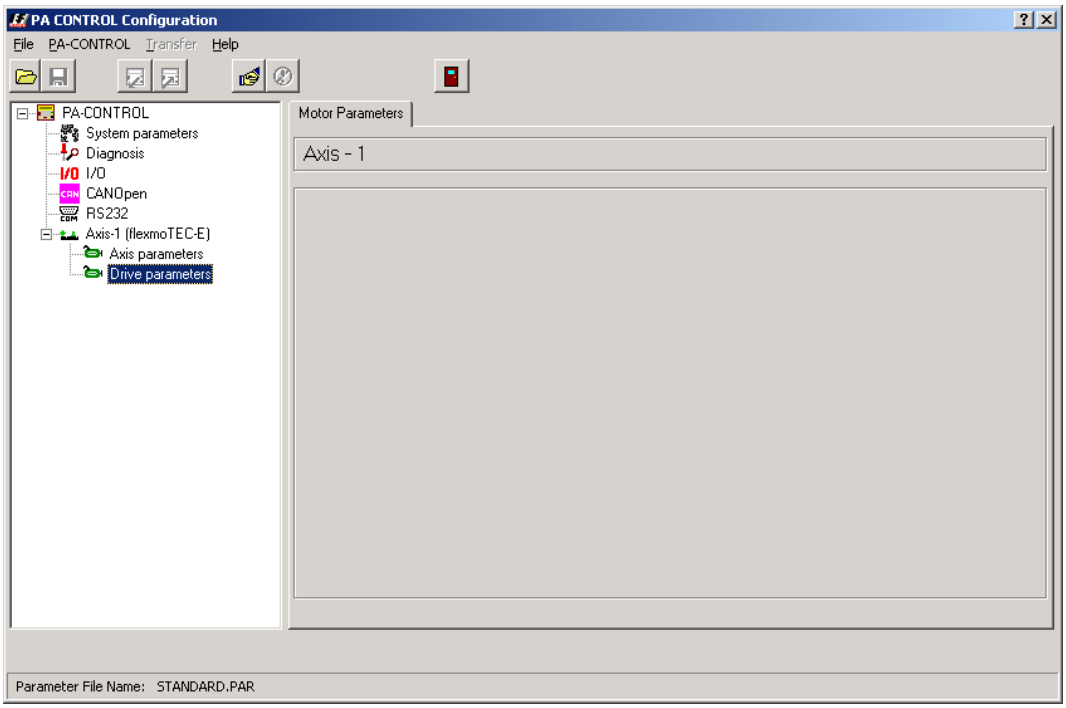

Figure 53: Drive Parameters flexmoTEC

5.10.2.1 Feedback

Parameter	Bedeutung
0	Resolver
1	reserviert
2	Hiperface
3	Auto
4	EnDAT
5	reserviert
6	SinCos EEP
7	SinCos Auto
8	RS422 & W&S
9	RS422
10	ohne Rückführung
11	SinCos mit Hallsensor
12	RS422 mit Hallsensor
13	Reservier
14	reserviert
15	Reserviert
16	Resolver -> SinCos

NOTE For the axis type flexmoTEC the drive parameters are edited in LinMot-Talk.

5.10.3 Drive Parameters intelliMOT

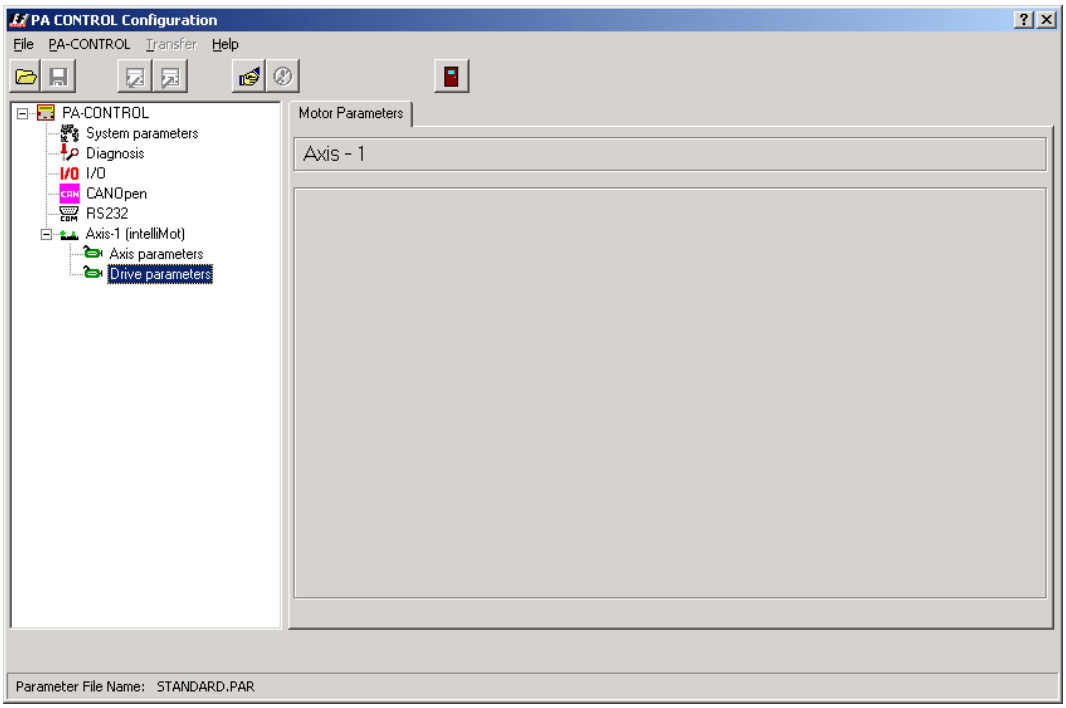

Figure 54: Drive Parameters intelliMOT

NOTE For the axis type intelliMOT the drive parameters are edited in intelliTool.

5.10.4 Drive Parameters dunMOT

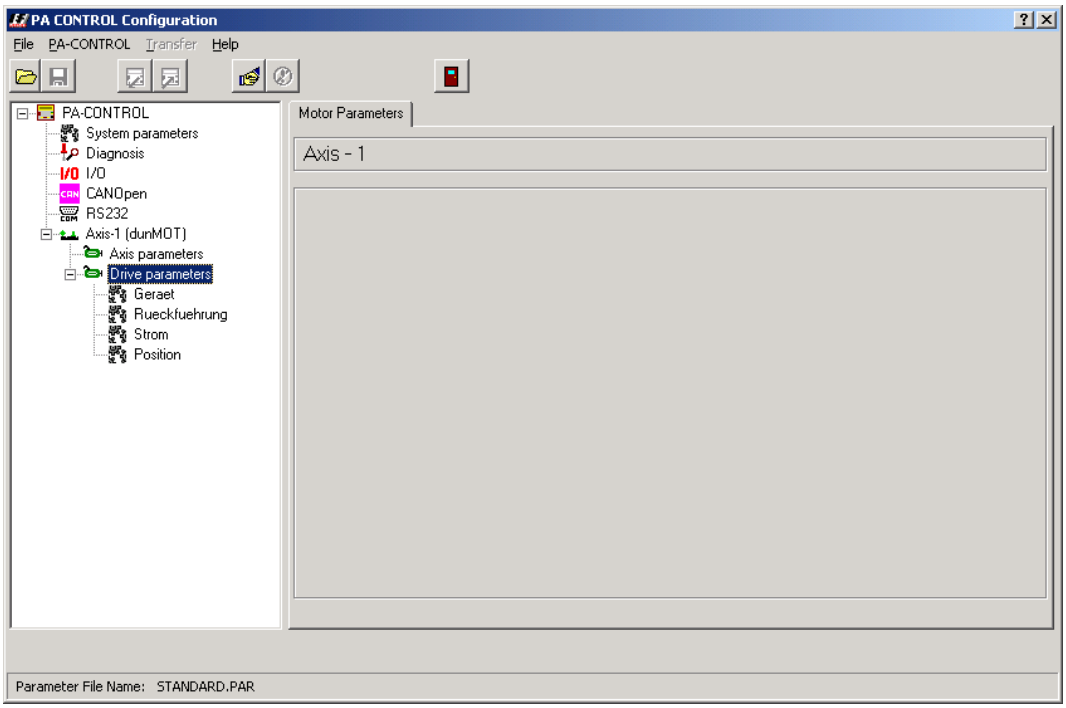

Figure 55: Drive Parameters dunMOT

Bei Anschluss und Inbetriebnahme eines dunMOT-Antriebes sind die folgenden Hinweise unbedingt zu beachten:

- Bevor die Antriebe an die PA-CONTROL angeschlossen werden können, muss die Baudrate und die CANopen-Adresse mit der Software „drive-Assistant“ der Fa. Dunkermotoren eingestellt werden.
- Die Achsparameter werden, wie auch bei anderen PA-CONTROL-Achsen, entsprechend der Applikation in den Registerkarten eingetragen.
- Die Antriebsparameter (Strom, ...) werden mit Hilfe des Programms WINPAC eingestellt und dann mit anderen PA-CONTROL-Parametern an die PA-CONTROL übertragen und im Antrieb gespeichert. Sie können aber nicht mit WINPAC und der PA-CONTROL aus dem Antrieb ausgelesen werden.

Beachten Sie zusätzlich unbedingt die IEF-Applikationsschrift „APP5003_DE_1069022_PAC_dunMOT.pdf“

NOTE For the axis type dunMOT the drive parameters are edited in „drive-Assistant“.

5.11 Parameter Calculation

5.11.1 Gear Factor

The program input can be effected in mm, inches, degrees, etc. by means of this parameter. The following formula is used to determine this parameter:

Example 1 (without gear):

$$\text{Gear factor (GF)} = \frac{\text{Steps per revolution}}{\text{Feed per motor revolution}}$$

Set resolution per revolution, 800
Spindle pitch, 5mm
Entry in mm

$$GF = \frac{800}{5\text{mm}} = 160 \text{ steps/mm}$$

Example 2 (with gear):

$$\text{Gear factor (GF)} = \frac{\text{Steps per revolution x gear ratio}}{\text{Feed per motor revolution}}$$

Set resolution per revolution, 800
Feed per motor revolution 100mm
Entry in mm
Gear ratio 5:1

$$GF = \frac{800 \times 5}{100\text{ mm}} = \underline{40 \text{ steps/mm}}$$

Example 3 (without gear):

$$\text{Gear factor (GF)} = \frac{\text{Steps per revolution}}{\text{Feed per motor revolution}}$$

In PA-CONTROL MP, non-adjustable resolution per revolution, 3200
Spindle pitch, 5mm
Entry in mm

$$GF = \frac{3200}{5\text{mm}} = 640 \text{ steps/mm}$$

5.11.2 Traversing Speed

The following formula is used to determine this parameter:

Max. traversing speed = Revolutions per second x feed per motor revolution

Motor with 3000 revolutions/min = 50 revolutions/sec.

Feed per motor revolution 5mm

Max. traversing speed = 50 rev/s x 5 mm = 250 mm/s

6 Options

6.1 Options of the PA-CONTROL MP

The range of function of the PA-CONTROL MP can be extended by a large number of options. These expansions are implemented by means of plug-in IEF modules.

	Description of the option	MP
IEF Modules	CANOpen	X
	COM 1 / 2 port	*X*
	COM 3 / 4 port	X
	Profibus-DP	X
	A-D converter	X
	SSI	X

6.2 Plug-in connections of the PA-CONTROL MP

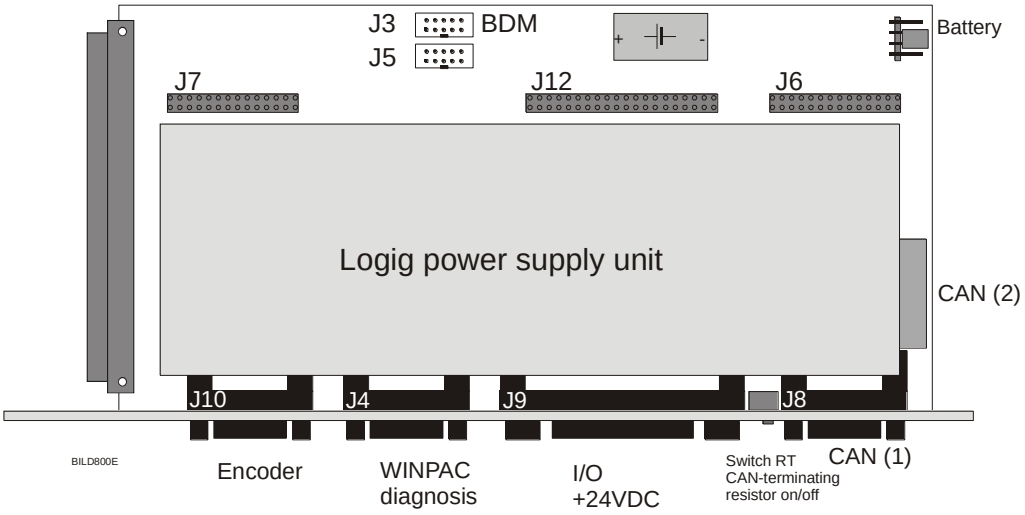

Fig. 56: Layout of the plug-in connections

NOTE Not all options can be combined at the same time, as the free installation space available varies depending on the basic equipment of the device.

Slot J6	All IEF modules except Profibus
Slot J7	All IEF modules
Slot J5	RS 232 port driver for operating terminal

NOTE You will find information about the IEF-modules from section *6.6: IEF Module RS 232 Port, page 148*.

6.3 Rotary switches of the PA-CONTROL MP

The addresses or the transmission properties can be set for the following optional expansions of PA-CONTROL:

- RS 232 port
- Profibus DP
- CANopen slave

This function is implemented by means of the rotary switches on the front plate.

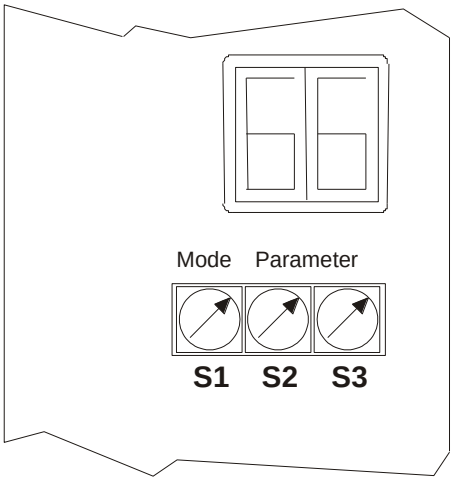

Fig. 57: Rotary switches of PA-CONTROL MP

The information set by means of S2 and S3 is assigned to a specific IEF module by means of rotary switch S1.

S1		S2	S3
Mode		**Parameter**	
0	PA-CONTROL operates as a standard device in the AUTOMATIC or ONLINE mode, CANopen Master.....	---	---
1	The parameter is transferred as the address for the Profibus	Profibus-DP Address tens digit	Profibus-DP Address units digit
2	PA-CONTROL enters the CANopen slave mode (only in PA-CONTROL MP) and transfers the parameter as the CANOpen ID	Profibus-DP Address tens digit	Profibus-DP Address units digit
3	PA-CONTROL transfers the parameter for the settings of COM1 (if available). COM 1 port is switched over to "ONLINE CMD".	Data bits Parity	Baud rate

Please refer to the document "Manual for IEF ports" in the same chapter for additional information.

6.4 CANopen Interface

PA-CONTROL has been provided with a CANopen interface. This interface is used for the optional expansion of PA-CONTROL.

Technical Data:

- Baud rate: 500kBits/s, can be altered
- Max. bus cable length: 66m

To ensure operator-friendliness and an uncomplicated initial start-up (Plug&Play), some specifications have been made for the connection of instruments to the CANopen bus and their addresses (ID numbers).

6.4.1 CANopen Devices with a permanent Assignment

PA-CONTROL assumes the role of master as it were for the devices with a permanent assignment in the CANopen. It detects the devices on the CANopen bus after reinitialization, transfers them to the hardware configuration of PA-CONTROL and monitors the devices in the various modes.

The devices with a permanent assignment are controlled by the operating system of PA-CONTROL and made available to the user as an axis, input or output.

6.4.2 CANopen Devices without a permanent Assignment

Any CANopen device which meets the technical requirements (address, baud rate, ...) can be connected as a device without a permanent assignment.

These devices are not addressed and not supported by the operating system. Commands (G700 group) are available in the AUTOMATIC mode for communication with such devices. The devices can be

- initialized (NMT)
- parameterized (SDO)
- monitored (EMCY)
- written to (PDO) and
- read (PDO)

by the programs in AUTOMATIC mode by means of these commands.

The WINPAC program provides various windows for support in diagnosis and commissioning.

6.4.3 Overview of the CAN IDs

CAN ID	Function in PA-CONTROL	Possible component
1	Driving axis 1	- LV-servoTEC - LV-servoTEC S2 - PA-CONTROL-MP - flexmoTEC-E - flexmoTEC-B - intelliMOT - dunMOT - EPOS
2	Driving axis 2	
3	Driving axis 3	
4	Driving axis 4	
5	Driving axis 5	
6	Driving axis 6	
7	Driving axis 7	
8	Driving axis 8	
9	Driving axis 9	
10	Driving axis 10	
11	Driving axis 11	
12	Driving axis 12	
13	Driving axis 13	
14	Driving axis 14	
15	Driving axis 15	
16	Driving axis 16	
17	Digital inputs/outputs (I/O1025 - I/O1088) Analog inputs/outputs (AD1 - AD4 / DA1 - DA4)	BECKHOFF : - "BK5120", “BK5150”, - “IL2301-B510“, - ”IP1001-B518” MURR Elektronik : - "MBM55900" FESTO : - "CPV", - “CPX - FB14”
18	Digital inputs/outputs (I/O1089 - I/O1152) Analog inputs/outputs (AD5 - AD8 / DA5 - DA8)	
19	Digital inputs/outputs (I/O1153 - I/O1216) Analog inputs(AD9 – AD12)	
20	Digital inputs/outputs (I/O1217 - I/O1280) Analog inputs(AD13 – AD16)	
21	Digital inputs/outputs (I/O1281 - I/O1344) Analog inputs(AD17 – AD20)	
22	Digital inputs/outputs (I/O1345 - I/O1408) Analog inputs(AD21 – AD24)	
23	Digital inputs/outputs (I/O1409 - I/O1472) Analog inputs(AD25 – AD28)	
24	Digital inputs/outputs (I/O1473 - I/O1536) Analog inputs(AD29 – AD32)	
49	Access via G700 commands in AUTOMATIC	- any CANopen device
50	Access via G700 commands in AUTOMATIC	
51	Access via G700 commands in AUTOMATIC	
52	Access via G700 commands in AUTOMATIC	
60	BUS access to PA-CONTROL	- IEF-Touch-Screen console
61	BUS access to PA-CONTROL	
62	BUS access to PA-CONTROL System parameters available for "polling range"	
63	BUS access to PA-CONTROL System parameters available for "polling range" Time monitoring for access	

6.5 RS 232 Port Driver

The RS 232 port driver only executes the signal level adjustment from 5V to the RS232 level of the COM port.

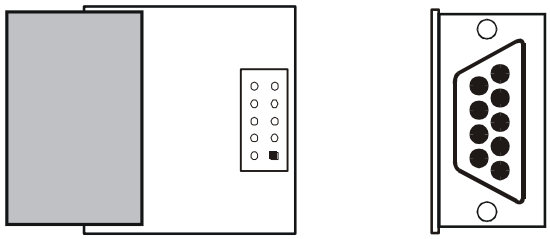

Figure 58: RS 232 Port Driver

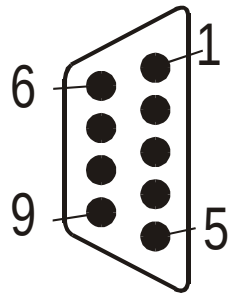

1 N.C.
2 RXD, Receive Data
3 TXD, Transmit Data
4 N.C.
5 GND
6 N.C.
7 RTS, switch on transmitter
8 CTS, ready for transmission
9 N.C.

Figure 59: Assignment of the RS 232 port (Sub-D, 9 poles; pins)

Use:

Use on:	Application for:	Connection to:
CPU4	COM2	J3
IEF module RS232 port	COM2 / COM4	J2
PA-CONTROL servoTEC	Control console connection	X6
PA-CONTROL-MP	Control console connection	X5

6.6 IEF Module RS 232 Port

A COM1 and 2 or COM3 and 4 port can be implemented by means of the IEF module RS 232 port. This module occupies an IEF module slot.

A COM2 or COM4 port comes into being by means of the RS232 port driver, which is connected to the RS232 port module via connector J2.

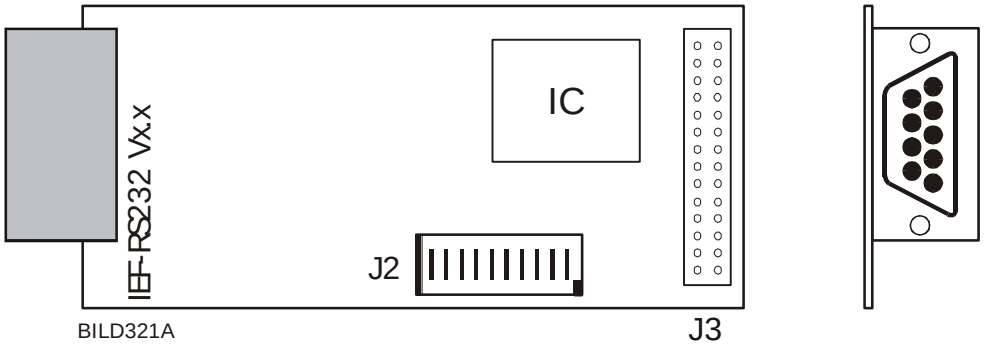

Figure 60: RS 232 Port Module

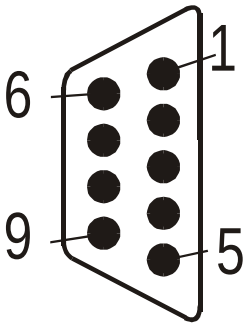

1 N.C.
2 RXD, Receive Data
3 TXD, Transmit Data
4 N.C.
5 GND
6 N.C.
7 RTS, switch on transmitter
8 CTS, ready for transmission
9 N.C.

Figure 61: Assignment of the RS 232 Port (Sub-D, 9 poles; pins)

6.7 IEF Module Profibus DP

PA-CONTROL can be integrated as a slave in a Profibus network by means of the Profibus option. Please refer to the "Profibus documentation" and the interface manual for further information.

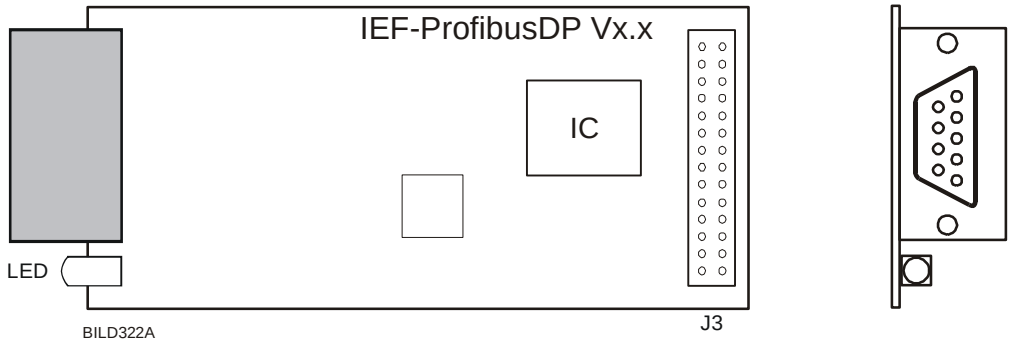

Figure 62: IEF Module Profibus DP

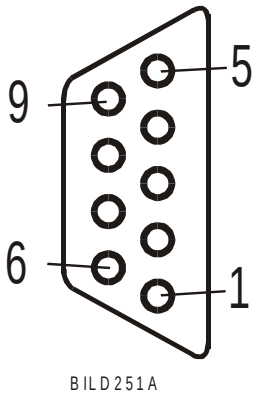

1 N.C.
2 N.C.
3 B
4 RTS *
5 GNDO *
6 +5V *
7 N.C.
8 A
9 N.C.

Figure 63: Connector Assignment (Sub-D, 9 poles, socket)

* These signals are required when the signal must be amplified for a bus extension.

NOTE EN50170 and the general installation guidelines for Profibus DP must be complied with when the Profibus option is installed.

6.8 IEF Module A-D Converter

This module is available in executions with 2 or 8 channels. In principle, the connector assignment is the same for both executions. See also the A-D converter manual.

Technical data:

- 12 bit converter
- 160 µsec/channel
- Input voltage ranges: (0-10) V or +/-10V
- Input resistance: 1MΩ in the 10V range

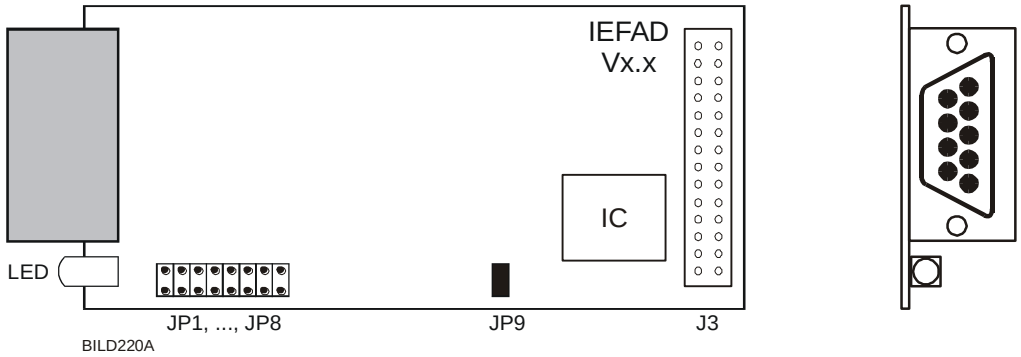

Figure 64: IEF Module A-D Converter

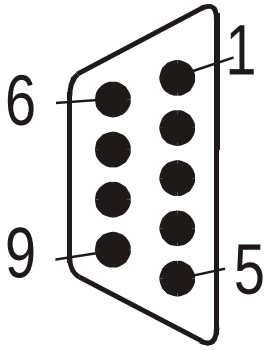

1	Analog input value channel 1
2	Analog input value channel 2
3	Analog input value channel 3
4	Analog input value channel 4
5	Analog input value channel 5
6	Analog input value channel 6
7	Analog input value channel 7
8	Analog input value channel 8
9	GND

Figure 65: Connector Assignment (Sub-D, 9 poles, pins)

NOTE Inputs not connected to signal sources must be connected to GND.

6.9 IEF Control Console

6.9.1 General

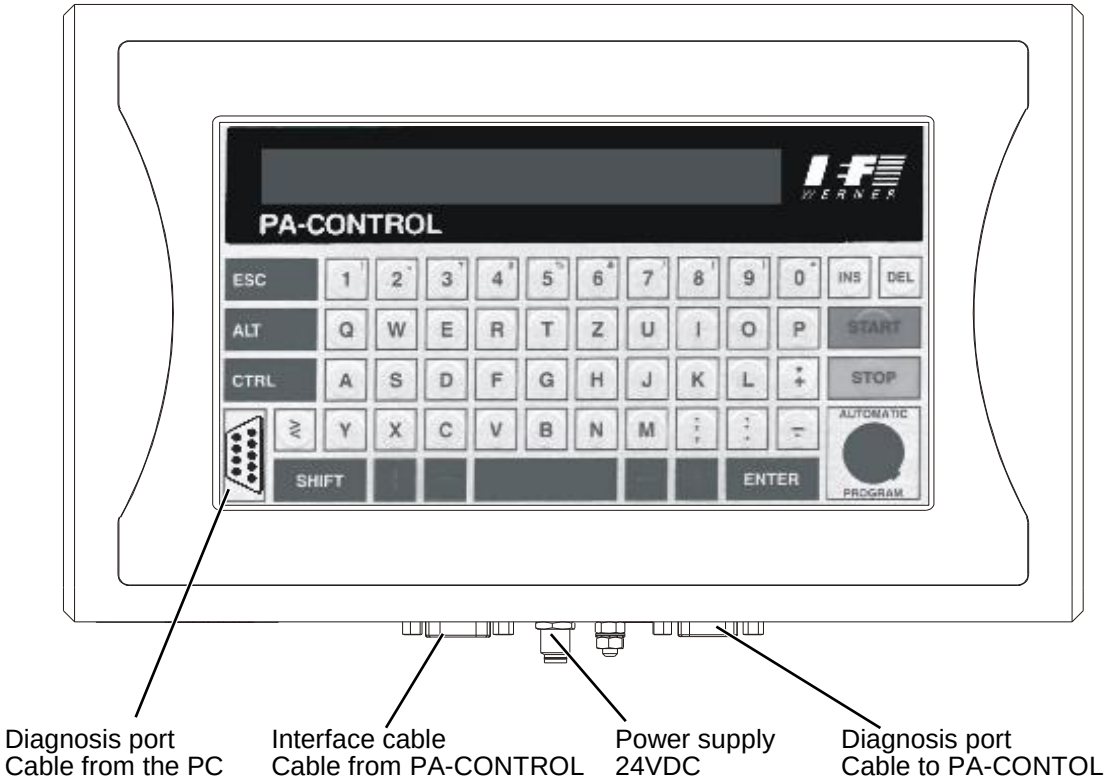

Figure 66: IEF Control Console, view and connections

The IEF control console is one of the numerous options for PA-CONTROL. It is used in the versions of PA-CONTROL which do not have their own keyboard.

In addition to the connection for the internal power supply (circular plug connection series 718 M8x1 / M8), the IEF control console has another three possibilities for connection via a 9 pole Sub-D plug connection:

- Diagnosis port, input / cable connection to the PC
  (9 pole connector on the front)
- Diagnosis port, output / cable connection to PA-CONTROL
  (9 pole socket at the bottom or on the back)
- Port for control console (9 pole socket at the bottom or on the back)

The respective connections must be provided on the controllers to enable connection of the IEF control console to the various versions of PA-CONTROL.

PA-CONTROL Single, Compact, Steuer	Additional front plate on EURO bus with Sub-D plug connection required
PA-CONTROL EP / MP	Expansion with RS232 port driver required
PA-CONTROL servoTEC	Expansion with RS232 port driver required

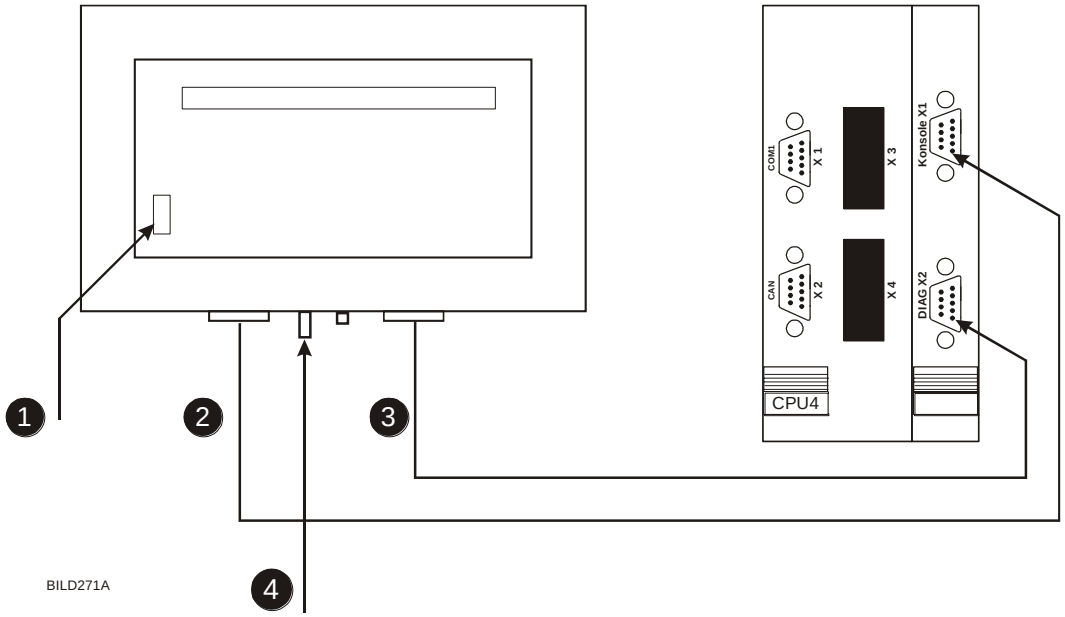

Figure 67: IEF Control console with cable connections

The following are part of the scope of supply of the IEF control console:

Description	IEF no. (standard length, 3m)	IEF no. (special length, max. 20m)
Interface cable (connection of the diagnosis port to the PC)	Not in the scope of supply	Not in the scope of supply ❶
Interface cable (data to and from the console)	231 766	on inquiry ❷
Interface cable (connection of the diagnosis port to PA-CONTROL)	231 585	on inquiry ❸
Power supply cable (5m)	732145	on inquiry ❹

Pin assignment of cables ❶ to ❸

IEF control console	PA-CONTROL
Pin 1 SCLK	Pin 4
Pin 2 MOSI	Pin 3
Pin 3 MISO	Pin 2
Pin 4 /STOP	Pin 1
Pin 5 GND	Pin 5
Pin 6	
Pin 7 BER	Pin 8
Pin 8 SEL	Pin 7

Nicht im deutschen Dokument

Pin assignment of the 24VDC supply (looking at the contact pins of the console)

Pin 1	24VDC
Pin 3	GND
Pin 4	Not assigned

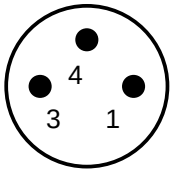

The following colour assignments apply if the IEF power supply cable, order number 732145, is used:

Brown	24VDC
Blue	GND
Black	not assigned

The IEF control console is available in two modifications, for installation in a control panel and in an aluminium housing as a surface-mounting device. In both cases, the cable connections can point vertically downwards or to the rear. This possibility is provided by a rotatable cover.

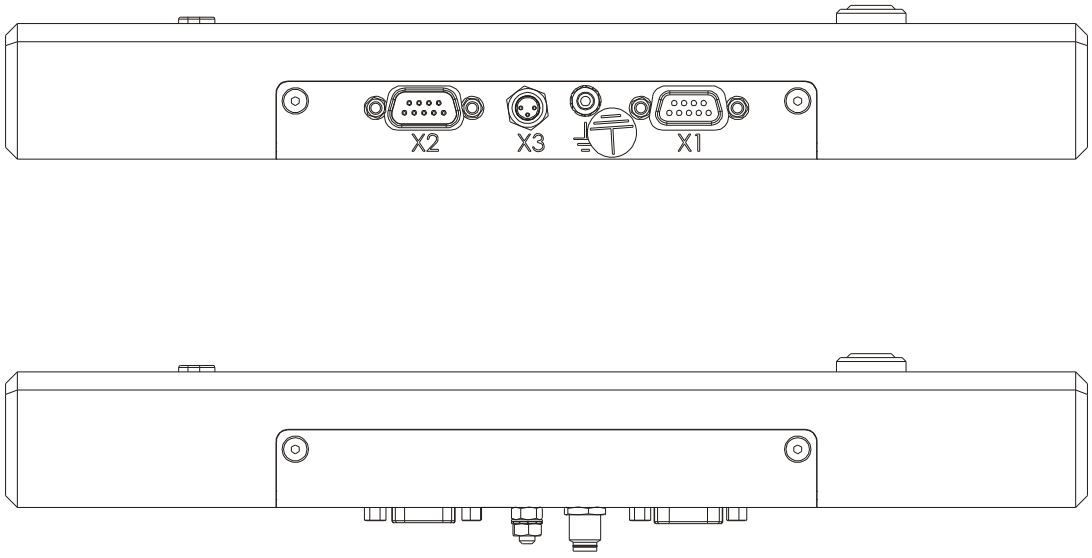

BILD272A

Figure 68: IEF Control console, connections

6.9.2 IEF Control Console - Version for Panel Mounting

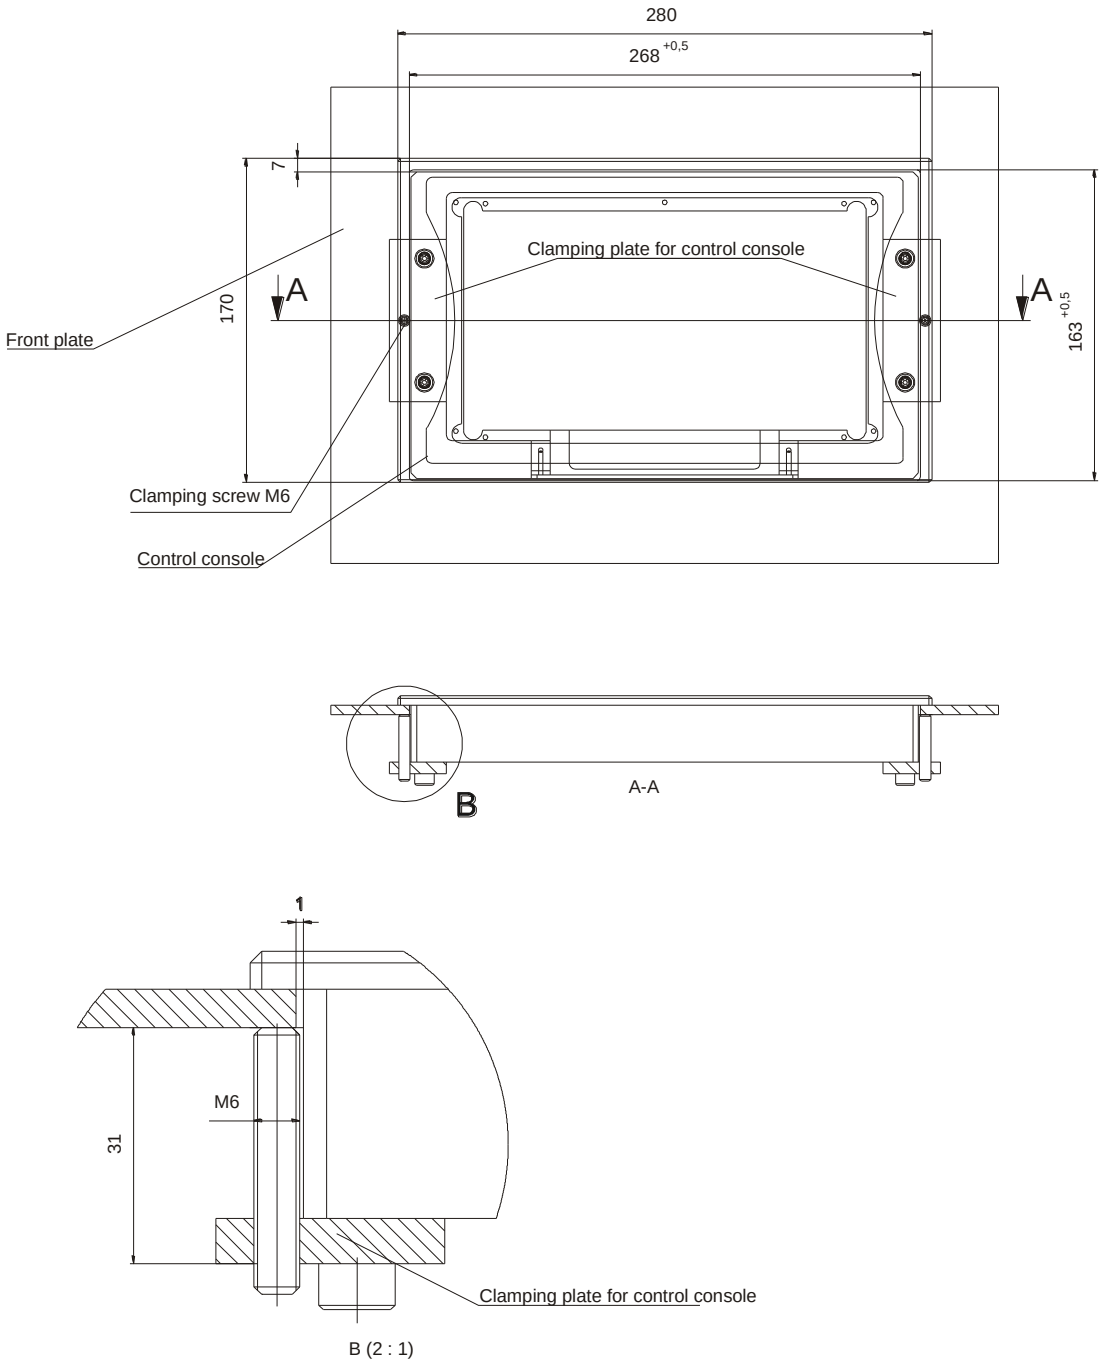

Figure 69: IEF Control console – Mounting Specification

6.9.3 IEF Control Console - Standard Version

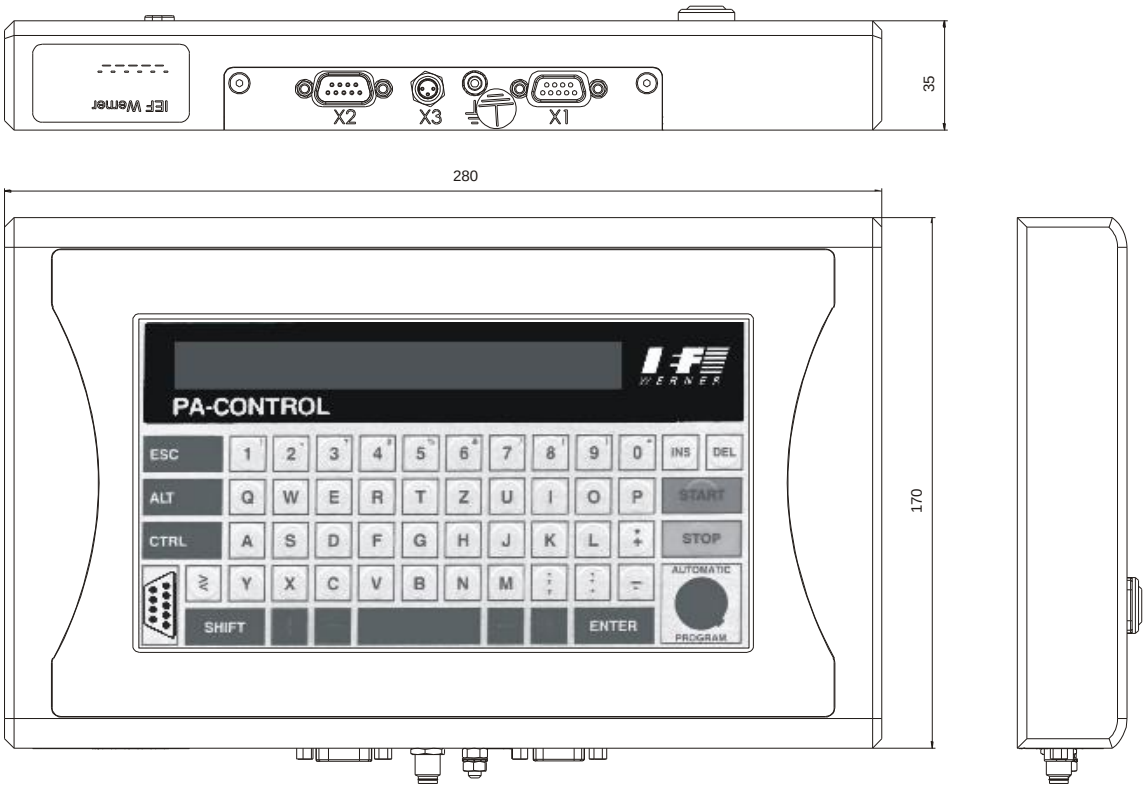

Figure 70: IEF Control console, Mounting Dimensions

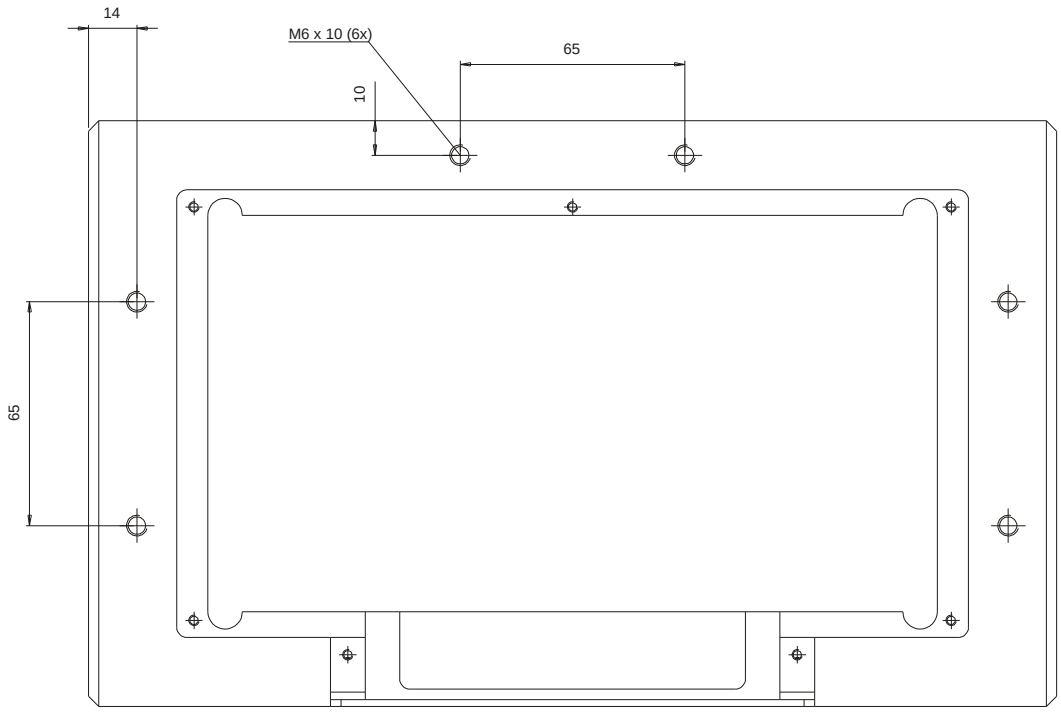

Figure 71: IEF Control console, Hole Pattern for Standard Version

6.10 IEF-Touch-Screen Console via CANopen Bus

An interface for the connection of up to 4 control consoles is provided on the CAN bus of PA-CONTROL for the connection of the control consoles IEF-Touch-Screen to PA-CONTROL.

All variants of the control consoles of IEF-Touch-Screen equipped with a CAN bus interface (e.g. BT8, HT06, TP22, ...) can be connected to PA-CONTROL.

The user interface is generated on the control consoles by means of the "TSwin" software (V4.20 or more recent).

Figure 72: IEF-Touch-Screen Console

6.10.1 CAN Addresses and Monitoring

Up to four control consoles can be connected to PA-CONTROL at the same time.

Number of control console	CANopen address	Number of the system flag "Control console active"	Time monitoring of access by PA-CONTROL
1	63	27	Yes
2	62	28	No
3	61	29	No
4	60	30	No

System flags are provided, so that a check can be made in PA-CONTROL in automatic mode as to whether a IEF-Touch-Screen console has been connected and is active. The system flag assigned to a console is set every time it is accessed and reset five seconds after the last access.

The control console with the ID63 is time-monitored by PA-CONTROL (5 seconds). If the control console was active and becomes inactive for any reason (cable breakage, switched off, ...), error "E322 = TIME OUT with the IEF-Touch-Screen console " is set.

6.10.2 TSwin Configuring Software

Templates are provided for the operating consoles of IEF-Touch-Screen console.

A template is provided by IEF-Werner for each of the different control consoles.

6.10.2.1 Directory Structure for Storage of the IEF Templates

The user should create a directory "IEF" under "...\Programm\Tswin...\Templates" and copy the IEF templates to this. The IEF templates are stored on the IEF CD and can be copied from there.

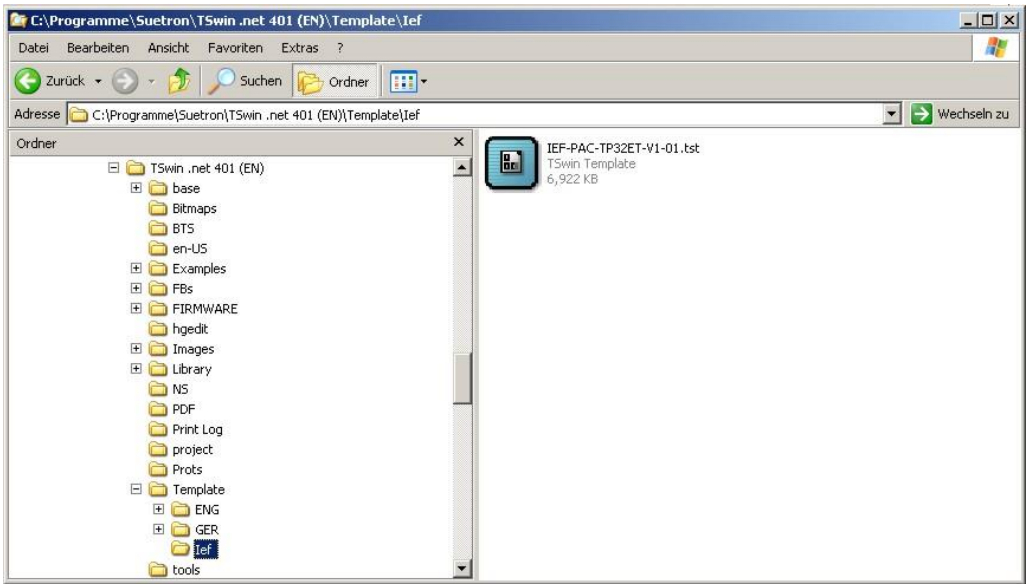

Figure 73: Directory Structure

6.10.2.2 New Project with IEF Template

The IEF templates are offered for selection when a new project is created.

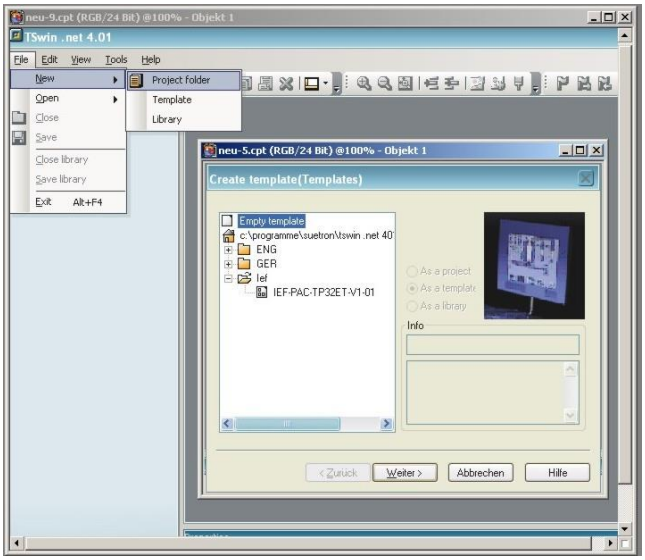

Figure 74: Template Selection

6.10.2.3 CAN Bus Settings with the TSwin Configuring Software

The settings for the CANopen communication have already made been in all IEF templates. Only the CAN address, "Terminal module number" or the baud rate need to be customized as required.

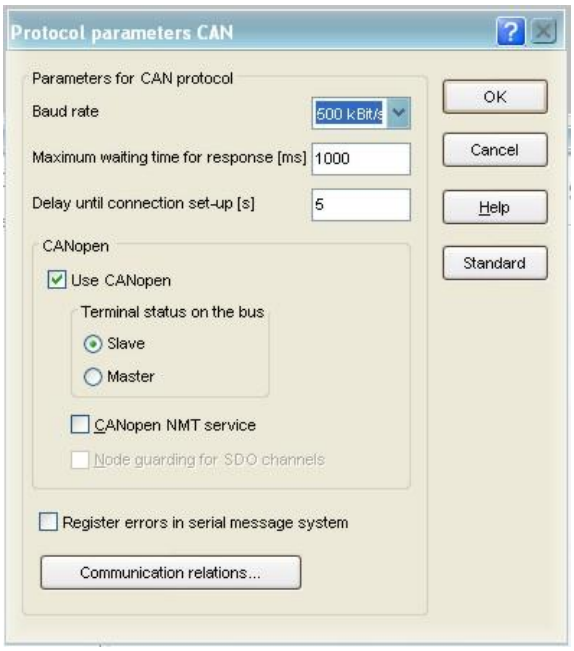

Figure 75: Protocol Parameters

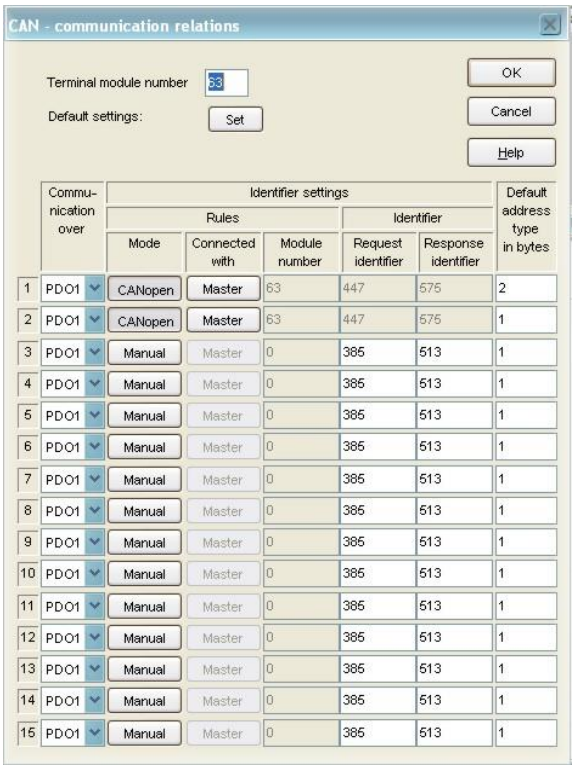

Figure 76: Communication Relationships

Communication between the control console and PA-CONTROL only takes place via PDO1 (no SDO communication, no node guard, no ...).

The strings and display lines are accessed "in byte mode" in communication 2. Further access takes place in word mode in communication 1.

6.10.3 List of Variables in the Control Console

Only a fraction of the possible variables for the inputs, outputs, flags, N registers and R registers are entered in the IEF templates. All other variables are complete in accordance with the version.

CAN-PA-CONTROL

	Variable name	Address:	Com. relations:	Low bit no.	High bit no.
0	PA-CONTROL				
1	Betriebsart	DW 8192:1	1		
2	Automatik-STAF	DW 8192:2	1		
3	Automatik-STOF	DW 8192:3	1		
4	Automatik-ABBF	DW 8192:4	1		
5	Pollbereich	W 8208:0	1		
6	Fehlertext-Syste	BY 8224:0	2		
7	Fehlertext-Ablau	BY 8225:0	2		
8	N-Register				
9	N0001	DW 12289:0	1		
10	N0002	DW 12289:1	1		
11	N0003	DW 12289:2	1		
12	N0004	DW 12289:3	1		
13	N0005	DW 12289:4	1		
14	N0006	DW 12289:5	1		
15	N0007	DW 12289:6	1		
16	N0008	DW 12289:7	1		
17	N0009	DW 12289:8	1		
18	N0010-Summe a	DW 12289:9	1		
19	N0011-Gutteil-Za	DW 12289:10	1		

Figure 77: List of Variables

The lists of all variables for PA-CONTROL are available as EXCEL files. The supplements to the variables can be copied from this file as required.TSwin-ControlVariable-Outputs-PA-CONTROL-V1-00.xls

- TSwin-ControlVariable-Inputs-PA-CONTROL-V1-00.xls
- TSwin-ControlVariable-FlagWords-PA-CONTROL-V1-00.xls
- TSwin-ControlVariable-FlagWords-PA-CONTROL-V1-00.xls
- TSwin-ControlVariable-NRegister-PA-CONTROL-V1-00.xls
- TSwin-ControlVariable-RRegister-PA-CONTROL-V1-00.xls

Figure 78: Reference for Variables

6.10.3.1 Object List through Access of the Data of PA-CONTROL

Object List Part 1

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
2000	8192	0	Number of SUB index 2000	Signed 32	RO
		1	Operating status of PA-CONTROL	Signed 32	RO
		2	Automatic START	Signed 32	Wo
		3	Automatic STOP	Signed 32	Wo
		4	Automatic ABORT	Signed 32	Wo
2010	8208		Polling range:		
		0	Coordination byte	Unsigned 16	RW
		1	Serial signalling channel	Unsigned 16	RW
		2	LEDs of function keys 1-8	Unsigned 16	RW
		3	LEDs of function keys 9-16	Unsigned 16	RW
		4	LEDs of function keys 17-24	Unsigned 16	RW
		5	LEDs of function keys 25-32	Unsigned 16	RW
		6	LEDs of function keys 33-40	Unsigned 16	RW
		7	LEDs of function keys 41-48	Unsigned 16	RW
2011	8209	0	Date-Time-String	Unsigned 8	RW
2020	8224	0- (3C)	System error text	Unsigned 8	RO
2021	8225	0 - (3C)	Run error text	Unsigned 8	RO
2100	8448	0	Number of input words	Unsigned 16	Ro
2100	8448	1	Diagnosis Inputs : number of Input	Unsigned 32	RW
2100	8448	2	Diagnosis inputs : state of input	Unsigned 16	RO
2101	8449	0-7F	Input word 1- 128 (I1 - I2048)	Unsigned 16	RO
2200	8704	0	Number of output words	Unsigned 16	RO
2200	8704	1	Diagnosis ouputs : number of the output	Unsigned 32	RW
2200	8704	2	Diagnosis outputs : value of the ouptut	Unsigned 16	RW
2201	8705	0-7F	Output word 1-128 (O1 - O2048)	Unsigned 16	RW

Object List Part 2

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
2800	10240	0	Number of flag words	Unsigned 16	RO
2800	10240	1	Diagnosis flags : number of the flag	Unsigned 32	RW
2800	10240	2	Diagnosis flags : value of the flag	Unsigned 16	RW
2801	10241	0-FF	Flag word flag 1-256 (M1 - M4096)	Unsigned 16	RW
2810	10256	0 – FF	Flag word 1-256 (M1 - M4096)	Unsigned 16	RW
2811	10257	0 - FF	Flagword 256-512 (M4097 – M8192)	Unsigned 16	RW
3000	12288	0	Number of N registers	Unsigned 16	RO
3000	12288	1	Diagnosis N-Register : Number	Unsigned 32	RW
3000	12288	2	Diagnosis N-Register : Value	Signed 32	RW
3001	12289	0-FF	N1 - N256	Signed 32	RW
3002	12290	0-FF	N257 - N512	Signed 32	RW
3002	12291	0-FF	N513 - N768	Signed 32	RW
3003	12291	0-FF	N513 - N768	Signed 32	RW
3004	12292	0-FF	N769 – N1024	Signed 32	RW
3005	12293	0-FF	N1025 – N1280	Signed 32	RW
3006	12294	0-FF	N1281 – N1536	Signed 32	RW
3007	12295	0-FF	N1537 – N1793	Signed 32	RW
3008	12296	0-FF	N1793 – N2948	Signed 32	RW
3009	12297	0-FF	N2049 - N2304	Signed 32	RW
300A	12298	0-FF	N2305 - N2560	Signed 32	RW
300B	12299	0-FF	N2561 – N2816	Signed 32	RW
300C	12300	0-FF	N2817 – N3072	Signed 32	RW
300D	12301	0-FF	N3073 – N3328	Signed 32	RW
300E	12302	0-FF	N3329 – N3584	Signed 32	RW
300F	12303	0-FF	N3585 – N3840	Signed 32	RW
3010	12304	0-FF	N3841 – N4096	Signed 32	RW
3011	12305	0-FF	N4097 – N4352	Signed 32	RW
3012	12306	0-FF	N4353 – N4608	Signed 32	RW
3013	12307	0-FF	N4609 – N4864	Signed 32	RW
3014	12308	0-FF	N4865 - N 5120	Signed 32	RW
3015	12309	0-FF	N5121 – N5376	Signed 32	RW
3016	12310	0-FF	N5377 – N5632	Signed 32	RW

Object List Part 3

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
3017	12311	0-FF	N5633 – N5888	Signed 32	RW
3018	12312	0-FF	N5889 – N6144	Signed 32	RW
3019	12313	0-FF	N6145 – N6400	Signed 32	RW
301A	12314	0-FF	N6401 – N6656	Signed 32	RW
301B	12315	0-FF	N6657 – N6912	Signed 32	RW
301C	12316	0-FF	N6913 – N7168	Signed 32	RW
301D	12317	0-FF	N7169 – N7424	Signed 32	RW
301E	12318	0-FF	N7425 – N7680	Signed 32	RW
301F	12319	0-FF	N7681 - N 7936	Signed 32	RW
3020	12320	0-FF	N7937 - N 8192	Signed 32	RW
3081	12417	0-FF	N1-N256 (word access)	Signed 16	RW
3082	12418	0-FF	N257 – N512 (word access)	Signed 16	RW
3083	12419	0-FF	N513 - N768 (word access)	Signed 16	RW
3084	12420	0-FF	N769 – N1024 (word access)	Signed 16	RW
3085	12421	0-FF	N1025 – N1280 (word access)	Signed 16	RW
3086	12422	0-FF	N1281 – N1536 (word access)	Signed 16	RW
3087	12423	0-FF	N1537 – N1793 (word access)	Signed 16	RW
3088	12424	0-FF	N1793 – N2948 (Word access)	Signed 16	RW
3089	12425	0-FF	N2049 - N2304 (Word access)	Signed 16	RW
308A	12426	0-FF	N2305 - N2560 (Word access)	Signed 16	RW
308B	12427	0-FF	N2561 – N2816 (Word access)	Signed 16	RW
308C	12428	0-FF	N2817 – N3072 (Word access)	Signed 16	RW
308D	12429	0-FF	N3073 – N3328 (Word access)	Signed 16	RW
308E	12430	0-FF	N3329 – N3584 (Word access)	Signed 16	RW
308F	12431	0-FF	N3585 – N3840 (Word access)	Signed 16	RW
3090	12432	0-FF	N3841 – N4096 (Word access)	Signed 16	RW
3091	12433	0-FF	N4097 – N4352 (Word access)	Signed 16	RW
3092	12434	0-FF	N4353 – N4608 (Word access)	Signed 16	RW
3093	12435	0-FF	N4609 – N4864 (Word access)	Signed 16	RW
3094	12436	0-FF	N4865 - N 5120 (Word access)	Signed 16	RW
3095	12437	0-FF	N5121 – N5376 (Word access)	Signed 16	RW
3096	12438	0-FF	N5377 – N5632 (Word access)	Signed 16	RW
3097	12439	0-FF	N5633 – N5888 (Word access)	Signed 16	RW
3098	12440	0-FF	N5889 – N6144 (Word access)	Signed 16	RW

Object List Part 4

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
3099	12441	0-FF	N6145 – N6400 (Word access)	Signed 16	RW
309A	12442	0-FF	N6401 – N6656 (Word access)	Signed 16	RW
309B	12443	0-FF	N6657 – N6912 (Word access)	Signed 16	RW
309C	12444	0-FF	N6913 – N7168 (Word access)	Signed 16	RW
309D	12445	0-FF	N7169 – N7424 (Word access)	Signed 16	RW
309E	12446	0-FF	N7425 – N7680 (Word access)	Signed 16	RW
309F	12447	0-FF	N7681 - N 7936 (Word access)	Signed 16	RW
30A0	12448	0-FF	N7937 - N 8192 (Word access)	Signed 16	RW
3100	12544	0	Number of R registers	Unsigned 16	Ro
3100	12544	1	Diagnosis R-Register : number	Unsigned 32	RW
3100	12544	2	Diagnosis R-Register : value	Float 32	RW
3101	12545	0-FF	R1 - R256	Float 32	RW
3102	12546	0-FF	R257 - R512	Float 32	RW
3103	12547	0-FF	R513 - R768	Float 32	RW
3104	12548	0-FF	R769 – R1024	Float 32	RW
3105	12549	0-FF	R1025 – R1280	Float 32	RW
3106	12550	0-FF	R1281 – R1536	Float 32	RW
3107	12551	0-FF	R1537 – R1793	Float 32	RW
3108	12552	0-FF	R1793 – R2948	Float 32	RW
3109	12553	0-FF	R2049 – R2304	Float 32	RW
310A	12554	0-FF	R2305 – R2560	Float 32	RW
310B	12555	0-FF	R2561 – R2816	Float 32	RW
310C	12556	0-FF	R2817 – R3072	Float 32	RW
310D	12557	0-FF	R 3073 – R3328	Float 32	RW
310E	12558	0-FF	R3329 – R3584	Float 32	RW
310F	12559	0-FF	R 3585 – R3840	Float 32	RW
3110	12560	0-FF	R 3841 – R4096	Float 32	RW
3111	12561	0-FF	R 4097 – R4352	Float 32	RW
3112	12562	0-FF	R 4353 – R4608	Float 32	RW
3113	12563	0-FF	R 4609 – R4864	Float 32	RW
3114	12564	0-FF	R 4865 – R5120	Float 32	RW
3115	12565	0-FF	R 5121 – R5376	Float 32	RW
3116	12566	0-FF	R 5377 – R5632	Float 32	RW

Object List Part 5

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
3117	12567	0-FF	R 5633 – R5888	Float 32	RW
3118	12568	0-FF	R 5889 – R6144	Float 32	RW
3119	12569	0-FF	R 6145 – R6400	Float 32	RW
311A	12570	0-FF	R 6401 – R6656	Float 32	RW
311B	12571	0-FF	R 6657 – R6912	Float 32	RW
311C	12752	0-FF	R 6913 – R7168	Float 32	RW
311D	12573	0-FF	R 7169 – R7424	Float 32	RW
311E	12574	0-FF	R 7425 – R7680	Float 32	RW
311F	12575	0-FF	R 7681 – R7936	Float 32	RW
3120	12576	0-FF	R 7937 - R8192	Float 32	RW
3200	12800	0 – (3C)	Diagnosis String : value of the string	Unsigned 8	RW
3200	12800	FE	Diagnosis String : number of the string	Signed 32	RW
3200	12800	FF	Number of PA-CONTROL strings	Signed 32	RO
3201	12801	0 - (3C)	S1 (global String 1)	Unsigned 8	RW
3202	12802	0 - (3C)	S2 (global String 2)	Unsigned 8	RW
3203	12803	0 - (3C)	S3 (global String 3)	Unsigned 8	RW
3204	12804	0 - (3C)	S4 (global String 4)	Unsigned 8	RW
3205	12805	0 - (3C)	S5 (global String 5)	Unsigned 8	RW
3206	12806	0 - (3C)	S6 (global String 6)	Unsigned 8	RW
3207	12807	0 - (3C)	S7 (global String 7)	Unsigned 8	RW
3208	12808	0 - (3C)	S8 (global String 8)	Unsigned 8	RW
3209	12809	0 - (3C)	S9 (global String 9)	Unsigned 8	RW
320A	12810	0 - (3C)	S10 (global String 10)	Unsigned 8	RW
320B	12811	0 - (3C)	S11 (global String 11)	Unsigned 8	RW
320C	12812	0 - (3C)	S12 (global String 12)	Unsigned 8	RW
320D	12813	0 - (3C)	S13 (global String 13)	Unsigned 8	RW
320E	12814	0 - (3C)	S14 (global String 14)	Unsigned 8	RW
320F	12815	0 - (3C)	S15 (global String 15)	Unsigned 8	RW
3210	12816	0 - (3C)	S16 (global String 16)	Unsigned 8	RW
3300	13056	0	Number of system flags	Signed 32	RO
3300	13056	1	Diagnosis Systemflag : number of the flag	Unsigned 32	RW
3300	13056	3	Diagnosis Systemflag : state of the flag	Unsigned 8	RO

Object List Part 6

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
3301	13057	0 - ...	SM1 – SM256	Unsigned 8	RO
3302	13058	0 - ...	SM257 - ...	Unsigned 8	RO
3400	13312	0	Number of system N registers	Signed 32	RO
3400	13312	1	Diagnosis System-N-Register : number	Unsigned 32	RW
3400	13312	2	Diagnosis System-N-Register : value	Signed 32	RO
3401	13313	0 - ...	SN1 - ...	Signed 32	RO
3500	13568	0	Number of system R registers	Signed 32	RO
3500	13568	1	Diagnosis System-R-Register : number	Unsigned 32	RW
3500	13568	2	Diagnosis System-R-Register : value	Float 32	RO
3501	13569	0 - ...	SR1 - ...	Float 32	RO
3801	14337	0 - (28)	Display PA-CONTROL front plate line 1	Unsigned 8	RO
3802	14338	0 - (28)	Display PA-CONTROL front plate line 2	Unsigned 8	RO
3803	14339	0	Key control console	Unsigned 8	WO
3804	14340	0	STOP key control console	Unsigned 8	WO
3805	14341	0	Control console is activated	Unsigned 8	RO
3806	14342	0	SHIFT key control console	Unsigned 8	WO
4000	16384	0	Current number of axes	Unsigned 8	RO
4001	16385	0 - F	Current axis position	Float 32	RO
4002	16386	0 - F	axis ready	Unsigned 8	RO
4003	16387	0 - F	Axis status (in position / running / stopped)	Unsigned 8	RO
4004	16388	0 - F	Status of negative limit switches	Unsigned 8	RO
4005	16389	0 - F	Status of positive limit switches	Unsigned 8	RO

6.10.4 Serial Signalling System with Polling Range

The serial signalling system of SÜTRON control consoles consists of the following elements:

- Writing of coordination byte
- Serial signalling channel and
- Status of the LEDs of the function keys

The three elements are combined in the variable "Polling range" for communication via CAN bus.

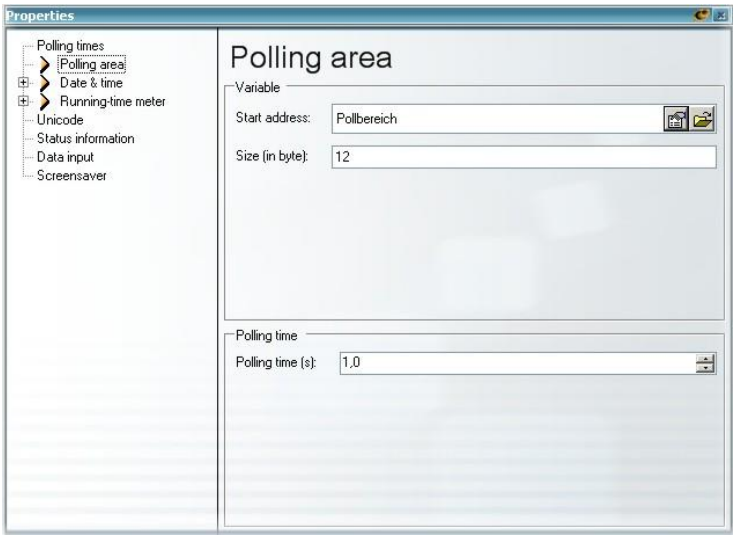

Figure 79: Polling Range

NOTE Only the setting "with 1 variable" can be used in TSwin for the polling range for communication via CAN

.

The polling range is applied to flags and N registers in PA-CONTROL. The N registers and flags used are assigned in the system parameters, so that customisation to the application is possible.

If the system parameters are set to 0, data fields are not used in PA-CONTROL.

System parameters for the polling range for control console 1 (CANopen address 63) and control console 2 (CANopen address 62) are provided in PA-CONTROL.

Default setting (after reinitialization of PA-CONTROL):

Control console	Number of flag word "Write" Coordination byte	Number of N register Serial signalling channel	Number of flag word LEDs of function keys
1 (ID63)	224	2048	218
2 (ID62)	0	0	0

A tab is available in the WinPAC program for setting the parameters for the polling range (*see Figure 80, page 168*)

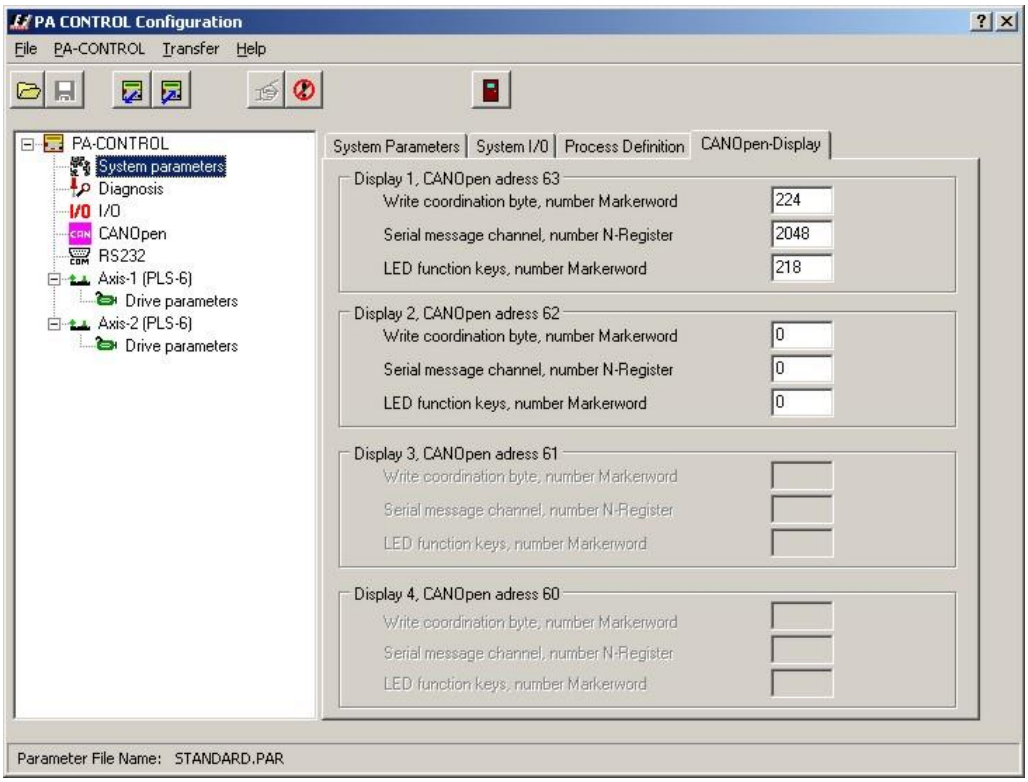

Figure 80: Tab for "Polling Range"

6.10.4.1 Coordination Byte

The coordination byte exists as "Read coordination byte" and "Write coordination byte". Both use a flag word in PA-CONTROL.

Write coordination byte means that PA-CONTROL writes this byte (flag).

Read coordination byte means that PA-CONTROL reads this byte (flag).

6.10.4.2 Write Coordination Byte

"Write coordination byte" is associated with the polling range. The number of the flag word in which the coordination byte "Write" is stored is specified in a system parameter of PA-CONTROL (see above).

Flag word 224 (M3569 - M3584) is used in PA-CONTROL as the default setting for "Write coordination byte". This results in the following assignment:

Write coordination byte (PA-CONTROL writes)	
M3584	Free
M3583	Free
M3582	Free
M3581	Data set download enable (DDF bit)
M3580	Ready flag (LM bit)
M3579	Reset password, delete (PL bit)
M3578	Refresh acknowledgement (RQ bit)
M3577	External data enabling (ED bit)

6.10.5 Read Coordination Byte

The "Read coordination byte" is set with its own variable in the TSwin program. A flag word should be used as a variable.

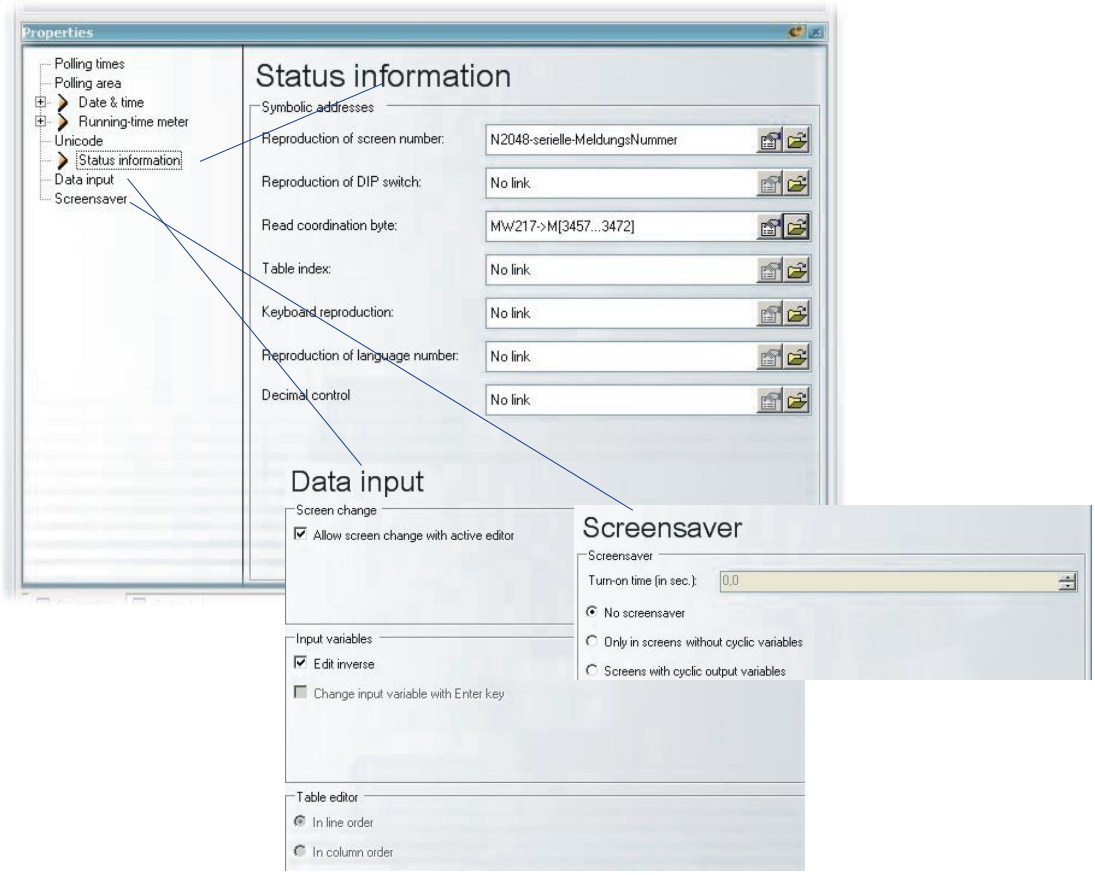

Figure 81: Setting the Read Coordination Byte

The flag word 217 (M3457 ... M3472) is used in the above example. This results in the following assignment:

Read coordination byte (PA-CONTROL reads)	
M3464	Free
M3463	Free
M3462	Free
M3461	Data set download aktiv
M3460	Ready flag (LM bit)
M3459	Refresh request bit (RA bit)
M3458	Editing status bit (EZ bit)
M3457	Editing request bit (EA bit)

6.10.5.1 Serial Signalling Channel

The serial signalling channel is stored in an N register. N register N2048 is used as the default setting in PA-CONTROL.

PA-CONTROL stores a 16 bit message number in this N register. The operator panel cyclically retrieves the entire polling range from PA-CONTROL and transmits the serial message at the same time.

As soon as a message (message number > 0) is detected, it is stored in the internal message store of the operator panel, and the N register in PA-CONTROL is reset to zero as an "acknowledgment".

External masks and message masks are addressed in the same way. As soon as the transferred number corresponds to a mask number, it is shown on the display. If the number has a mask and a message text, the mask (message mask, full-page error text) is shown on the display and the associated message text entered in the message store.

6.10.5.2 LEDs of Function Keys

Number of the flag word starting from which the status of the LEDs of the function keys is stored.

The LEDs of the function keys use a varying number of flag words depending on the setting in the control console.

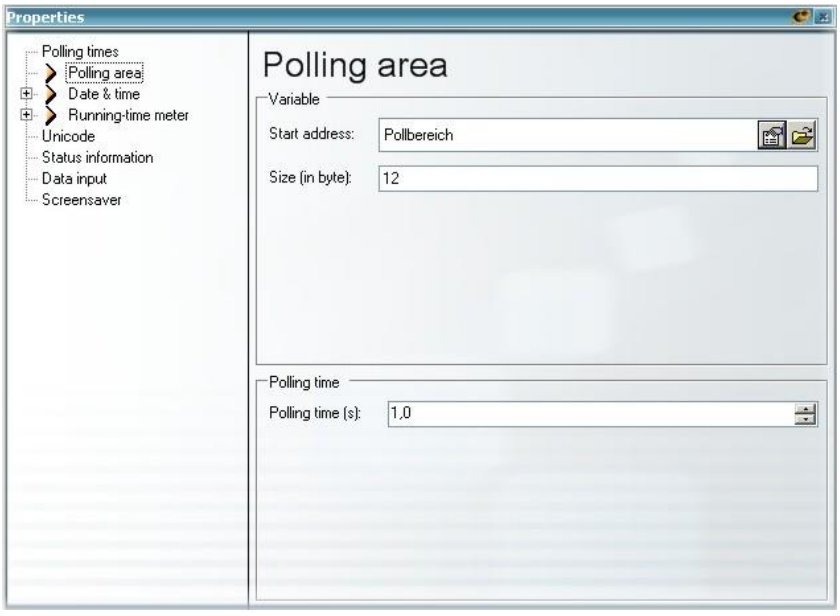

Figure 82: Setting the Polling Range

Note on size :

12 bytes → 6 Words : 1 Flag word for coordination byte
1 N register for signalling channel
4 Flag words for LEDs of function keys

10 Bytes → 5 Words 1 Flag word for coordination byte
1 N register for signalling channel
3 Flag words for LEDs of function keys

The flag word 218 (M3488 - M3568) is used as the default setting in PA-CONTROL.

Assignment of the LEDs of the function keys to the flags of PA-CONTROL in the default								
MW218	M 3473 LED 1 on / off	M 3474 LED 1 flashing	M 3475 LED 2 on / off	M 3476 LED 2 flashing	M 3477 LED 3 on / off	M 3478 LED 3 flashing	M 3479 LED 4 on / off	M 3480 LED 4 flashing
	M 3481 LED 5 on / off	M 3482 LED 5 flashing	M 3483 LED 6 on / off	M 3484 LED 6 flashing	M 3485 LED 7 on / off	M 3486 LED 7 flashing	M 3487 LED 8 on / off	M 3488 LED 8 flashing
MW219								
MW220								
MW221								
MW222								
MW223	M 3553 LED 45 on / off							M 3568 LED 48 flashing

6.10.6 Parallel Signaling System

The parallel signaling system is applied in the flag area (flag words) of PA-CONTROL.

The user must ensure that the settings are possible in PA-CONTROL and that the ranges for status and acknowledgement do not overlap.

256 parallel messages are implemented in the following example:

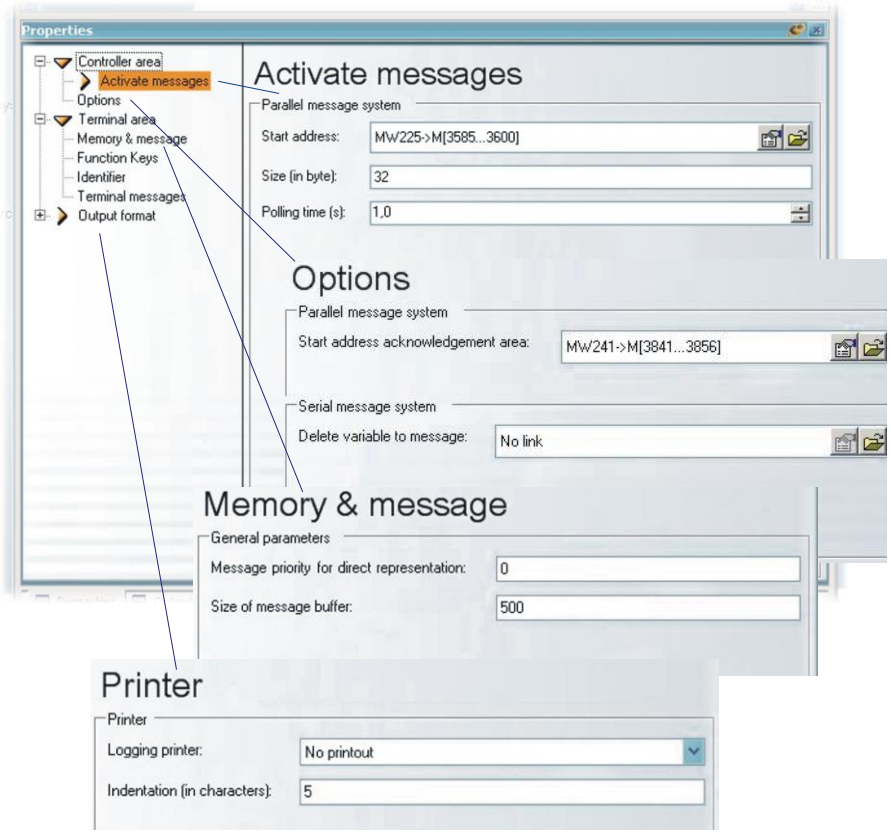

Figure 83: Setting the parallel Signalling System

This results in the following assignment:

Status of the parallel signalling system	
M3585	Message 1
M3586	Message 2
...	
M3601	Message 17
...	...
M3839	Message 255
M3840	Message 256

Acknowledgement of the parallel signalling system	
M3841	Acknowledgement message 1
M3842	Acknowledgement message 2
M3857	Acknowledgement message 17
...	...
M4095	Acknowledgement message 255
M4096	Acknowledgement message 256

6.10.6.1 Date and Time

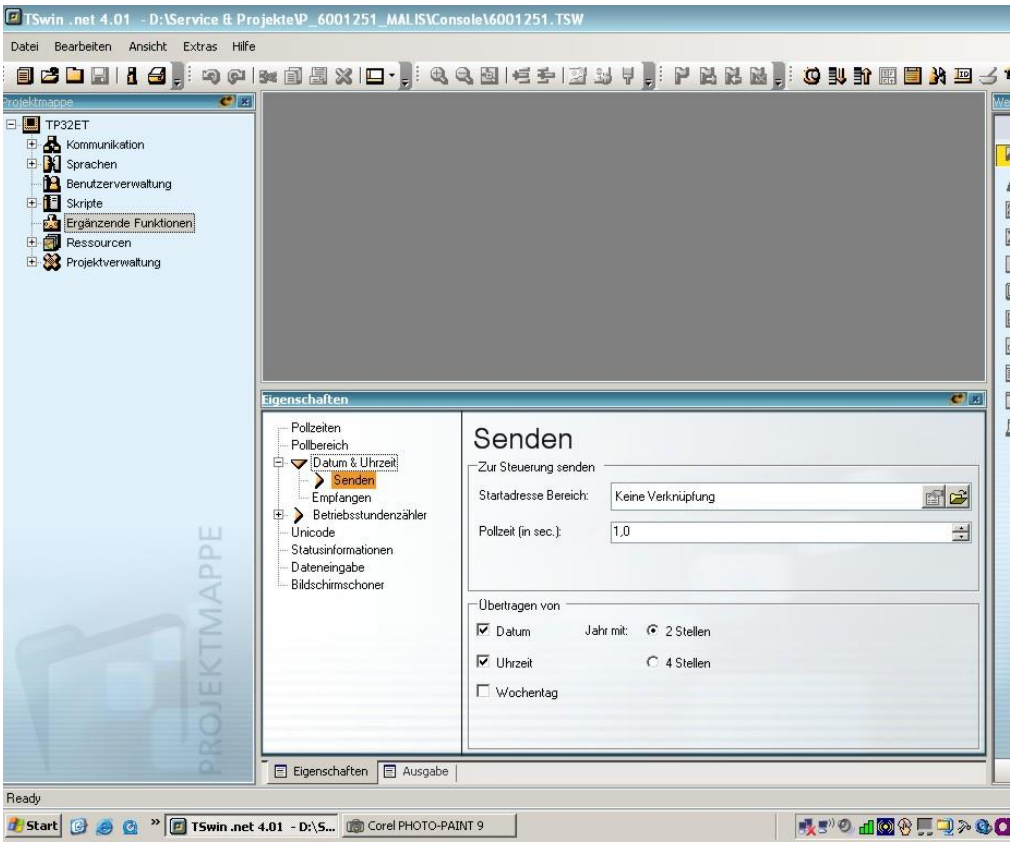

Abbildung 84: Supplementary Function „Date & Time“

6.10.7 Simulation of the PA-CONTROL Front Plate

Special access options were created, in order to display the front plate of PA-CONTROL, and therefore all the operating possibilities provided by the front plate of PA-CONTROL, on the user interface of the control console.

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
3801	14337	0 - (28)	Display PA-CONTROL front plate line 1	Unsigned 8	RO
3802	14338	0 - (28)	Display PA-CONTROL front plate line 2	Unsigned 8	RO
3803	14339	0	Key control console	Unsigned 8	WO
3804	14340	0	STOP key control console	Unsigned 8	WO
3805	14341	0	Control console is activated	Unsigned 8	RO
3806	14342	0	SHIFT key control console	Unsigned 8	WO

Any existing PA-CONTROL front plate is disabled by accessing (reading) the display lines (Index 3801/3802).

PA-CONTROL front plates are implemented ready for use in the IEF templates:

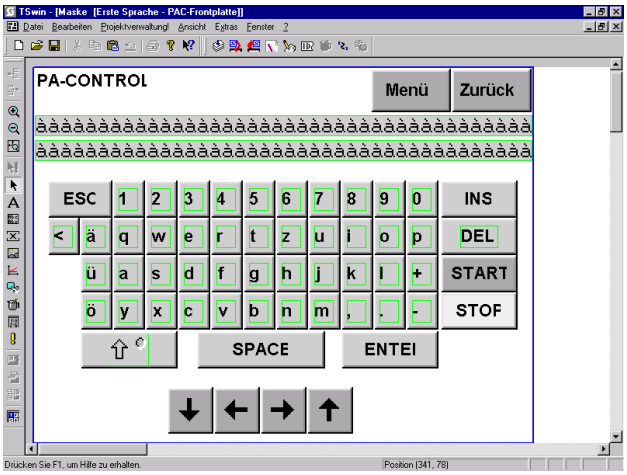

Figure 85: Template for "IEF Front Plate"

NOTE The font for the display line must be set to "COURIER 10", so that the special characters (ä,ü, ...) are displayed correctly.

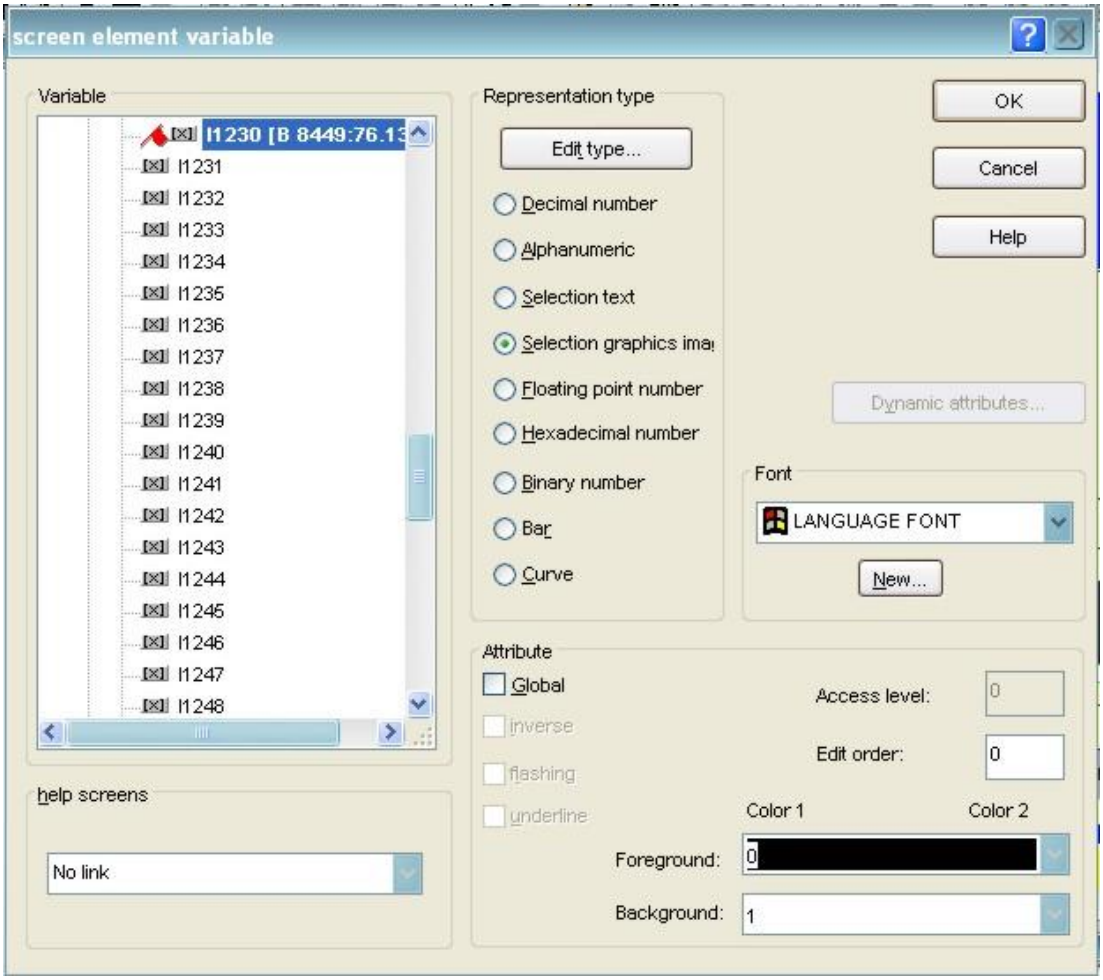

Figure 86: Setting the Font

6.10.7.1 Key code for cursor keys

Index (hex)	Index (dec)	Sub-index (hex)	Name	Type	Access
3804	14340	0	STOP key control console	Unsigned 8	WO

Since the control console can only generate one code between 0 and 255 for keys, the cursor keys were assigned with the following values. The standard ASCII characters are transferred with their standard code.

Key designation	Code (dec)
CURUP	**1**
CURDOWN	**2**
CURRIGHT	**3**
CURLEFT	**4**
BACKSPACE	**8**
POS1	**9**
POSEND	**10**
PGUP	**11**
PGDOWN	**12**
ENTER	**13**
INS	**14**
DEL	**15**
ESC	**27**
ASCII character set **for example :** **0** **1** **2**	**????** **48** **49** **50**
STARTKEY	**222**

7 Technical Annex

7.1 Messages of PA-CONTROL

Operating status display

PA-CONTROL continuously monitors the function of its components and the program execution. Status and operating conditions as well as error and fault signals are generated as a result of this monitoring.

This information can be requested in all devices by means of the program development system WINPAC (see Chapter 4, Start-up and Documentation of WINPAC).

The error and fault signals are displayed in plain language on the operator terminal of devices which are equipped with this.

A status or error code is also output via the double-digit 7-segment display of the PA-CONTROL MP.

The messages are displayed as numbers. In this connection, the two digit positions of the code are statically displayed in the status and operating status display.

In the case of error and fault signals, the individual digits of the respective code are displayed alternately in groups of two digit positions together with the letter E (error).

Example of an operating status display:

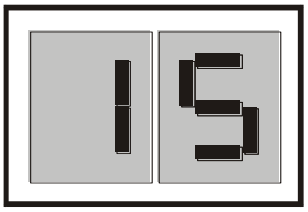

BILD143A

Figure: 87: Display for "Automatic stopped"

Example of a system error message:

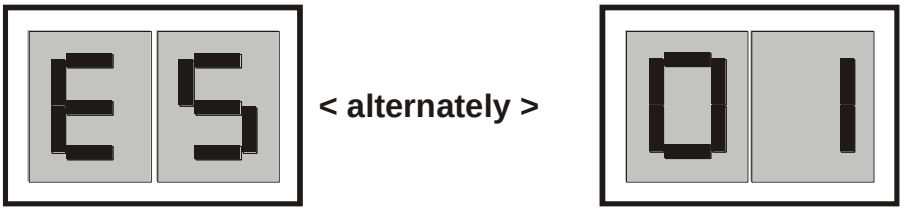

BILD144E

Figure 88: Display for "External STOP" not defined

7.1.1 Status and operational Status Messages

No.		Operational status	Further information - Troubleshooting
Dec	Hex		
00	00	no communication	Controller in an undefined status
01	01	Initial position	After switch-on
02	02	Manual operation	Front plate
03	03	Manual operation	Traversing of the axes
10	0A	Automatic started	START command initiated
11	0B	Automatic running	The program defined as the "START program" is processed
12	0C	Automatic and "STOP" detected	Front plate, external STOP or bus STOP
13	0D	Automatic and process "STOP" program	Waits for an event in the “STOP-program”
15	0F	Automatic and stopped	Front plate, external STOP or bus
16	10	Automatic and process program "START" after "STOP"	Waits for an event in the “START-after-STOP program”
17	11	Automatic and malfunction detected	
18	12	Automatic and process "Malfunction program"	Waits for an event in the malfunction program
19	13	Automatic with malfunction and stopped	The program defined as the "START program" has been stopped, no further program will be processed.
20	14	Manual traversing via serial port	Motor or axis is manually traversed via WINPAC
31	1F	Online	
35	23	Online stopped	
39	27	Online stopped with malfunction	
PA-CONTROL MP CANopen slave mode			
50	32	CANopen slave mode started	
51	33	CANopen slave mode, running	
52	34	CANopen slave mode, STOP detected	
53	35	Antrieb ist eingeschaltet = drive is switched on	
54	36	Antrieb läuft = drive runs	
55	37	CANopen slave mode, stopped	
56	38	PA-CONTROL MP is working in measuring mode	
57	39	CANopen slave mode, malfunction detected	
59	3B	CANopen slave mode, malfunction detected and stopped	

7.1.2 Error and Fault Signals

7.1.2.1 CPU error messages:

Code	CPU error messages	Further information - Troubleshooting
002	Bus error	CPU faulty
003	Address error	see above
004	Unimplemented command	see above
005	Division by zero	see above
006	Command chk	see above
007	Command Trapv	see above
008	Privilege violation	see above
009	Trace	see above
010	Emulator 1	see above
011	Emulator 2	see above
012	reserved	see above
013	Uninitialized interrupt	see above
014	Incorrect interrupt	see above
015	Uninitialized auto-vector1	see above
016	Uninitialized auto-vector2	see above
017	Uninitialized auto-vector3	see above
018	Uninitialized auto-vector4	see above
019	Uninitialized auto-vector5	see above
020	Uninitialized auto-vector6	"Boot" PA-CONTROL on switch-on
021	Uninitialized auto-vector7	"Boot" PA-CONTROL on switch-on
022	Uninitialized nonauto interrupt	"Boot" PA-CONTROL on switch-on
023	Uninitialized trap vector	"Boot" PA-CONTROL on switch-on
024	Uninitialized co-processor vector	"Boot" PA-CONTROL on switch-on
099	Incompatible operating system	The version of the boot system and the loaded operating system do not match. Eliminate the error by loading another version of the operating system

7.1.2.2 System error Hardware Part 1:

Code	Error message	Further information - Troubleshooting
E100	Keyboard port time-out	Keyboard removed, keyboard switched off
E101	Keyboard not ready	see above
E102	Short circuit in stepping motor output stage	Motor cable defective, motor defective
E103	Motor voltage incorrect / absent	230VAC not connected to the system? Bridge inserted in the motor connector? Motor power supply defective?
E104	Auxiliary voltages incorrect	Power supply defective
E105	Temperature in heat sink too high	Ventilation defective, ventilation clogged
E106	Motor rotation monitoring actuated	Motor run against mechanical stop, motor acceleration too high, rotary encoder wiring
E107	Phase sequence monitoring – no motor	Check motor wiring
E108	Axis type not defined	Non-existent axis addressed
E109	Axis type incorrectly defined	Hardware configuration changed
E110	Hardware configuration M-module slot	Module was exchanged, "boot" PA-CONTROL
E111	Hardware configuration IEF slot 1	Module was exchanged, "boot" PA-CONTROL
E112	Hardware configuration IEF slot 2	Module was exchanged, "boot" PA-CONTROL
E113	PLS7 interface different version	PLS7 is more recent than the operating system, match versions
E114	Axis power circuit not ready	LV-UNIT rotation monitoring error, wiring defective, LV-servoTEC supply voltage
E115	Axis module PLS7 does not exist	Hardware not connected
E116	PLS7 reports system error no.xxx	See table on page for further information
E117	PLS7 TIMEOUT	PLS7 card defective, exchange card
E118	Hardware configuration ASi Master 1	ASi master card defective or not connected
E119	Hardware configuration ASi Master 2	ASi master card defective or not connected
E120	Hardware configuration ASi Master 3	ASi master card defective or not connected
E121	Hardware configuration ASi Master 4	ASi master card defective or not connected
E122	Axis module PLS6 does not exist	Check card

System error Hardware Part 2:

Code	Error message	Further information - Troubleshooting
E123	Axis module PLS8 does not exist	Check card
E124	PLS6 / PLS8 TIMEOUT on loading PIC	Hardware error in the PLS card, exchange card
E125	More than 16 axes detected	Check axis configuration
E126	Another axis type detected	Check hardware configuration, "boot" PA-CONTROL if necessary
E127	New axis type detected	Check hardware configuration, "boot" PA-CONTROL if necessary
E128	Different axis types detected	Different cards which are not permissible together are present in system. (PLS6 combined with PLS7 or servo-axis with axis number of a PLS7 card)
E129	PLS6 / PLS8 PIC not ready	Hardware error in the PLS card, exchange card.
E130	PLS6- / PLS8 PIC error checksum	Hardware error in the PLS card, exchange card
E131	EURO TP1 IEF module 1 not possible	Module not permissible on this slot
E132	EURO TP1 IEF module 2 not possible	Module not permissible on this slot
E133	EURO TP2 IEF module 1 not possible	Module not permissible on this slot
E134	EURO TP2 IEF module 2 not possible	Module not permissible on this slot
E135	EURO TP3 IEF module 1 not possible	Module not permissible on this slot
E136	EURO TP3 IEF module 2 not possible	Module not permissible on this slot
E137	EURO TP4 IEF module 1 not possible	Module not permissible on this slot
E138	EURO TP4 IEF module 2 not possible	Module not permissible on this slot
E139	EURO TP1 IEF module 1 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E140	EURO TP1 IEF module 2 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E141	EURO TP2 IEF module 1 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E142	EURO TP2 IEF module 2 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E143	EURO TP3 IEF module 1 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E144	EURO –TP3-IEF-Modul 2 Änderung	Hardwarekonfiguration überprüfen, ggf. PA-CONTROL „urladen“ Check Hardwarekonfiguration , boot-strap PA-CONTROL if necessary
E145	EURO – TP4-IEF-Modul 1 Änderung	Check Hardwarekonfiguration , boot-strap PA-CONTROL if necessary

System error Hardware Part 3:

Code	Error message	Further information - Troubleshooting
E144	EURO TP3 IEF module 2 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E145	EURO TP4 IEF module 1 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E146	EURO TP4 IEF module 2 change	Check hardware configuration, "boot" PA-CONTROL if necessary
E147	Permissible internal temperature of the device exceeded	See technical data
E148	Too many absolute positioning systems detected	More IEF SSI modules are connected than the number of axes
E149	Warning: discharge degree of the battery	Check battery and exchange if necessary

7.1.2.3 System error RAM contents group:

Code	Hardware error message	Further information - Troubleshooting
E150	System parameters outside range	"Boot" system parameters, "boot" PA-CONTROL if necessary
E151	Axis parameters outside range	"Boot" axis parameters, "boot" PA-CONTROL if necessary
E152	Horizontal checksum error in the ASCII program	Delete program, "boot" PA-CONTROL if necessary
E153	Horizontal checksum error in the Code program	Delete program, "boot" PA-CONTROL if necessary
E154	Warning: discharge degree of the battery of the RAM-Module (only CPU4)	Check battery and exchange if necessary

7.1.2.4 Field bus error messages:

Code	BUS error message	Further information - Troubleshooting
E200	Profibus-DP error IO length	Incorrect configuration (GSD file?)
E201	Profibus-DP init error	Incorrect configuration (GSD file?)
E202	Profibus-DP unknown error	Incorrect configuration (GSD file?)
E203	RS232-CMD init error	RS 232 setting incorrect
E204	RS232-CMD hardware interrupt	Check transmission path (cable & connector)
E205	Rotary switch outside range	Incorrect setting of the rotary switch
E206	Malfunction on reading the rotary switch	Hardware error (CPU, rotary switch)

7.1.2.5 AS-i system error and CMD error messages:

Code	Hardware error message	Further information - Troubleshooting
E250	ASi : Error on execution of host job	ASi master could not execute the command
E251	ASi : No error on execution of host job	ASi master could execute the command
E252	ASi : Slave does not exist	Device with the address xx does not exist
E253	ASi : Slave address 0 exists	The address 0 is not permissible in automatic or online mode
E254	ASi : Slave address already in use	Selection of another address for programming
E255	ASi : The ASi slave cannot be programmed to address 0	Check error on execution of host job
E256	ASi : The address could not be assigned to the ASi slave	Check address
E257	ASi : Address could not be stored in the EEPROM of the ASi slave	Problem with the programming of the address, repeat operation
E258	ASi : Unknown error	Repeat
E259	ASi : Timeout for transfer of command	Check ASI master card
E260	ASi : No supply voltage	Check ASi power supply
E261	ASi: Slave 0 is here	Invalid address for automatic and online mode
E262	ASi: Configuration error	Slaves on the bus do not coincide with the stored configuration

7.1.2.6 CANopen bus, Communication errors / Warnings Part 1:

Code	Hardware error message	Further information - Troubleshooting
E300	Bus offline	Too many bad CANopen frames, implement EMC-compatible system design
E301	Timeout for SDO communication with CANopen module (axis, IO module)	Axis switched off, CAN connector removed
E302	Error during SDO communication with CANopen module (axis, IO module)	Axis switched off, CAN connector removed
E303	Unknown warning at the axis	Device sets warning flag, but does not describe the error.
E304	Unknown error at the axis	Device sets warning flag, but does not describe the error.
E305	Axis does not answer the SYNC frame	Axis switched off, CAN connector removed
E306	Timeout at stop of an axis	Optmize parameter "VEL0"
E307	Axis not ready	Axis switched off, motor supply voltage unavailable
E308	Version of LV servoTEC operating system incorrect	The version of the operating system of LV-servoTEC is not up-to-date
E309	Different parameters in PA-CONTROL and LV-servoTEC	Match parameters
E310	Communication error with CANopen module (axis, IO module)	Axis switched off, CAN connector removed
E311	IO module does not answer NODE GUARD frame	IO module switched off, break in the cabling
E312	Index of the object does not exist	Incorrect command/parameter
E313	SUB-index of the object does not exist	Incorrect command/parameter
E314	Parameter value too high	Check parameter value in the file of the servoTEC parameters
E315	Parameter value too low	Check parameter value in the file of the servoTEC parameters
E316	Service parameters inconsistent	Error in the operating system
E317	Object may only be read	Error in the operating system
E318	Counter TX error too high	Bus malfunction (terminating resistor, cable length)
E319	Counter RX error too high	Bus malfunction (terminating resistor, cable length)
E320	"SYNC message" cannot be sent	- Bus malfunctions, - Error in the operating system
E321	Not all CAN axes or CAN IO modules have been initialized	- CAN device connected ? - Not switched on ? - at error ?

CANopen bus, Communication errors / Warnings Part 2:

Code	Hardware error message	Further information - Troubleshooting
E322	Timeout for the communication with the control console	- Control console connected ? - Not switched on ? - at error ?
E323	Emergency message received from IO module	- Power supply switched off - Error in IO module - Short circuit of an output Please note error code of the module, e.g. - 30xx-xx : Voltage, ... - 4xxx-xx : Temperature, ... - 81xx-xx : Communication, ... - 90xx-xx : External error, ...
E324	CAN axis at "EMERGENCY STOP" on traversing	EMERGENCY STOP input of the axis actuated
E325	CAN axis not ON	
E326	Error CAN LinMOT-Axis	
E327	Error CAN intellimot Axis	
E328	Error Can ecostep axis	
E329	Error PLS-EP axis	
E330	CAN Error, parameter out of range	
E331	CAN Error : no Entry on this Access	
E332	Error CAN dunMOT Axis	
E333	Error CAN dunMOT axis during homing	
E334	CAN error Object Index does not exist	
E335	CAN error Object Sub-Index does not exist	
E336	CAN Error drive-parameter out or range	
E337	CAN Error drive-parameter value to high	
E338	CAN Error drive parameter value to low	
E339	CAN Error drive-parameter service-parameter inconsistent	
E340	CAN Error drive-parameter read only	
E341	CAN Error no entry access	
E342	CAN-Modbus error of module	
E343	CAN –Time out at START Operational Mode	
E344	CAN Error at Access IEF-Touch-Screen	
E345	CAN-Error servoTEC s2 axis	
E346	CAN-Error servoTEC S2 parameter to high	
E347	CAN-Error servoTEC S2 parameter to low	

Code	Hardware error message	Further information - Troubleshooting
E348	CAN Error EPOS axis	
E349	CAN Error flexmoTEC–B axis	

7.1.2.7 CANopen bus error axis (servoTEC) Part 1:

Die in Klammer gesetzten Fehlercodes F01 bis F32 entsprechen den Fehlermeldungen des LV-servoTEC. Siehe dazu Bedienungsanleitung LV-servoTEC see *section 6.4 CANopen Interface*, *page 145*.

Code	Hardware error message	Further information - Troubleshooting
E400	Unknown error, not detailed	
E401	Error reset, error no longer present	
E402	Generic error	
E403	Not ready	e.g. initialization not yet completed, ready (BTB) signal is not available on switch-on
E404	Fault to ground (F22)	Only with 40/70 ampere devices
E405	No supply system, not ready (F16)	Controller enabling was present, although no supply voltage was present, check mains supply.
E406	Overvoltage DC link (F02)	Ballast performance limit was reached, use external ballast resistor with higher performance and alter ballast performance parameters. Supply voltage too high, use mains transformer.
E407	Undervoltage DC link (F05)	Supply voltage not available or too low for enabled servo amplifier, enable servo amplifier with at least 500ms delay.
E408	Loss of a phase of the supply system (F19)	Can be switched off for operation on two phases.
E409	Internal temperature exceeded (F13)	Upgrade ventilation
E410	Temperature of heat sink exceeded (F01)	Limit value permanently set at 80°C by the manufacturer. Upgrade ventilation
E411	Motor temperature exceeded (F06)	Thermostatic switch of motor has actuated, allow motor cool to down and check why motor is overheating Connector of the feedback unit loose or feedback line interrupted, secure connector or replace feedback line.

Code	Hardware error message	Further information - Troubleshooting
E412	Error in auxiliary supply (F07)	The auxiliary voltage internally generated in the LV-servoTEC is defective, send LV-servoTEC to the manufacturer for repair.

CANopen bus error axis (servoTEC) Part 2:

Code	Hardware error message	Further information - Troubleshooting
E413	Error A-D converter (F17)	Error in the A-D conversion, usually an EMC disturbance, reduce EMV disturbances and check screen and grounding Possibly also hardware defect of the regulator
E414	Output stage error (F14)	Motor supply cable has a short circuit, exchange cable Motor has a ground fault or short circuit, exchange motor Output stage module has overheated; upgrade ventilation Defect of the output stage module Send servo amplifier to the manufacturer for repair. Ground fault or short circuit in the circuit of the external ballast resistor, eliminate ground fault or short circuit.
E415	Error ballast resistor (F18)	Ballast circuit defective or setting incorrect
E416	Error in application of the AS option (F27)	Activation of the AS option and the ENABLE signal are present at the same time
E417	Checksum serial EEPROM (F09)	Might be remedied by re-storage of the parameters (SAVE)
E418	Flash EEPROM (F10)	Checksum error
E419	Watchdog caused software reset (F32)	System software does not react correctly
E420	BCC error (Table)	**1)**
E421	BCC error, (system macro)	E420-E426: lead to F32,
E422	BCC error, (EEPROM serial)	Breakdown of the various
E423	FPGA error	causes only through output via the
E424	Error (Table)	serial port
E425	User software BCC	
E426	Defective user software BCC (F32)	System software does not react correctly
E427	Parameter error	Incorrect parameter value via PDO

1) Defective drive firmware, might be fixed by download of firmware.

The error codes F01 to F32 in brackets correspond to error messages of LV-servoTEC. See the LV-servoTEC operating instructions, *section 6.4 CANopen Interface, page 145*.

CANopen bus error axis (servoTEC) Part 3:

Code	Hardware error message	Further information - Troubleshooting
E428	Error brake (F11)	Cable break, short circuit or ground fault of the brake line
E429	Commutation error (F25)	Motor commutation not correct, check motor cable, check parameters MPHASE, VCOMM
E430	LV-servoTEC could not be enabled	HW Enable unavailable, or error status of the servo
E431	Command only allowed if LV-servoTEC not enabled	
E432	Defective feeback unit (F04)	Cable break, short circuit or ground fault
E433	Handling error (F21)	Software error of the expansion card
E434	Response monitoring	Node-guarding error, can be reset via control word
E435	CANopen bus not ready	Faulty CAN bus communication?
E436	State machine is not operation-enabled	Control word used incorrectly
E437	Incorrect mode	Preselect correct mode
E438	Torque setting incorrect (F15)	Preset RMS current value exceeded, e.g. as a result of a stiff mechanical system, check mechanical system
E439	Overspeed (F08)	Set overspeed reached motor has possibly run away
E440	Tracking error (F03)	Message of the position controller
E441	Invalid traverse job number started	Selected traversing set was not defined
E442	Error external trajectory (F28)	Setpoint step change too large Only in SERCOS systems
E443	Fatal exception error (F32)	System software does not react correctly
E444	Error in a PDO component	Incorrect value
E445	Incorrect operating mode	Only for Rx-PDO 22
E446	Slot error (F20)	Error of the expansion card Only in servos with slot cards
E447	Warning display as error (F24)	Warning display is evaluated as an error (user-defined)
E448	Error in approach to reference point (F26)	Hardware limit switch reached
E449	Sercos error (F29)	Only in SERCOS systems
E450	Sercos	Only in SERCOS systems

The error codes F01 to F32 in brackets correspond to error messages of LV-servoTEC. See the LV-servoTEC operating instructions, *section 6.4 CANopen Interface, page 145*.

CANopen bus error axis (servoTEC) Part 4:

Code	Hardware error message	Further information - Troubleshooting
E460	I^2T message threshold crossed	If necessary, reduce motor current, acceleration or traversing speed
E461	Ballast performance reached	
E462	Tracking error	Change drive parameter "tracking error" or, if necessary, reduce motor current, acceleration or traversing speed
E463	Response monitoring active	
E464	No mains phase	Check mains wiring or deactivate mains monitoring (PMODE)
E465	Software limit switch 1 has actuated	
E466	Software limit switch 2 has actuated	
E467	Bad traversing job started	Error in the operating system
E468	No reference point	Reference axis (G25…)
E469	Positive limit switch active	
E470	Negative limit switch active	
E471	Motor default values have been loaded	Setting of the motor parameters not yet complete
E472	Expansion card is not functioning correctly	
E473	Motor phase	
E474	Incorrect VCT entry	
E475	Warning n17 – n31	Display warning using the WINPAC-program Diagnosis -> servoTEC -> error statistics
E481	Positive limit switch actuated	
E482	Short circuit	Motor cable defective, motor defective
E483	Voltage for stepping motor output stage incorrect	230VAC not connected to the supply? Bridge inserted in the motor connector? Motor power supply defective?
E484	Auxiliary voltages incorrect	Power supply defective
E485	Temperature in the heat sink too high	Ventilation defective, ventilation clogged
E486	Motor rotation monitoring was actuated	Motor run against mechanical stop, motor acceleration too high, rotary encoder wiring
E487	Phase sequence monitoring! – no motor	Check motor wiring
E501	External stop input not defined	Parameter

7.1.2.8 Error messages in automatic mode Part 1:

Code	Run error message	Further information - Troubleshooting
E502	External stop input cold	Stop input not connected ?
E503	STOP program unavailable	Run definition
E504	START-AFTER-STOP prog. unavailable	Run definition
E505	MALFUNCTION program unavailable	Run definition
E506	STOP program illegal command	Only use permissible commands (see chapter *3 Commands of the PA-CONTROL-Family*)
E507	START after STOP prog. illegal command	Only use permissible commands (see chapter *3 Commands of the PA-CONTROL-Family)*
E508	MALFUNCTION program illegal command	Only use permissible commands (see *chapter 3 Commands of the PA-CONTROL-Family*)
E509	Reserve	
E510	Reserve	
E511	Start program not defined	Run definition
E512	Start program unavailable	Run definition
E513	Program unavailable	Run definition
E514	Unknown command	Syntax error
E515	Nesting depth too large	Too many subroutines
E516	Too many processes started	More than 31 programs opened
E517	Value too low	Value less than e.g. the min. traverse
E518	Value too high	Value greater than e.g. the max. traverse
E519	Flag number too low	Value outside range 1-1024
E520	Flag number too high	Value outside range 1-1024
E521	Register number too low	Value outside range 1-1024
E522	Register number too high	Value outside range 1-1024
E523	Axis still running	Traversing command is still being processed
E524	Axis overrun	Axis outside traversing range
E525	No axis reference point	Reference switch defective?
E526	Data channel not initialized	Port available ?
E527	Display unavailable	IEF control terminal available
E528	Command at the data channel not possible	Port available ?
E529	Positive limit switch actuated	Switch actuated or cable break ?
E530	Negative limit switch actuated	Switch actuated or cable break ?

Error messages in automatic mode Part 2:

Code	Run error message	Further information - Troubleshooting
E531	Limit switch actuated	Switch actuated or cable break ?
E532	Value outside range	Value outside traversing range
E533	System error, cause unknown	Error message of the operating system
E534	Profibus-DP communication switched off	Interruption of Profibus (connector, cable)
E535	AP traversing speed too high	Check setting of the parameters
E536	AP traversing speed too low	Check setting of the parameters
E537	AP reference speed too high	Check setting of the parameters
E538	AP reference speed too low	Check setting of the parameters
E539	AP manual speed too high	Check setting of the parameters
E540	AP manual speed too low	Check setting of the parameters
E541	AP creep speed too high	Check setting of the parameters
E542	AP creep speed too low	Check setting of the parameters
E543	AP Start-Stop speed too high	Check setting of the parameters
E544	AP Start-Stop speed too low	Check setting of the parameters
E545	AP acceleration too high	Check setting of the parameters
E546	AP acceleration too low	Check setting of the parameters
E547	SLEEP program not running	Program is not being executed at present
E548	Assignment of axis type for interpolation	Interpolation not possible with this hardware (only with PLS7, PLS9)
E549	PLS7 negative acknowledgement at card command	Hardware error
E550	PLS7 incorrect card mode	Hardware error
E551	COM port busy	COM1 used as RS232-OnlineCMD
E552	Axes already used by interpolation	Interpolation command uses all four axes of this PLS card during interpolation
E553	IPO – path traversing speed too high	Check parameters
E554	IPO – path traversing speed too low	Check parameters
E555	IPO – path Start-Stop speed too high	Check parameters
E556	IPO – path Start-Stop speed too low	Check parameters
E557	IPO – path acceleration too high	Check parameters
E558	IPO – path acceleration too low	Check parameters
E559	Input field too small	Error in user program
E560	Rotary encoder error on synchronization	Hardware error

Error messages in automatic mode Part 3:

Code	Run error message	Further information - Troubleshooting
E561	Program already running	Program can only be started once
E562	RS232 communication was disconnected	Check cabling, handshake lines
E563	Manuell approach to reference point: positive limit switch actuated	Rotational and limit switch direction incorrect
E564	Incorrect program type	Call of an incorrect program (PTX)
E565	INTERBUS_S emergency stop	INTERBUS_S was disconnected
E566	Axis not ready	Check standby power section
E567	Increments of axis range greater than 31 bits	Check definition of traversing range
E568	Approach to reference point not possible	Check servoTEC communication
E569	STORE command executed incorrectly	Check placeholder for characters in the program
E570	Number of revolutions greater than maximum	Check definition of traversing range **Formula for calculation of the speed N:** $N = \frac{(traversingrangemax - traversingrangemin)*gearfactor}{PGEARI\,[PGEARI - servoTEC - parameter]}$ (PGEARI – servoTEC parameters) **IMPORTANT**: The following applies up to version V4.72 No. of rev. < 1024
E571	Command not possible with this axis	Program error
E572	Reserve, not assigned at present	
E573	Any CANopen device SDO TIME-OUT	Check whether CANopen device connected
E574	String too long	The result string would be longer than 80 characters if strings are added
E575	Traversing speed greater than 16 bits	The value would be greater than a 16 bit value in the case of a traversing command for a servoTEC axis
E576	Value cannot be read stably	
E577	Incorrect jump target	The commands JMP-LINE or JMP-LINE-IPO jump to an invalid program line
E578	Traverse of the servoTEC axis too long	The traverse for a traversing command is limited to a number of revolutions - up to V4.73I : 1022 revolutions - from 4.74 or higher

Error messages in automatic mode Part 4 :

Code	Run error message	Further information - Troubleshooting
E579	Command not allowed in the initial position program	A command is to be executed in the "initial position" program which is not enabled for this program type e.g: - A1:= - RUN
E580	ServoTEC axis, PRBASE wrong	
E581	Name of program with illegal characters	
E582	Axis was moved in state IDLE/SAFE	
E583	Axis not in state DRIVE ENABLED	
E584	Axis not in state HALT	
E585	Axis , time out at stop axis	
E586	Axis in state DISABLED	
E587	Temperature controller not exist	
E588	AD-converter not exist	
E589	Counter not exist	
E590	Command not executable	
E591	Axis release mode = 4, not usable with IPO-commands	
E592	Gantry-mode out of range	
E593	Gantry-SLAVE-Axis cannot be moved by a command	
E594	G183- and G700-commands cannot be used at the same time	

7.1.2.9 Communication errors:

Code	Run error message	Further information - Troubleshooting
E600	IEF module slot number not allowed	Insert module in permissible slot
E601	COM port number not allowed	Programming error
E602	COM port not installed	Addressed COM port unavailable
E603	COM port not initialized	Programming error
E604	COM port not empty for sending	Previous transmission not yet ended Programming error, Port disabled, hardware handshake
E605	COM port hardware handshake disabled	Check parameter setting and device
E606	COM port data format incorrect	Parameter setting
E607	COM port hardware not empty for sending	Previous transmission not yet ended Programming error, Port disabled, hardware handshake

7.1.2.10 Errors of the absolute dimension system:

Code	Run error message	Further information - Troubleshooting
E620	Absolute positioning system unavailable	SSI hardware error
E621	Absolute positioning system not referenced	Carry out approach to reference point
E622	Reserve, not assigned at present	
E623	Absolute positioning system SSI module not ready	Check SSI module (connection and wiring)
E624	Absolute positioning system DIN-T0 error	Parameter error
E625	Absolute positioning system DIN-Tn+ error	Parameter error
E626	Absolute positioning system initialization timeout error	Check SSI module (connection and wiring)

7.1.2.11 CANopen LV-servoTEC error:

Code	Run error message	Further information - Troubleshooting
E900	Different parameters in PA-CONTROL and LV-servoTEC	Adjust parameter value
E901	Different obligatory parameters in PA-CONTROL and LV-servoTEC	Adjust parameter value
E902	Different reference parameters in PA-CONTROL and LV-servoTEC	Adjust parameter value

7.1.2.12 Fehlermeldungen zu den Gantry-Achsen

Code	Run-error-message	Further information - troubleshooting
E910	Gantry axis parameter unequal : gear factor	
E911	Gantry axis parameter unequal : motor steps per revolution	
E912	Gantry axis parameter unequal : release mode	
E913	Gantry axis parameter unequal : power-on support mode	
E914	Gantry axis parameter unequal: OFF ramp	
E915	Gantry axis parameter unequal: STOP axis input no.	
E916	Gantry axis parameter unequal: START axis input no.	
E917	Gantry axis parameter unequal: OFF axis input no.	
E918	Gantry axis parameter unequal: ON axis input no.	
E919	Gantry axis undefined : gantry limit switch input no.	
E920	Gantry axis undefined: gantry limit switch output no.	
E921	Gantry axis parameter distance between reference point and zero is unequal 0	
E922	Insufficient memory space to generate the PNX program list for IEF-Touch	

7.1.2.13 PLS7- Run error message

Code	CPU-Run error message	Further information - Troubleshooting
2	Bus error	Change the PLS7-card
3	Address error	- „ -
4	Unimplemented command	- „ -
5	Division by zero	- „ -
6	Command chk	- „ -
7	Command Trapv	- „ -
8	Privilege violation	- „ -
9	Trace	- „ -
10	Emulator 1	- „ -
11	Emulator 2	- „ -
15	Uninitialized interrupt	- „ -
24	Incorrect interrupt	- „ -
101	Uninitialized auto-vector1	- „ -
102	Uninitialized auto-vector2	- „ -
103	Uninitialized auto-vector3	- „ -
104	Uninitialized auto-vector4	- „ -
105	Uninitialized auto-vector5	- „ -
106	Uninitialized auto-vector6	- „ -
107	Uninitialized auto-vector7	- „ -
110	Uninitialized nonauto interrupt	- „ -
120	Uninitialized trap vector	- „ -
130	Uninitialized co-processor vector	- „ -
401	Generator 1 load “Time out”	- „ -
402	Generator 2 load “Time out”	- „ -
403	Generator 3 load “Time out”	- „ -
404	Generator 4 load “Time out”	- „ -
501	Checksum error at load generator 1	- „ -
502	Checksum error at load generator 2	- „ -
503	Checksum error at load generator 3	- „ -
504	Checksum error at load generator 4	- „ -
999	Software-Watchdog	- „ -

7.2 Basic board

The following form the basis of the PA-CONTROL MP:

- Power supply board
- CPU
- Logic power supply unit

The functional possibilities can be expanded by means of various IEF modules (see also Section *6: Options, page 143 onwards*).

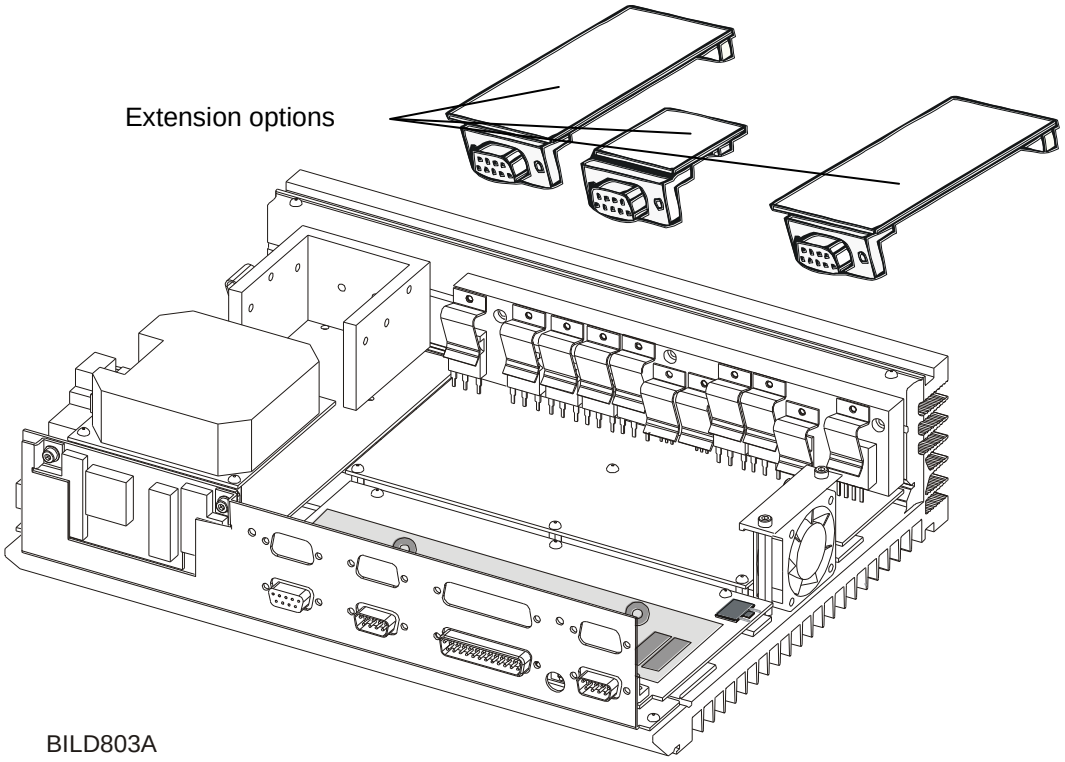

Figure 89: Overview of the PA-CONTROL MP

CAUTION

The power and logic sections in the device are electrically isolated in accordance with EN 50178.

7.2.1 Power supply unit

- Supply directly from the mains (180 to 263VAC)
- Mains frequency 50Hz / 60Hz
- Security against supply voltage dip - 1 cycle
- Motor voltage 90 VDC
- PFC circuit for sinusoidal current input in accordance with EN 61000 T3/2

7.2.2 Logic power supply unit

- Input voltage 24VDC
- Output 5V DC for CPU
- Output 5V DC for CANopen-Bus
- Output 5.3 VDC for encoder
- Output 15 VDC for motor output stage

All voltages are electrically isolated from each other.

7.2.3 Fuses

Description	Location	Function	Value
Fuse 1 (Si1)	Mains filter board	Fusing of the mains voltage supply	T 6.3 A
Fuse 2 (Si2)	Power supply unit	Fusing of the DC link voltage	F 1 / 440V soldered in
Fuse 3 (Si3)	Logic power supply unit	Fusing of all logic voltages	T2A

CAUTION

Disconnect the controller and wait for the capacitors to discharge before exchanging the fuses.

7.3 Connector assignments

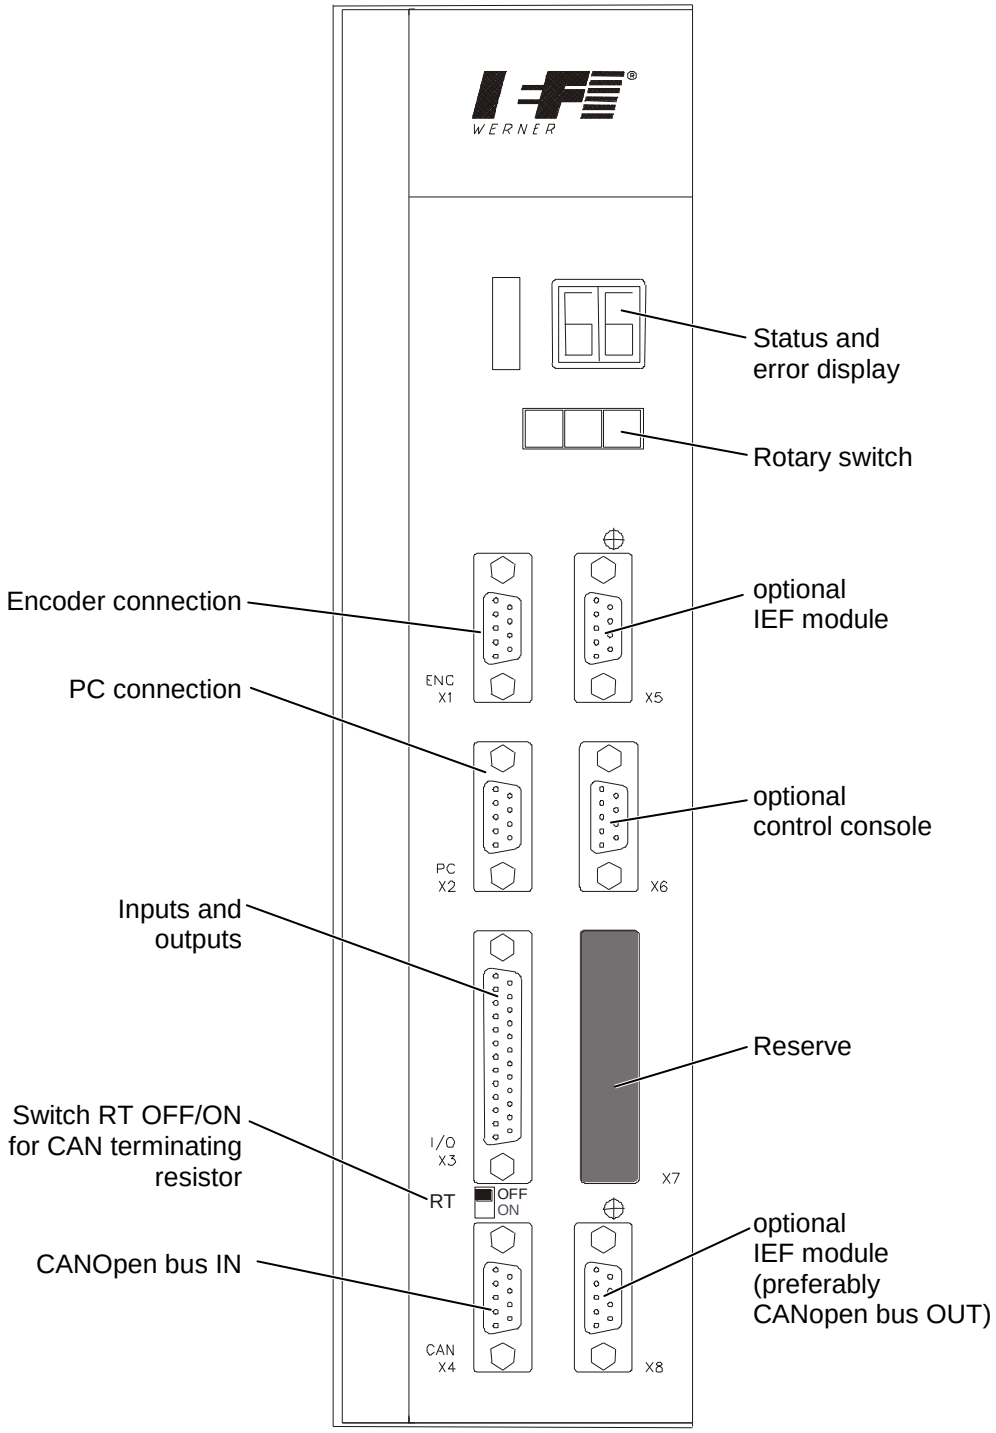

Figure 90: PA-CONTROL MP, overview of the plug-in connections

In addition to the illustrated plug-in connections X1 to X8, the plug-in connections X9 (brake), X10 (stepping motor) and X11 (mains voltage) are located on the top. Please *refer to chapter 6.3* Rotary switches of the PA-CONTROL MP*, page 144,* for the purpose of the rotary switch and the principle of operation of the switch "RT".

7.3.1 Encoder connection X1

Rotation monitoring is activated by means of the WINPAC program via the menu items Settings / PA-Control / Axis / Motor parameters.

A rotary encoder (with e.g. 50 increments per motor revolution) must be connected via the plug-in connection "ENC X1" for active rotation monitoring.

A power supply of 5V with a current of up to 150mA is available for the rotary encoder. The rotary encoder output signal channels A and B are square-wave signals out of phase by 90°. They must be executed as 5V push-pull signals (RS422 agreement). The output signal channel "C" is the zero pulse per revolution.

NOTE

1. The motor wiring and the encoder connection must be connected as per the documentation. Any required change in the direction of rotation may only be made by means of the switch-over facility in WINPAC [Settings] [PA-Control] [Axis] [Motor parameters] and not by rewiring a motor winding.
2. A phase test is carried out approx. 2.5 seconds after the controller has been switched on (check of the wiring for W1 and W2). If no error message is output, the motor is put under voltage and the contact for the brake closed. The motor and rotary encoder positions are subsequently set to zero.

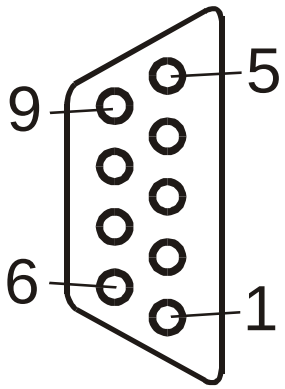

1	A+
2	+5V / 100mA
3	C+
4	C-
5	B-
6	A-
7	+5V / 100mA
8	GND
9	B+

Figure 91: Assignment of the encoder port (Sub-D, 9 poles, socket)

7.3.2 Diagnosis port (X2)

The diagnosis port is a serial asynchronous port of the type RS232. The port is permanently set to 19.2K baud, 1 stop bit, 8 data bits and 1 parity bit (odd).

The diagnosis port is reserved for diagnostic purposes and cannot be used to communicate with other devices in the plant in the automatic mode (program).

Regardless of the operating mode of the device, it can be accessed via the diagnosis port at any time. Some actions cannot be executed via the diagnosis port, depending on the operating mode of the device.

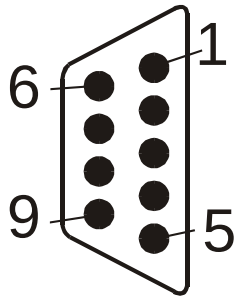

1	DCD, Reception level
2	RXD, Receive Data
3	TXD, Transmit Data
4	DTR, Terminal ready
5	GND
6	N.C.
7	RTS, switch on transmitter
8	CTS, ready for transmission
9	RI, ready for transmission

Figure 92: Assignment of the diagnosis port (Sub-D, 9 poles; pins)

NOTE

Assignment complies with asynchronous standard RS232!

A shielded line must be used to guarantee the trouble-free exchange of data.

PA-CONTROL			PC (9 poles)	
DCD	1	-	DTR	4
RXD	2	-	TXD	3
TXD	3	-	RXD	2
DTR	4	-	DCD	1
GND	5	-	GND	5
N.C.	6			6
RTS	7	-	CTS	8
CTS	8	-	RTS	7
RI	9	-	RI	9

Figure 93: Assignment of the connection cable between PA-CONTROL and PC

7.3.3 Inputs and outputs (X3)

7.3.3.1 Digital outputs

- Number: 8
- 24 VDC / 0.5A (ohmic load)
- Opto-decoupled
- Short-circuit proof
- Switching positive
- max. output voltage 30V, max. 2A (sum of all outputs)

7.3.3.2 Digital inputs

- 24V DC / typical input current 5mA
- Opto-decoupled
- Secured against incorrect polarity
- High level (12-30) VDC
- Low level (0-3) VDC

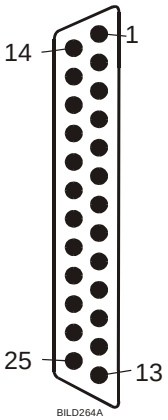

1	Input 1	14	Output 1
2	Input 2	15	Output 2
3	Input 3	16	Output 3
4	Input 4	17	Output 4
5	Input 5	18	Output 5
6	Input 6	19	Output 6
7	Input 7	20	Output 7
8	Input 8	21	Output 8
9	Input 9	22	24V for outputs
10*	Input 10	23	0V(GND) for outputs
11	Limit switch positive	24	0V(GND) for outputs
12	Limit switch negative	25	System supply (0V) GND
13	System supply 24VDC		

Figure 94: Assignment X3, inputs and outputs (Sub-D, 25 poles, pins)

The inputs can be scanned and the outputs changed by means of the WINPAC program (Menu items: Settings / PA-CONTROL MP / System I/O).

On delivery, input 10 is defined as "External stop".

NOTE This can be changed by the user via WINPAC. The definition of an input as "External stop" is not mandatory. Automatic and online-mode do not require an input defined as "External stop".

7.3.4 CANopen interface X4

The PA-CONTROL MP has been provided with a CANopen interface. This interface is used for the optional expansion of PA-CONTROL. Communication with other devices is possible via the CAN bus. Please refer to the "CAN bus documentation" for further information.

Technical Data:

- Baud rate: 500KBaud (can be altered)
- Max. bus cable length: 25m

To ensure operator-friendliness and an uncomplicated initial start-up (Plug & Play), some specifications have been made for the connection of instruments to the CANopen bus and their addresses (ID numbers).

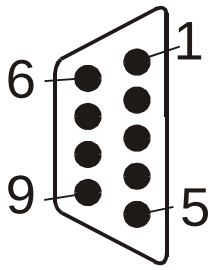

1	N.C.
2	CAN_L
3	CAN_GND
4	N.C.
5	N.C.
6	(GND)
7	CAN_H
8	N.C.
9	(CAN_V+)

Figure 95: CANopen bus, connector assignment, Sub-D, 9 poles; pins

NOTE DIN ISO 11898 must be complied with when the CAN bus is installed.

7.3.5 IEF module (X5, X6, X8)

The various IEF modules offered as a control option are available to the user via slots X5 and X8.

It should be noted that all the offered IEF modules can only be used on slot X5 (internally J7). All the IEF modules are permissible on slot X8 (internal J6) with the exception of the profibus module. Slot X6 is provided for the RS232 interface of the operating terminal.

Please *refer to section 6.5 RS 232 Port Driver, page 147.*

7.3.6 Brake connector X9

The PA-CONTROL MP offers the possibility of operating motors with brakes. The brake opens on application of a voltage of 24VDC. However, the prerequisite is that a voltage of 24VDC is connected to connections 1 and 2 as per *Figure 96, below.*

When the PA-CONTROL MP is switched on, a motor test is carried out. After the motor test has been successfully completed, the brake is opened, i.e. a contact internally connects PIN 2 to PIN3. If a malfunction occurs, the brake is taken off current.

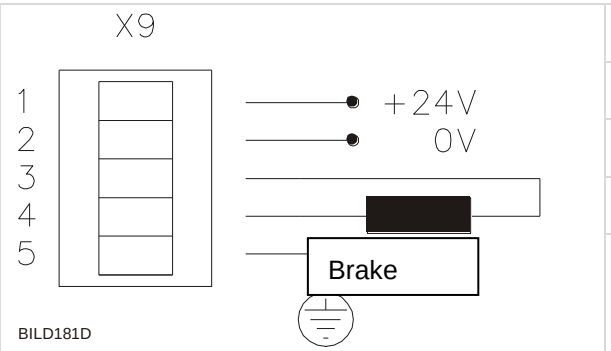

1	Brake voltage +24V
2	Brake voltage GND
3	- Connection for brake coil
4	+ Connection for brake coil
5	PE for brake

Figure 96: Connector assignment for the brake connector

7.3.7 Motor connector (X10)

The PAC-CONTROL MP is a 2 phase power output stage. The motor cable is connected via the plug-in connection X10 on top of the PA-CONTROL MP.

This power output stage has the following features:

- Constant current output stage, current up to 12A in accordance with the PWM* principle
- Step resolution 3200 steps per revolution, dynamic changeover up to full-step operation
- Short-circuit, short circuit to ground and supply voltage monitoring
- Undervoltage, overvoltage and temperature monitoring
- Cable monitoring on switch-on
- Rotation monitoring for motors with an encoder
- Triggering of the rotation monitoring at a difference of ± 4 full steps of the nominal value
- Motor voltage circuit executed externally

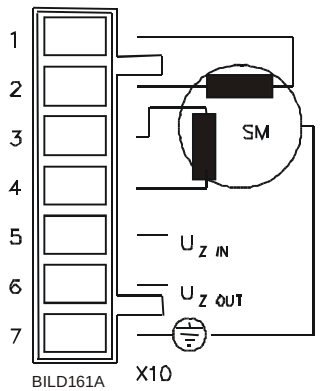

1	Motor winding 1
2	Motor winding 1
3	Motor winding 2
4	Motor winding 2
5	DC link in
6	DC link out
7	PE, system earth

Figure 97: Connector assignment of the motor connector

WARNING

Connectors may only be inserted or removed in a no-voltage condition! A maximum voltage of 140VDC can be applied at the connections U_{zin}-U_{zout}.

* Pulse-width modulation

7.3.8 Mains connector X11

The complete power supply to the power and logic sections of the controller is effected via the mains connector.

Connector assignment:

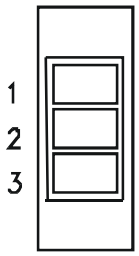

Connection	230VAC with L1/N/PE	USA supply network between two phases
1	PE	PE
2	N	L2
3	L1	L1

Figure 98: Connector assignment of the mains connector

WARNING

Connectors may only be inserted or removed in a non-voltage condition

7.4 Overview of accessories and spare parts

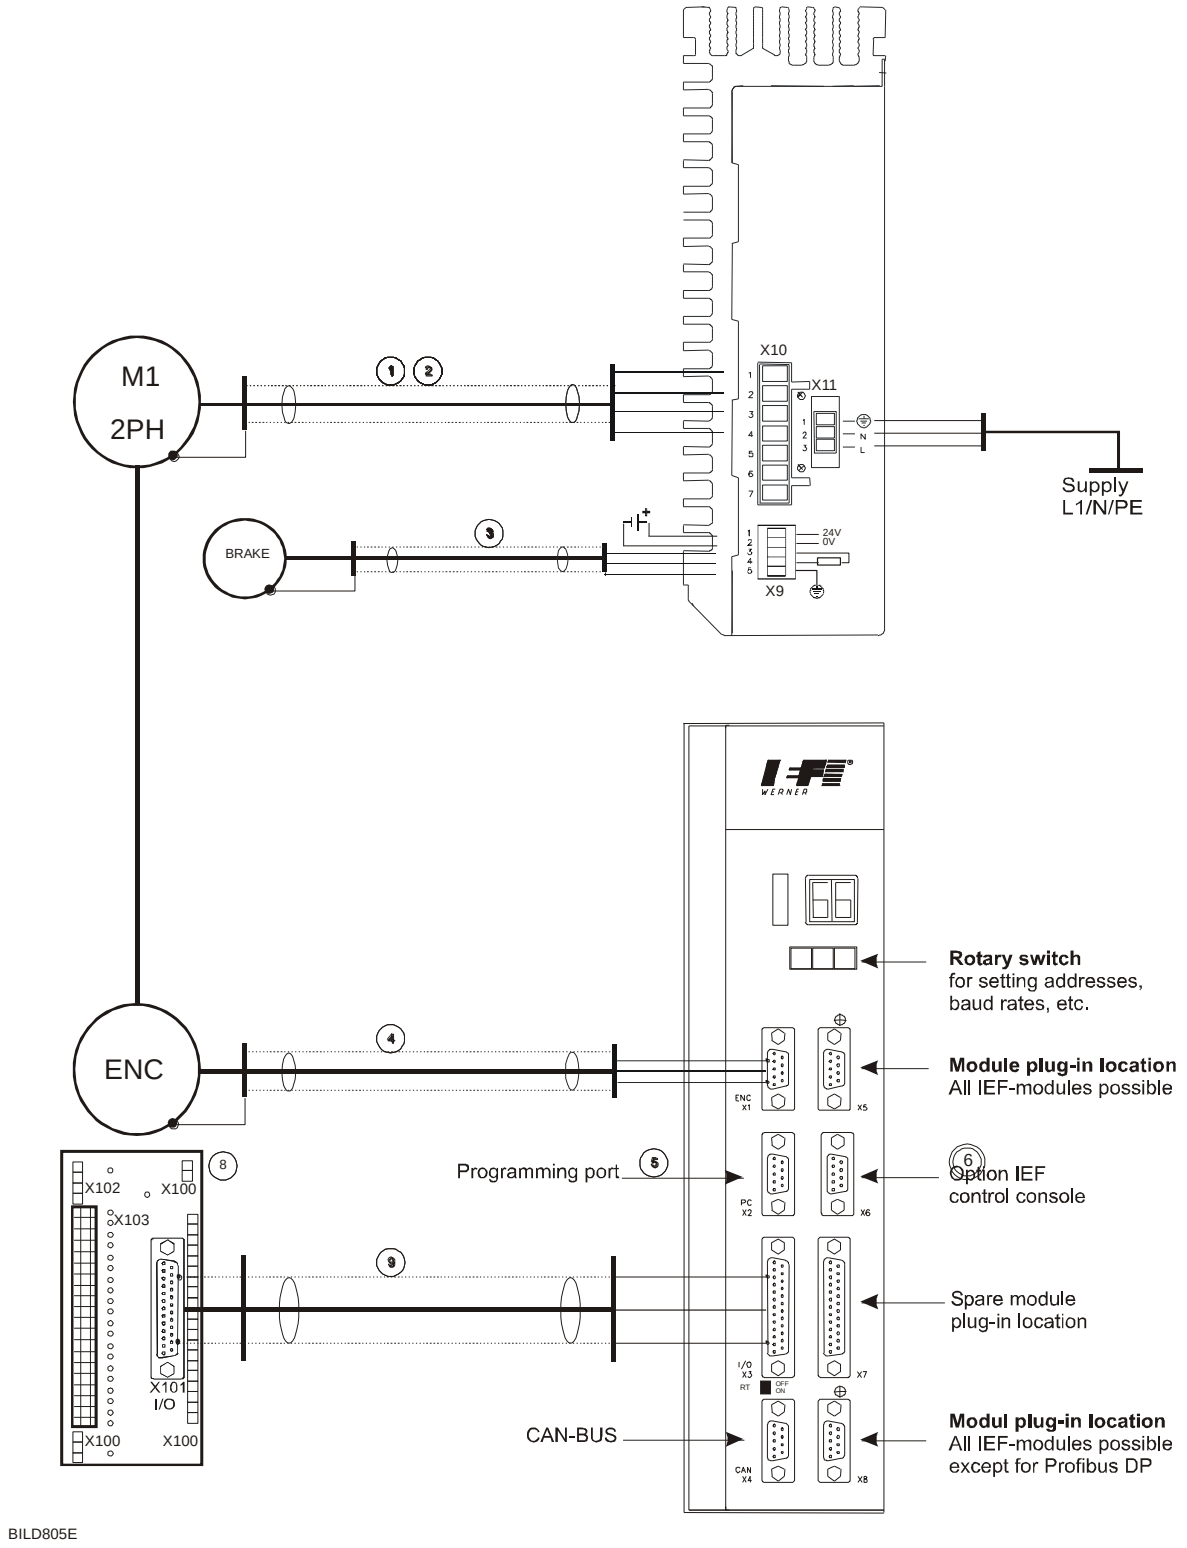

Figure 99: Overview

7.4.1 List of accessories and spare parts

No.	Description	IEF no. (Standard length)		IEF no. (Special length)	
		Connector on motor		Connector on motor	
1	Motor cable PA-CONTROL MP 2Ph 5x1.0² Motors up to 8 amperes (open cable head)	231 780	-	231 783	231 778
	Motor cable PA-CONTROL MP 2Ph 5 x 1.0² Motors up to 8 amperes (with circular connector RC 6)	-	231 777	-	231 778
2	Motor cable PA-CONTROL MP 2Ph 5 x 1.5² Motors up to 12 amperes (open cable head)	231 781	-	231 784	-
	Motor cable PA-CONTROL MP 2Ph 5 x 1.5² Motors up to 12 amperes (with circular connector RC 6)	-	231 795	-	231 796
3	Brake cable PA-CONTROL MP (open cable head)	231 782	-	231 785	-
	Brake cable PA-CONTROL MP (with connector)		231 798		231 799
4	Rotation monitoring line type 2Ph (open cable head)	230 804	-	230 979	-
	Rotation monitoring line type 2Ph (with connector)	-	230 781	-	230 782
5	Interface cable PC ↔ PA-CONTROL MP	231 766		-	
6	IEF control console	231 764		-	
	Port for IEF control console	527 452		-	
	Interface cable for IEF control console	231 766		1002839	
7				-	
	ASi signal line	-		734 053	

Continued

No.:	Description	IEF no. (Standard length)	IEF no. (Special length)
With wiring module			
8	Wiring module MP/SC/Single Varioface 25 poles	734 783	-
9	I/O cable 25 poles 25x0.34	231 601	231 602
Without wiring module:			
10	Limit switch cable 1A 1x5x0,25 open	231 542	231 543
11	I/O cable 25 poles 25x0.34 open	231 603	231 603
12	WINPAC (prog. development system)	231 726	
13	Software update PA-CONTROL MP	230 714	
Option	RS 232 port	527 450	
Option	Profibus-DP interface	527 184	
Option	A-D converter	527 451	
Option	ASi master	527 449	
Option	IEF control console	231 764	

7.5 Service

NOTE Service work may only be carried out by authorized personnel!

7.5.1 Exchange of the battery on the CPU board

The internal battery has a guaranteed service life of 5 years. The battery should be replaced before this date, in order to prevent data loss.

NOTE Always switch on the 24VDC control voltage supply or the 230VAC supply voltage, in order to exchange the battery without data loss.

Procedure:

- Order a replacement battery from IEF-Werner (new battery with connection cable in the battery box)
- Carry out a data backup (programs and parameters) by means of the WINPAC program
- Remove jumper (*see Figure 89 on page 199 and Figure 100*)
- Insert connector of the connection cable (*see Figure 100)*,
- Mount the battery box in the switch cabinet below the controller

Note:

The battery can of course be exchanged by your own service personnel. However, we recommend that this is carried out by the service division of IEF-Werner.

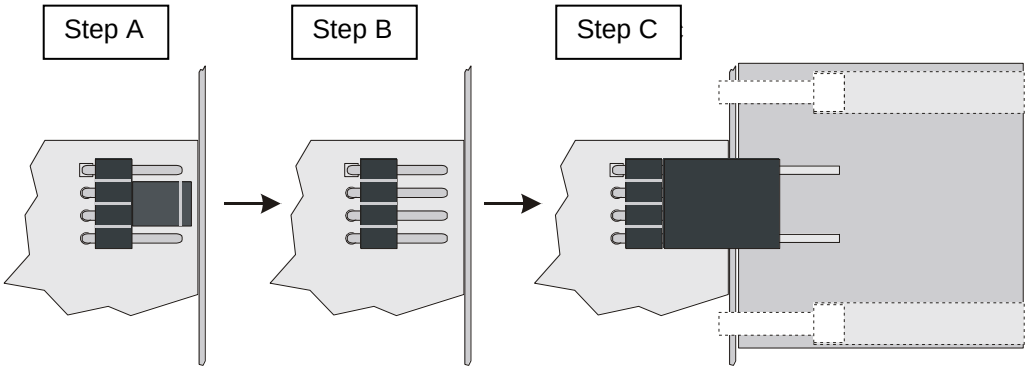

Figure 100: Sequence of operations

7.6 Outside measurements

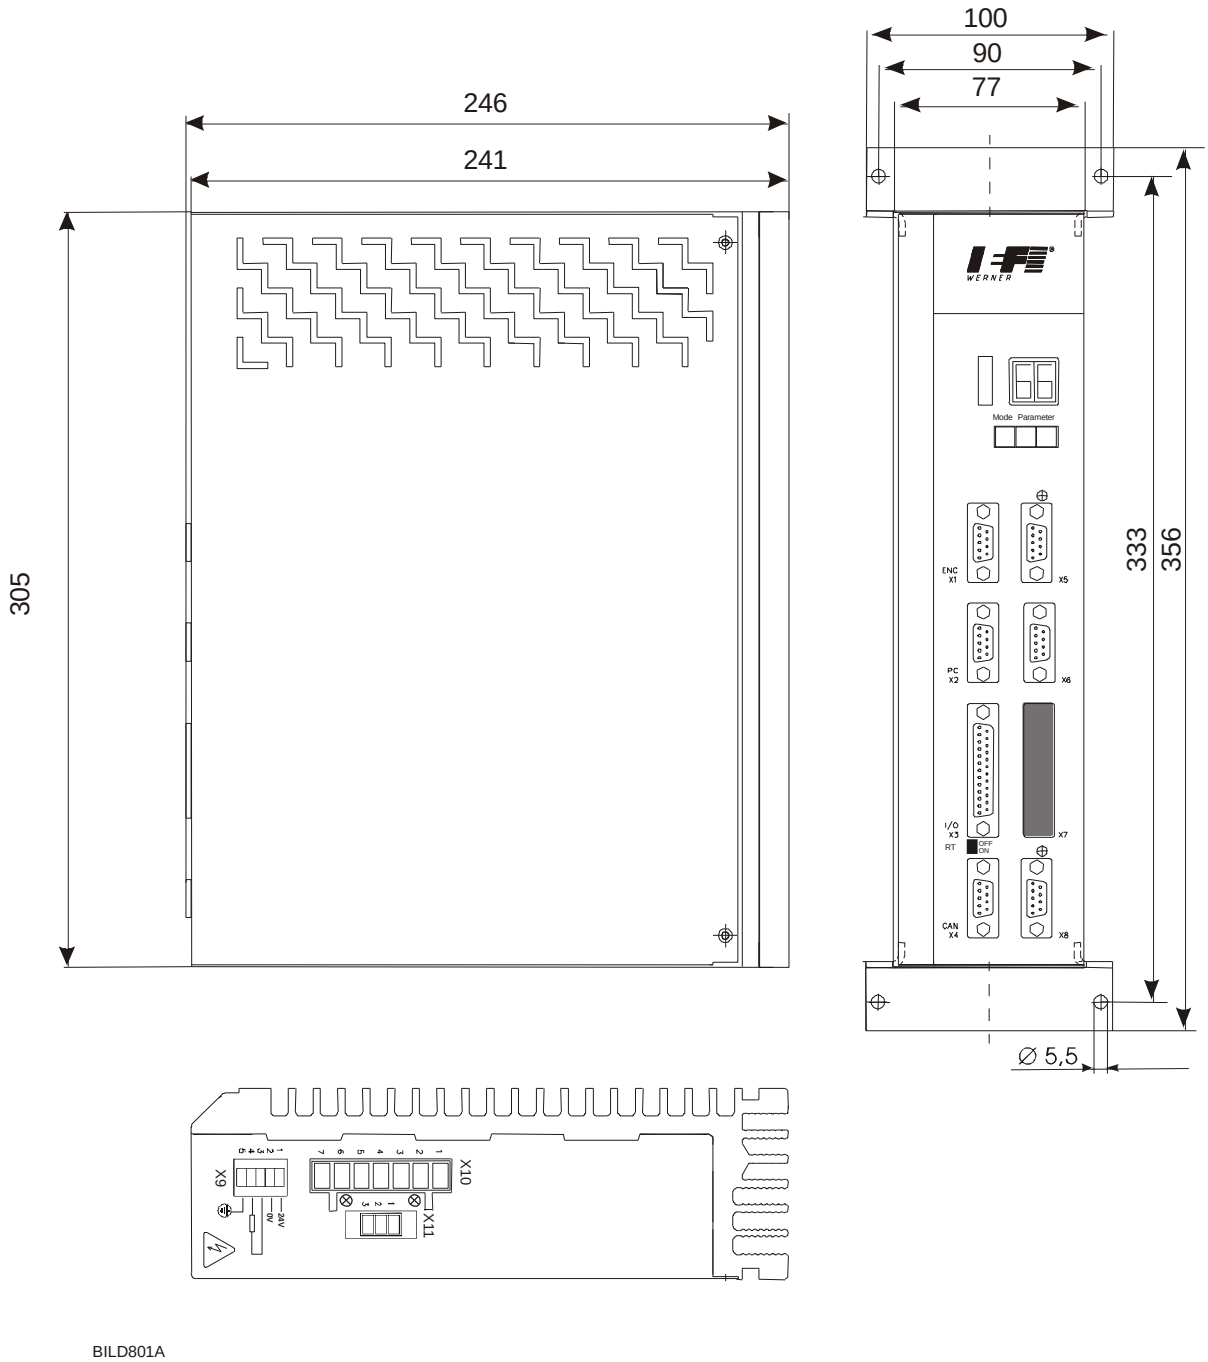

Figure 101: PA-CONTROL MP, outside measurements

7.7 PA-CONTROL key code (+ ASCII character set to ISO/IEC 8859-15)

Dec	Hex	Character	PAC Keyboard
0	0	NUL	
1	1	SOH	
2	2	STX	
3	3	ETX	
4	4	EOT	
5	5	ENQ	
6	6	ACK	
7	7	BEL	
8	8	BS	Shift+DEL
9	9	HT	
10	A	LF	
11	B	VT	
12	C	FF	
13	D	CR	ENTER
14	E	SO	
15	F	SI	
16	10	DLE	
17	11	DC1	
18	12	DC2	
19	13	DC3	
20	14	DC4	
21	15	NAK	
22	16	SYN	
23	17	ETB	
24	18	CAN	
25	19	EM	
26	1A	SUB	
27	1B	ESC	ESC/Shift+ESC
28	1C	FS	
29	1D	GS	
30	1E	RS	
31	1F	US	
32	20	SP	SPACE BAR
33	21	!	Shift+1
34	22	„	Shift+2
35	23	#	
36	24	$	Shift+4
37	25	%	Shift+5
38	26	&	Shift+6
39	27	‘	
40	28	(	Shift+8
41	29	)	Shift+9
42	2A	*	Shift++
43	2B	+	+
44	2C	,	,
45	2D	-	-
46	2E	.	.

Dec	Hex	Character	PAC Keyboard
47	2F	/	Shift+7
48	30	0	0
49	31	1	1
50	32	2	2
51	33	3	3
52	34	4	4
53	35	5	5
54	36	6	6
55	37	7	7
56	38	8	8
57	39	9	9
58	3A	:	Shift+ .
59	3B	;	Shift+ ,
60	3C	<	<
61	3D	=	Shift+0
62	3E	>	Shift+<
63	3F	?	Shift+3
64	40	@	Ctrl+Q
65	41	A	Shift+A
66	42	B	Shift+B
67	43	C	Shift+C
68	44	D	Shift+D
69	45	E	Shift+E
70	46	F	Shift+F
71	47	G	Shift+G
72	48	H	Shift+H
73	49	I	Shift+I
74	4A	J	Shift+J
75	4B	K	Shift+K
76	4C	L	Shift+L
77	4D	M	Shift+M
78	4E	N	Shift+N
79	4F	O	Shift+O
80	50	P	Shift+P
81	51	Q	Shift+Q
82	52	R	Shift+R
83	53	S	Shift+S
84	54	T	Shift+T
85	55	U	Shift+U
86	56	V	Shift+V
87	57	W	Shift+W
88	58	X	Shift+X
89	59	Y	Shift+Y
90	5A	Z	Shift+Z
91	5B	[	Ctrl+8
92	5C	\	
93	5D	]	Ctrl+9

Dec	Hex	Character	PAC Keyboard
94	5E	^	
95	5F	_	Shift+ -
96	60	´	
97	61	a	A
98	62	b	B
99	63	c	C
100	64	d	D
101	65	e	E
102	66	f	F
103	67	g	G
104	68	h	H
105	69	i	I
106	6A	j	J
107	6B	k	K
108	6C	l	L
109	6D	m	M
110	6E	n	N
111	6F	o	O
112	70	p	P
113	71	q	Q
114	72	r	R
115	73	s	S
116	74	t	T
117	75	u	U
118	76	v	V
119	77	w	W
120	78	x	X
121	79	y	Y
122	7A	z	Z
123	7B	{	Ctrl+7
124	7C	|	
125	7D	}	Ctrl+0
126	7E	~	
127	7F	DEL	
128	80	PAD	
129	81	HOP	
130	82	BPH	
131	83	NBH	
132	84	IND	
133	85	NEL	
134	86	SSA	
135	87	ESA	
136	88	HTS	
137	89	HTJ	
138	8A	VTS	
139	8B	PLD	
140	8C	PLU	

Dec	Hex	Character	PAC Keyboard
141	8D	RI	
142	8E	SS2	
143	8F	SS3	
144	90	DCs	
145	91	PU1	
146	92	PU2	
147	93	STS	
148	94	CCH	
149	95	MW	
150	96	SPA	
151	97	EPA	
152	98	SOS	
153	99	SGCI	
154	9A	SCI	
155	9B	CSI	
156	9C	ST	
157	9D	OSC	
158	9E	PM	
159	9F	APC	
160	A0	NBSP	
161	A1	¡	
162	A2	¢	
163	A3	£	
164	A4	€	
165	A5	¥	
166	A6	Š	
167	A7	§	
168	A8	š	
169	A9	©	
170	AA	ª	
171	AB	«	
172	AC	¬	
173	AD	SHY	
174	AE	®	
175	AF	¯	
176	B0	°	
177	B1	±	
178	B2	²	
179	B3	³	
180	B4	Ž	
181	B5	µ	
182	B6	¶	
183	B7	·	
184	B8	ž	
185	B9	¹	
186	BA	º	
187	BB	»	

Dec	Hex	Character	PAC Keyboard
188	BC	Œ	
189	BD	œ	
190	BE	Ÿ	
191	BF	¿	
192	C0	À	
193	C1	Á	
194	C2	Â	
195	C3	Ã	
196	C4	Ä	Alt+A
197	C5	Å	
198	C6	Æ	
199	C7	Ç	
200	C8	È	
201	C9	É	
202	CA	Ê	
203	CB	Ë	
204	CC	Ì	
205	CD	Í	
206	CE	Î	
207	CF	Ï	
208	D0	Ð	
209	D1	Ñ	
210	D2	Ò	
211	D3	Ó	
212	D4	Ô	
213	D5	Õ	
214	D6	Ö	Alt+O
215	D7	×	
216	D8	Ø	
217	D9	Ù	
218	DA	Ú	
219	DB	Û	
220	DC	Ü	Alt+U
221	DD	Ý	
222	DE	Þ	START
223	DF	ß	
224	E0	à	
225	E1	á	
226	E2	â	
227	E3	ã	
228	E4	ä	Ctrl+A
229	E5	å	
230	E6	æ	
231	E7	ç	
232	E8	è	
233	E9	é	

Dec	Hex	Character	PAC Keyboard
234	EA	ê	
235	EB	ë	
236	EC	ì	
237	ED	í	
238	EE	î	
239	EF	ï	
240	F0	ð	
241	F1	ñ	
242	F2	ò	
243	F3	ó	
244	F4	ô	
245	F5	õ	
246	F6	ö	Ctrl+O
247	F7	÷	
248	F8	ø	
249	F9	ù	
250	FA	ú	
251	FB	û	
252	FC	ü	Ctrl+U
253	FD	ý	
254	FE	þ	
255	FF	ÿ	

Additions

Dec	Hex	PAC Keyboard
294	126	Alt+L
327	147	Shift+Arrow left
328	148	Arrow up
329	149	Shift+Arrow up
331	14B	Arrow left
333	14D	Arrow right
335	14F	Shift+Arrow right
336	150	Arrow down
337	151	Shift+Arrow down
338	152	INS Shift+INS
339	153	DEL
		Ctrl+Arrow left
		Ctrl+Arrow right
397	18D	Ctrl+DEL